Savannah River NUCLEAR SOLUTIONS℠

Seventh Five-Year Remedy Review Report for Savannah River Site Operable Units with Engineered Cover Systems (U)

Aiken, South Carolina

SEMS Number: 00

SRNS-RP-2025-01064

Revision 1

August 2026

SAVANNAH RIVER SITE • AIKEN, SOUTH CAROLINA

DISCLAIMER

This document was prepared in conjunction with work accomplished under Contract No. DE-AC09-08SR22470 with the U. S. Department of Energy.

This work was prepared under an agreement with and funded by the U.S. Government. Neither the U.S. Government or its employees, nor any of its contractors, subcontractors or their employees, makes any express or implied: 1. Warranty or assumes any legal liability for the accuracy, completeness, or for the use or results of such use of any information, product, or process disclosed; or 2. Representation that such use or results of such use would not infringe privately owned rights; or 3. endorsement or recommendation of any specifically identified commercial product, process, or service. Any views and opinions of authors expressed in this work do not necessarily state or reflect those of the United States Government, or its contractors, or subcontractors.

Printed in the United States of America

Prepared for
U.S. Department of Energy
and
Savannah River Nuclear Solutions, LLC
Aiken, South Carolina

11/9/2026 KAREN MORROW Digitally signed by KAREN MORROW Date: 2026.11.09 09:24:42 -05'00'

Date

Karen D. Morrow
Office Director for Closure and Project Management
Savannah River Operations Office
Office of Environmental Management
U. S. Department of Energy

Date

Juli E. Blalock, Chief
Bureau of Land and Waste Management
South Carolina Department of Environmental Services

This page is intentionally left blank.

EXECUTIVE SUMMARY

This document presents the results of a technical evaluation of environmental remedies that implemented engineered cover systems at Savannah River Site. The remedies are evaluated to determine whether they are functioning as designed and whether they are protective of human health and the environment. This evaluation is required under Section 121 of the Comprehensive Environmental Response, Compensation, and Liability Act, as amended by the Superfund Amendments and Reauthorization Act of 1986. Comprehensive Environmental Response, Compensation, and Liability Act requires remedial actions that result in any hazardous substances, pollutants, or contaminants remaining at the site above levels that allow for unlimited use and unrestricted exposure to be subject to a remedy review every five years.

Due to the large number of Savannah River Site remedial decisions, U.S. Department of Energy, U.S. Environmental Protection Agency, and South Carolina Department of Environmental Services agreed to conduct the remedy reviews in five phases, approximately one year apart, with operable units grouped by the following remedy types: (1) native soil covers and/or land use controls; (2) groundwater; (3) engineered cover systems; (4) geosynthetic or stabilization/ solidification cover systems; and (5) operating equipment. This is the third phase of the Seventh Five-Year Remedy Review Report, with this report evaluating Savannah River Site operable units that have engineered covers as part of the final remedy.

According to the data reviewed and the site inspections, the remedies evaluated in this report are functioning as intended. The exposure assumptions, toxicity data, cleanup levels, and remedial action objectives used at the time of remedy selection are still valid. No new information has come to light that calls into question the protectiveness of any of the remedies evaluated. The remedies have been determined to be protective of human health and the environment. A recommendation to discontinue water-level measurements at the Central Shops Burning/Rubble Pits (631-1G and 631-3G) has been proposed since the water-level measurements have remained well below the bottom of the basin for more than five years and meets the requirements of three consecutive years of decreasing water level in Pit 631-3G as stated in the *Post-Construction Report (PCR)/Corrective Measures Implementation Report (CMIR)/Final Remediation Report (FRR) for the Central Shops*

Burning/Rubble Pits (631-1G and 631-3G/3GA) Operable Unit (U) (WSRC-RP-2004-4014, Revision 1, February 2005).

Table of Contents

Section		Page
Executive Summary		ES-1
List of Figures		ii
List of Tables		ii
List of Appendices		iii
List of Acronyms and Abbreviations		v
I.	Introduction	1
II.	Response Action Summary	6
III.	Progress Since Last Review	10
IV.	Five-Year Remedy Review Process	11
V.	Technical Assessment	14
VI.	Issues/Recommendations	16
VII.	Protectiveness Statement(s)	16
VIII.	Next Review	17
IX.	OU-Specific Five-Year Remedy Review Reports	17
X.	References	17

LIST OF FIGURES

Figure		Page
Figure 1.	Location Map for SRS OUs with Engineered Cover Systems	21

LIST OF TABLES

Table		Page
Table 1.	Five-Year Review Summary Form	23
Table 2.	SRS OUs with Engineered Cover Systems	25
Table 3.	LUC Summary Table	27
Table 4.	Operation and Maintenance Cost Comparison for SRS OUs with Engineered Cover Systems	31
Table 5.	Protectiveness Determination/Statements from the Sixth Five-Year Remedy Review for SRS OUs with Engineered Cover Systems (SRNS 2018a)	33
Table 6.	Operable Units without Issues and Recommendations in the Seventh Five-Year Remedy Review Report	34
Table 7.	Issues and Recommendations Identified in the Seventh Five-Year Remedy Review Report	34
Table 8.	Protectiveness Statements for the Seventh Five-Year Remedy Review Report for SRS OUs with Engineered Cover Systems	35

LIST OF APPENDICES

Appendices		Pages
Appendix A	Seventh Five-Year Remedy Review Report Phased Reviews	A-1
Appendix B	Evaluation of Changes in Standards and Toxicity	B-1
Appendix C	Central Shops Burning/Rubble Pits (631-1G/631-3G)	C-1
Appendix D	D-Area Burning/Rubble Pits (431-D/431-1D)	D-1
Appendix E	F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, 904-43G])	E-1
Appendix F	Ford Building Seepage Basin (904-91G)	F-1
Appendix G	H-Area Hazardous Waste Management Facility (H-Area Seepage Basins [904-44G, 904-45G, 904-46G, 904-56G])	G-1
Appendix H	K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-25G)	H-1
Appendix I	M-Area Hazardous Waste Management Facility (Lost Lake [904-51G] and M-Area Settling Basin [904-112G])	I-1
Appendix J	Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)	J-1
Appendix K	Mixed Waste Management Facility	K-1
Appendix L	SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, 904-55G)	L-1

This page is intentionally left blank.

List of Acronyms and Abbreviations

ARAR	applicable or relevant and appropriate requirement
bgs	below ground surface
BRA	baseline risk assessment
CA	contamination area
CERCLA	Comprehensive Environmental Response, Compensation and Liability Act
CFR	Code of Federal Regulations
Ci	curies
cm	centimeter or centimeters
CM	contaminant migration
cm/s	centimeter or centimeters per second
CMCOC	contaminant migration constituent of concern
CMIR	Corrective Measures Implementation Report
CMS/FS	Corrective Measures Study/Feasibility Study
COC	constituent of concern
CPT	cone penetrometer technology
CSBRP	Central Shops Burning/Rubble Pits (631-1G and 631-3G)
+D	plus daughter
DBRP	D-Area Burning/Rubble Pits (431-D and 431-1D)
DNAPL	dense non-aqueous phase liquid
DNT	2,4-dinitrotoluene
dpm/mL	disintegrations per minute per milliliter
DUS	dynamic underground stripping
EAROD	Early Action Record of Decision
EC&ACP	Environmental Compliance and Area Completion Projects
ECO	ecological
ECODS	Early Construction and Operational Disposal Site
EMR	effectiveness monitoring report
ESD	Explanation of Significant Differences
ELLT	Engineered Low-Level Trench
FBSB	Ford Building Seepage Basin (904-91G)
FFA	Federal Facility Agreement
FHWMF	F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, and 904-43G])
FIPSL	F-Area Inactive Process Sewer Line
FRR	Final Remediation Report
ft / ft^3	foot or feet / cubic feet
ft^3/min	cubic feet per minute
FRR	Final Remediation Report
FY	fiscal year

LIST OF ACRONYMS AND ABBREVIATIONS *(continued)*

gal	gallon or gallons
GMZ	Groundwater Mixing Zone
GMZA	Groundwater Mixing Zone Application
HAZWOPER	hazardous waste operations
HWMF	hazardous waste management facility
HHWMF	H-Area Hazardous Waste Management Facility (H-Area Seepage Basins [904-44G, 904-45G, 904-46G and 904-56G])
HIPSL	H-Area Inactive Process Sewer Line
IRIS	Integrated Risk Information System
in	inch or inches
IROD	Interim Record of Decision
KBRP/KRP	K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)
kg	kilogram or kilograms
km / km^2	kilometer or kilometers / square kilometer
L	liter or liters
LAZ	lower aquifer zone
lbs	pounds
LBRP	L-Area Burning Rubble Pit (131-L)
LLC	Limited Liability Company
LLRWDF	Low-level Radioactive Waste Disposal Facility
LUCIP	Land Use Controls Implementation Plan
LUC	land use control
m / m^3	meter or meters / cubic meter
MASB	M-Area Settling Basin
MCL	maximum contaminant level
Met Lab	Metallurgical Laboratory (904-110G)
mg/L	milligram per liter
MHWMF	M-Area Hazardous Waste Management Facility (Lost Lake [904-51G] and M-Area Settling Basin [904-112G])
mi / mi^2	mile or miles / square mile
mrem	millirem
MWMF	Mixed Waste Management Facility (643-28E)
µg/kg	microgram per kilogram
µg/L	microgram per liter
mg/kg	milligrams per kilogram
MNA	monitored natural attenuation
msl	mean sea level

LIST OF ACRONYMS AND ABBREVIATIONS *(continued)*

MZ	mixing zone
MZCL	mixing zone concentration limit
N/A	not applicable
NBN	no building number
NCP	National Oil and Hazardous Substances Pollution Contingency Plan
NDMA	N-nitroso-dimethylamine
NPDES	National Pollutant Discharge Elimination System
NPL	National Priorities List
NRDC	National Resources Defense Council
NTCR	non-time critical removal
O&M	operation and maintenance
ORWBG	Old Radiological Waste Burial Ground
OU	operable unit
PAH	polyaromatic hydrocarbons
PBDE	polybrominated diphenyl ether
PBRP	P-Area Burning/Rubble Pit (131-P)
PCE	tetrachloroethylene
PCB	polychlorinated biphenyl
ρCi/g	picocuries per gram
ρCi/mL	picocuries per milliliter
ρCi/L	picocuries per liter
PCR	Post Construction Report
PFAS	per- and polyfluoroalkyl substances
PFOS	perflurorooctane sulfonic acid
PRG	Preliminary Remediation Goal
PTSM	principal threat source material
Q	quarter
RAO	remedial action objective
RCOC	refined constituent of concern
RCRA	Resource Conservation and Recovery Act
RDX	hexahydro-1,3,5-trinitro-1,3,5-triazine
RfC	reference concentration
RfD	reference dose
RFI	RCRA Facility Investigation
RG	remedial goal
RGO	remedial goal option
RI	Remedial Investigation
ROD	Record of Decision
RSL	regional screening level
S/S	stabilization/solidification
SARA	Superfund Amendments and Reauthorization Act of 1986

LIST OF ACRONYMS AND ABBREVIATIONS *(continued/end)*

SCDES[1]	South Carolina Department of Environmental Services
SCHWMR	South Carolina Hazardous Waste Management Regulations
SE	site evaluation
SEMS	Superfund Enterprise Management System
SRL	Savannah River Laboratory
SRLSB	Savannah River Laboratory Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G)
SRNL	Savannah River National Laboratory
SRNS	Savannah River Nuclear Solutions, LLC
SRS	Savannah River Site
SSHASP	site-specific health and safety plan
SVE	soil vapor extraction
SWP	southwest plume
TCE	trichloroethylene
TCP	1,2,3-trichloropropane
TNT	2,4,6-trinitrotoluene
TZ	transmissive zone
UAZ	upper aquifer zone
USDOE	United States Department of Energy
USEPA	United States Environmental Protection Agency
USFS-SR	United States Department of Agriculture Forest Service – Savannah River
UTRAU	Upper Three Runs Aquifer Unit
VOC	volatile organic compound
WSRC	Washington Savannah River Company
WSRC	Westinghouse Savannah River Company
yd / yd^3	yard or yards / cubic yard

1 South Carolina Department of Environmental Services (SCDES) was known as South Carolina Department of Health and Environmental Control prior to July 1, 2024.

SAVANNAH RIVER SITE SUMMARY

I. INTRODUCTION

Section 121 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA), as amended by the Superfund Amendments and Reauthorization Act of 1986 (SARA), requires that remedial actions which result in any hazardous substances, pollutants, or contaminant remaining at the site be subject to a five-year remedy review. The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) (40 CFR 300.430(f)(4)(ii)) further provides that remedial actions which result in any hazardous substances, pollutants, or contaminants remaining at the site above levels that allow for unlimited use and unrestricted exposure to be reviewed every five years to ensure protection of human health and the environment. The purpose of five-year remedy reviews is to evaluate the implementation and performance of the selected remedy at an operable unit (OU) to determine if the remedy is and will continue to be protective of human health and the environment. The evaluation of the remedy and the determination of protectiveness should be based on and sufficiently supported by data and document reviews, site interviews, visual inspections, etc. The methods, findings, and conclusions of remedy reviews are documented in Five-Year Remedy Review Reports. The reports also identify any issues found during the review and provide recommendations to address the issues.

The U.S. Department of Energy (USDOE) prepared this seventh five-year remedy review for Savannah River Site (SRS) OUs that included engineered cover systems in the remedial action pursuant to CERCLA Section 121 and as amended by SARA and the NCP. During implementation of the five-year remedy review process at the SRS, the U.S. Environmental Protection Agency (USEPA), the South Carolina Department of Environmental Services (SCDES), and the USDOE recognized that remedial action decision document(s) would be issued for multiple OUs. Rather than generate individual five-year remedy review reports for each OU, the USDOE and regulatory agencies determined that it would be more cost effective to conduct a remedy review for all applicable OUs on the same five-year cycle. The First Five-Year Remedy Review was issued in August 1997 (WSRC 1997); the Second

Five-Year Remedy Review was issued in February 2004 (WSRC 2003b); the Third Five-Year Remedy Review was issued in January 2009 (WSRC 2008); the Fourth Five-Year Remedy Review was issued in February 2014 (SRNS 2014); and the Fifth Five-Year Remedy Review was issued in December 2018 (SRNS 2015, SRNS 2017, SRNS 2018a, SRNS 2018b, and SRNS 2018c), the Sixth Five-Remedy Review was issued in December 2023 (SRNS 2019, SRNS 2020, SRNS 2021, SRNS 2022, SRNS 2023). The issuance of the Seventh Five-Year Remedy Review is in progress: Phase 1 (Native Soil Covers and/or Land Use Controls) was issued in January 2025; Phase 2 (Groundwater Remedies) was issued in January 2026.

The size of each report has grown considerably since 1997 due to the increasing number of OU remedies evaluated, and the level of detail required for data reviews, site inspection reporting, and document formatting based on USEPA guidance. To allow for a more even distribution of resources, a recommendation was made by SRS in the Fourth Five-Year Remedy Review Report (SRNS 2014) that future reviews should be conducted in phases based on OU groupings with similar remedies. In addition to a reduction in the total volume for future remedy review reports, evaluating similar remedies in the same review period would support easier identification and resolution of similar issues and allow for more efficient implementation of similar initiatives. Beginning with the Fifth Five-Year Remedy Review Report, the USDOE, USEPA, and SCDES agreed to segregate the five-year remedy review report into five OU groupings (grouped by remedy similarity) with a different group submitted annually on a five-year cycle. The SRS OUs are grouped by the following remedy types:

(1) Native Soil Covers and/or Land Use Controls (LUCs);
(2) Groundwater;
(3) Engineered Cover Systems;
(4) Geosynthetic or Stabilization/Solidification Cover Systems; and
(5) Operating Equipment.

The trigger date for the submittal of the next five-year remedy review report to the regulatory agencies is based on the USEPA signature date of the previous report. The final

signature for the last grouping of the Seventh Five-Year Remedy Review Report is due no later than December 31, 2028. A more detailed discussion of the phased reviews and transition schedule are provided in Appendix A.

This report documents the Seventh Five-Year Remedy Review for the third OU grouping, OUs with engineered cover systems selected as the final remedy and includes a review of remedy decision documents for ten USEPA Superfund Enterprise Management System (SEMS) units at the SRS. SEMS is a database maintained by the USEPA as part of the Superfund program that assigns a unique tracking number to hazardous waste sites considered for cleanup under CERCLA. Remedy decision documents may include more than one SEMS unit and/or SRS OU.

The SRS OUs evaluated in this document were grouped together because of similar remedies. Figure 1 identifies the location of the SRS OUs evaluated in this document. The data evaluation and visual inspections for the SRS OUs with engineered cover systems were conducted from July 2025 through December 2025.

This report was prepared using the Comprehensive Five-Year Review Guidance (USEPA 2001) and is supplemented by the Recommended Evaluation of Institutional Controls: Supplement to the "Comprehensive Five-Year Review Guidance" (USEPA 2011), Clarifying the Use of Protectiveness Determinations for Comprehensive Environmental Response, Compensation, and Liability Act Five-Year Reviews (USEPA 2012), and Five-Year Review Recommendation Template (USEPA 2016). This report summarizes common elements for the entire SRS. The remedy reviews are included as Appendix C through Appendix L.

Site Chronology

A summary of the regulatory history of SRS is provided below beginning with the 1988 National Resources Defense Council (NRDC) Consent Decree (Civil Action No. 1:85-2583-6). The Consent Decree was an agreement between the NRDC and other interested parties, SCDES, and USDOE to amend Parts A and B of the Resource Conservation and Recovery Act (RCRA) Permit Application to include the Metallurgical Laboratory Basin

(904-11G) and associated Carolina Bay, the Acid/Caustic Basin (904-74G, 904-75G, 904-78G, and 904-80G), and the Mixed Waste Management Facility (643-28G) to include closure, groundwater monitoring and post-closure activities. The Savannah River Laboratory Seepage Basins (904-53G, 904-54G, and 904-55G) and New TNX Basin (904-120G) were also included in the Consent Decree for closure consistent with RCRA requirements. The Consent Decree was signed on May 26, 1988. On December 21, 1989, SRS was included on the National Priorities List (NPL). The inclusion created a need to integrate the established RCRA Facility Investigation (RFI) program with CERCLA requirements to provide for a focused environmental program. In accordance with Section 120 of CERCLA 42 U.S. Code Section 9620, the USDOE has negotiated a Federal Facility Agreement (FFA) (FFA 1993) with the USEPA and the SCDES to coordinate remedial activities at SRS into one comprehensive program which fulfills these dual regulatory requirements. USDOE functions as the lead agency for remedial activities at SRS, with concurrence by the USEPA-Region 4 and the SCDES.

A summary status of SRS is provided in the Five-Year Summary Review Form in Table 1. A chronology of site events including the effective dates for the Consent Decree, the FFA, and the NPL Listing is provided in Appendix A. Chronologies of significant activities and regulatory milestones for individual OUs are included in the site-specific remedy review reports (Appendix C through Appendix L).

Background

The SRS was constructed during the 1950s to produce materials used in the fabrication of nuclear weapons, primarily tritium and plutonium, in support of our nation's defense programs. Production of nuclear materials for the defense program was discontinued in 1988. SRS has provided nuclear materials for the space program, as well as for medical, industrial, and research efforts up to the present. Chemical and radioactive wastes are by-products of nuclear material production processes. These wastes have been treated, stored, and in some cases, disposed of at SRS. Past disposal practices (e.g., seepage basins, pits and piles, landfills, etc.) have resulted in soil and groundwater contamination.

Hazardous waste materials handled at SRS are managed under RCRA, a comprehensive law requiring responsible management of hazardous waste. Certain SRS activities require SCDES operating or post-closure permits under RCRA. SRS received a RCRA hazardous waste permit from the SCDES, which was most recently renewed on October 27, 2025 (SCDES 2025). Module VIII of the Hazardous and Solid Waste Amendments portion of the RCRA permit mandates corrective action requirements for non-regulated solid waste management units subject to RCRA 3004(u).

Physical Characteristics

SRS occupies approximately 802.9 km^2 (310 mi^2) of land adjacent to the Savannah River, principally in Aiken and Barnwell counties of South Carolina (Figure 1). SRS is located approximately 40 km (25 mi) southeast of Augusta, Georgia, and 32 km (20 mi) south of Aiken, South Carolina. Approximately 90 percent of SRS land consists of natural and managed forests. The locations at SRS where nuclear materials were produced, stored, and disposed are clustered into distinct industrial areas that are separated by large areas of forest. OUs are generally contained within or adjacent to these industrial areas.

SRS is located on the Atlantic Coastal Plain. Subsurface and groundwater contamination associated with OUs is in unconsolidated sands and clays. The depth to the water table at SRS varies from just below the surface in wetlands and near streams to approximately 39 m (130 ft) below ground surface. Recharge to the aquifers underlying the SRS is primarily through rainfall. Groundwater flows toward and discharges into site streams and the floodplain of the Savannah River.

Land and Resource Use

For nearly 40 years, USDOE and its predecessor agencies produced nuclear materials for the nation's defense programs at SRS. Today, the focus of the USDOE has shifted to environmental stewardship, clean energy initiatives, and national security.

The future land use for all of the OUs at SRS is anticipated to be industrial with the USDOE maintaining control of the land. According to the *Savannah River Site Future Use Project*

Report (USDOE 1996), residential uses of SRS land should be prohibited. LUCs selected as part of the remedial action will prohibit residential use of the area.

SRS obtains its own drinking and process water supply from groundwater located beneath the SRS. SRS domestic and process water systems are supplied from a network of approximately 40 wells in widely scattered locations across the site, of which eight wells supply the primary drinking water system. Wells serving site process and drinking water in the larger site areas are typically 180 to 270 m (600 to 900 ft) in depth and pump water from the deeper Crouch Branch and McQueen Branch aquifers. Wells serving the smaller site facilities, such as barricades, pumphouses, and field laboratories, are shallower in depth (30 to 90 m [100 to 300 ft]) and are similar to large household-type wells. The SRS domestic water systems meet state and federal drinking water standards.

History of Contamination

During the early 1950s, SRS began to produce materials used in nuclear weapons, primarily tritium, plutonium-239, and other special nuclear materials for national defense and the space program. Chemical and radioactive wastes are by-products of nuclear material production processes. These wastes have been treated, stored, and in some cases disposed of at SRS. Hazardous substances, as defined by the CERCLA, are currently present in the environment at SRS, with past disposal practices (e.g., seepage basins, pits and piles, landfills, etc.) resulting in soil and groundwater contamination.

II. RESPONSE ACTION SUMMARY

Initial Response

After SRS was placed on the NPL in 1989, the SRS Site Evaluation program was initiated to identify potential release sites present at SRS that would require investigation and potential remediation under CERCLA. Five hundred fifteen (515) potential release sites have been identified. The FFA includes a schedule for the investigation and remedial action (if needed) for each potential release site not already completed.

A core team process for sharing and interpreting information and working together to reach agreement on key remedial decisions among USDOE, USEPA, and SCDES was implemented at SRS in 2000. The core team process has made environmental cleanup at SRS efficient and has allowed remediation at many OUs to be accomplished on an accelerated schedule.

The collaborative efforts of the USDOE, USEPA, and SCDES support a consistent approach to site characterization, human health and ecological risk analyses, remedy selection, establishment of remedial goals and remedy implementation for individual OUs at SRS. Technical and administrative protocols have been established to promote the consistent implementation of USEPA guidance at OUs across SRS. An environmental database is used to track sampling, analysis, and results of environmental characterization and monitoring. The environmental database is not available to the public directly. However, the information retained in the database is provided in regulatory documents that are submitted to USEPA and SCDES for review and approval and are available to the public in the SRS Administrative Record File (ARF) (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/). The ARF is available at the following locations:

U.S. Department of Energy
Public Reading Room
Gregg-Graniteville Library
University of South Carolina – Aiken
471 University Parkway
Aiken, South Carolina 29801

Thomas Cooper Library
Government Information and Maps Department
University of South Carolina
1322 Greene Street
Columbia, South Carolina 29208

An SRS Area Completion Strategy (WSRC 2006) was developed which allowed for the simultaneous characterization and cleanup of multiple OUs and potential sources of contamination in congested industrial areas.

Basis for Taking Action

The most prevalent soil contaminants at SRS are cesium-137 and organic chemicals (volatile or semivolatile). Other radionuclides, metals, polychlorinated biphenyls, and pesticides are present, but less common, at levels that exceed human health risk-based standards at a variety of OUs.

Based on the remedial investigations and technical evaluations, the OUs addressed in this remedy review were determined to contain hazardous substances, pollutants, or contaminants remaining on-site above levels that allow for unlimited use and unrestricted exposure. The specific contaminants and remedial actions for each OU are described in greater detail in the OU-specific appendices (Appendix C through Appendix L).

Remedial Actions

Remedial actions may target source areas, soil, vadose zone, and/or groundwater. Cleanup levels, formerly referred to as remedial goals in SRS decision documents, are defined for individual OUs, and are included as part of the remedial action objectives (RAOs). RAOs specify the exposure pathway to be mitigated and the receptor to be protected. In general, RAOs at SRS are:

- Prevent exposure of trespassers, industrial workers, and hypothetical residents to soils or groundwater containing unacceptable levels of contaminants.
- Prevent exposure of ecological receptors to soils, surface water or groundwater containing unacceptable levels of contaminants.
- Prevent or minimize the migration of contaminants to groundwater at levels that exceed maximum contaminant levels (MCLs)/cleanup levels.
- Reduce the contaminant concentrations in the groundwater plume to below MCLs/cleanup levels.
- Prevent or minimize the discharge of contaminated groundwater to surface water at levels that exceed MCLs/cleanup levels.

Additionally, LUCs are part of all remedial actions where hazardous substances, pollutants, or contaminants remain on-site above levels that allow for unlimited use and unrestricted exposure. The type of LUCs and their implementation, and reference to the OU-specific land use control implementation plan (LUCIP) are described in Section VII of the OU-specific appendices. LUCs are defined for individual OUs, but in general, LUC objectives at SRS are:

- Prevent exposure to, or ingestion of, contaminated media.
- Prohibit residential use.
- Prevent unauthorized access.
- Prevent unauthorized intrusive activity.
- Maintain the integrity of the cover systems.

Table 2 lists the remedial actions for each of the OUs in this five-year remedy review report. The remedial actions are described in greater detail in the OU-specific appendices (Appendix C through Appendix L). Table 3 provides a summary of the LUC objectives for the OUs with engineered cover systems.

Status of Implementation

The remedial actions listed in Table 2 have been implemented. LUCs are ongoing at all OUs discussed in this five-year remedy review. The status of all response actions or remedial actions for each of the engineered cover systems is discussed in greater detail in the OU-specific appendices (Appendix C though Appendix L). These actions include removal and remedial actions conducted prior to a final Record of Decision (ROD).

Systems Operation and Maintenance

A site-wide maintenance program is in place to care for cover systems, signs, monitoring wells, and other infrastructure associated with environmental remediation. Operation and maintenance (O&M) of cover systems consist of growing grass, mowing, managing surface

stormwater drainage, inspections, and repair of erosion or subsidence as necessary. Identifying signs must remain legible.

The costs of the O&M activities for the individual OUs have been compiled as part of this five-year remedy review. As part of the process of selecting the most appropriate action for each OU, the cost of implementing each of the remedial alternatives was estimated and reported in the respective remedy decision documents. Table 4 compares the actual costs incurred at SRS OUs with engineered cover systems over the time period from fiscal year (FY) 2021 to FY2025 to the estimated costs from the remedy decision documents projected for the same time period. The review for the actual costs incurred (i.e., FY2021 to FY2025) is based on the time-period since the last review for these OUs was conducted in the Sixth Five-Year Remedy Review Report (SRNS 2021). Site-specific details concerning costs incurred are included for each OU in Appendix C through Appendix L.

In support of the beneficial reuse of brownfield locations, the U.S. Department of Agriculture Forest Service – Savannah River (USFS-SR) began establishing pollinator habitats in 2019 within the boundaries of previously closed waste units located in M-Area, P-Area, R-Area, and T-Area where they will not interfere with existing cover systems or LUCs. Additionally, the USFS-SR also plants 100 acres of pollinator habitat annually at SRS, primarily along powerline rights-of-way. Other USFS-SR practices include adjusted planning practices to encourage a more diverse plant population, and thinning of 3,500 acres of forest annually, which creates conditions more conducive to pollinator habitat.

III. PROGRESS SINCE LAST REVIEW

For the OUs evaluated in this review, the previous protectiveness statements from the Sixth Five-Year Remedy Review Report (SRNS 2021) concluded that the remedies for these OUs were protective (Table 5). There have been no new remedial actions implemented since the Sixth Five-Year Remedy Review Report (SRNS 2021) was signed by USDOE, USEPA, and SCDES and issued to the public.

There were no recommendations or follow-up actions from the Sixth Five-Year Remedy Review Report that impacted the OUs with engineered soil covers evaluated in this report.

The following actions have been completed since the Sixth Five-Year Remedy Review Report (SRNS 2021) for the OUs with engineered cover systems evaluated in this report:

- Reviewed the most recent regulatory submittals pertaining to each of the OUs;
- Confirmed the implementation of the remedial actions and interim remedial actions;
- Reviewed groundwater monitoring data to determine if MCLs were exceeded;
- Inspected the OUs, interviewed maintenance personnel and documented the results on the Inspection Checklist, as required, with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Reviewed changes in standards and to-be-considered guidance.

IV. FIVE-YEAR REMEDY REVIEW PROCESS

USDOE has implemented the Seventh Five-Year Remedy Review for SRS OUs with Engineered Cover Systems. The review specifically evaluated remedies by comparing them to the OU-specific decision documents. The following actions were taken to perform the Seventh Five-Year Remedy Review for this category:

- Submitted a scoping summary to USDOE, USEPA, and SCDES on August 25, 2025 and conducted a scoping meeting on September 22, 2025. The USDOE, USEPA, and SCDES agreed to the scope and schedule of the remedy review report, which is discussed in the scoping summary;
- Publication of an announcement on December 5, 2025 that the USDOE is conducting the Seventh Five-Year Remedy Review in phases. The announcement stated that the third phased submittal will focus on OUs with engineered cover systems. The public was notified though mailings of *The Savannah River Environmental Bulletin*, a newsletter sent to citizens in South Carolina and Georgia on an extensive mailing list, including landowners adjacent to SRS, which is updated annually in July, and through notices in the *Aiken Standard* (Aiken, SC), *The Augusta Chronicle* (Augusta, GA), *The People Sentinel* (Allendale and Barnwell, SC), and *The State* (Columbia, SC)

newspapers. The Environmental Bulletin and newspaper affidavits of publication are available in the Administrative Record File;

- Reviewed appropriate data, and documentation (i.e., including RODs, Early Action RODs [EARODs], Interim RODs [IRODs], Explanation of Significant Differences [ESDs], and LUCIP-required field inspection checklists, etc. The specific data and document references used to review each remedy decision are listed in the OU-specific reports located in Appendix C through Appendix L;
- Confirmed protectiveness of the remedial actions through inspections and interviews. Cognizant personnel were interviewed as to the status and success of the current remedial systems. The results of the inspections and interviews are documented in the Site Inspection Checklist included with the OU-specific reports located in Appendix C through Appendix L;
- Reviewed changes in standards and to-be-considered guidance including federal and state promulgated standards (i.e., chemical-specific applicable or relevant and appropriate requirements [ARARs]) that would call into question whether the prescribed remedy was meeting the newer standards or guidance. Any problems or discrepancies are reported in the Section V (Technical Assessment) and Section VI (Issues/Recommendations) of the OU-specific appendices; and
- Submitted a draft Fact Sheet to USEPA and SCDES for review with Revision 0 of the Seventh Five-Year Remedy Review Report for SRS OUs with Engineered Cover Systems.

Community Notification and Involvement

USDOE will address any comments received from USEPA and SCDES and provide a Revision 1 report, if necessary, for USEPA and SCDES approval. After the USEPA and SCDES approve this report and USDOE, USEPA, and SCDES sign this report, a notice of its availability will be published in the *Aiken Standard* (Aiken, SC), *The Augusta Chronicle* (Augusta, GA), *The People Sentinel* (Allendale and Barnwell, SC), and *The State* (Columbia, SC) newspapers. Additionally, the availability of the report will be announced

in *The Savannah River Site Environmental Bulletin*, which will be sent (postal service and email) to the SRS mailing list. The SRS mailing lists consists of USDOE and SRS contractor personnel, SRS Citizens Advisory Board, members of the public, surrounding SRS, community leaders and organizations, etc. The report and Fact Sheet will be posted on the SRS external webpage and will be made available to the public at four information repositories and online.

Data Review, Site Inspections, and Interviews

According to the data review, the site inspections, and interviews, the remedies selected for the SRS OUs included in this report are functioning as intended by the decision documents. The exposure assumptions, toxicity data, cleanup levels, and RAOs used at the time of the remedy selection are still valid for all OUs included in this report. No new information has come to light that calls into question the protectiveness of the remedies.

SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. Environmental Compliance and Area Completions Projects (EC&ACP) Operations and Monitoring personnel evaluated the impacts of Hurricane Helene to all SRS OUs. Within a month after Hurricane Helene occurred, all OUs were reinspected for damages and repaired as needed. No damages have been identified at the OUs evaluated in this report that would affect the protectiveness of the remedies.

The Revision 0 report was submitted on February 5, 2026. Regulatory site inspections with USDOE, USEPA and SCDES personnel were held on March 19, 2026 via Microsoft Teams and face-to-face. SRNS personnel were also present at the meeting. During the meeting, participants viewed drone footage of the OUs with engineered cover systems and were provided an opportunity to walk down the OUs. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU.

V. TECHNICAL ASSESSMENT

The technical assessment of the environmental cleanup program at SRS and each of the OU-specific remedies evaluated in this report (Appendices C through Appendix L) are described by answers to the following three questions posed by the USEPA guidance.

- Question A: Is the remedy functioning as intended by the decision documents?
- Question B: Are the exposure assumptions, toxicity data, cleanup levels, and RAOs still valid?
- Question C: Has any other information come to light that could call into question the protectiveness of the remedy?

Question A: Is the remedy functioning as intended by the decision documents?

Answer: Yes. SRS engineered cover remedies and related activities are functioning as intended as demonstrated below.

- Contaminated material has been excavated and consolidated or left in place under protective cover systems breaking the pathway for worker exposure and for the migration of contaminants to groundwater.
- For all final remedial actions, LUCs are in place and are effective in preventing unauthorized access to the OUs with engineered cover systems and include physical access controls to SRS (e.g., fences, guards, security patrols, etc.) and administrative controls (SRS is a secured government facility with land use restrictions and a Site Use/Site Clearance program).
- The cover system maintenance program and LUCs have been effective in maintaining the integrity of the cover systems at SRS OUs. The inspection reports indicate no significant deficiencies.
- Thermal technologies have been successful at SRS in removing volatile organic compounds from subsurface zones characterized by very high concentrations and dense

non-aqueous phase liquid. Dynamic Underground Stripping was successfully used at the M-Area Hazardous Waste Management Facility as discussed in Appendix I.

Question B: Are the exposure assumptions, toxicity data, cleanup levels, and RAOs still valid?

Answer: Yes. The exposure assumptions, toxicity data, cleanup levels, and RAOs used at the time of remedy selection are still valid for all OUs included in this report. An evaluation of chemical and radiological standards including federal and state promulgated standards (i.e., chemical-specific ARARs) that were in place when the last five-year remedy review was initiated in 2021 to the current 2025 standards was conducted to determine if there were any changes that would affect the protectiveness of the selected remedies. There were some changes in chemical- and radiological-specific standards that could affect the protectiveness of the remedies. In May 2024, the residential soil screening level for lead decreased from 400 mg/kg to 200 mg/kg. If other sources of lead are present, the screening level is 100 mg/kg. Additionally, some chemical-specific standards decreased from 2020 to 2025 due to updated values used in calculating the regional screening levels (RSLs). However, the protectiveness of the remedies were not affected as the cover systems and LUCs prevent exposure. Although new MCLs and RSLs were established for per- and polyfluoroalkyl substances (PFAS) compounds, an evaluation of PFAS for the OUs with engineered covers as the final remedies indicated no impact to remedy protectiveness. There were no changes in action-specific or location-specific requirements that would impact any remedy. This evaluation is included in Appendix B and described in the OU-specific appendices.

Question C: Has any other information come to light that could call into question the protectiveness of the remedy?

Answer: No. No other information that could call into question the protectiveness of the selected remedies and no outstanding issues have been identified in this Seventh Five-Year Remedy Review.

For all OUs, current and reasonably anticipated future land use at SRS remains consistent with assumptions in the respective decision documents.

VI. ISSUES/RECOMMENDATIONS

Remedial actions evaluated in this Five-Year Remedy Review Report for SRS remain protective of human health and the environment and are effective and functioning as intended. The OUs without issues and recommendations are listed in Table 6.

The OU with issues and recommendations is listed in Table 7 and summarized below.

- Due to water-level measurements at Central Shops Burning/Rubble Pits (631-1G/631-3G) OU continuously being below the bottom of the basin for more than five years, SRS proposes to discontinue taking water-level measurements since these results meet the requirement of three consecutive years of decreasing water-level in Pit 3G (WSRC 2005).

VII. PROTECTIVENESS STATEMENT(S)

The protectiveness statements for each remedy are based on the recommended language from the Comprehensive Five-Year Review Guidance (USEPA 2001), Clarifying the Use of Protectiveness Determinations for Comprehensive Environmental Response, Compensation, and Liability Act Five-Year Reviews (USEPA 2012), and Five-Year Review Recommended Template (USEPA 2016).

For the OUs evaluated in this Five-Year Remedy Review, the engineered cover system remedies were determined to be protective of human health and the environment (Table 8).

LUCs are part of all remedial actions where hazardous substances, pollutants, or contaminants remain on-site above levels that allow for unlimited use and unrestricted exposure. The type of LUCs and implementation and reference to OU-specific LUCIPs are described in detail in Section VII of the OU-specific appendices. For the OUs evaluated in this report, pathways for contaminants to reach human and ecological receptors have been successfully broken by the selected remedies including LUCs.

A protectiveness statement for the OUs evaluated in this report is included in the OU-specific remedy review located in Appendix C through Appendix L.

VIII. NEXT REVIEW

As established in Section 121 of CERCLA, as amended by the SARA and the NCP, periodic reviews are required at least every five years for sites where hazardous substances, pollutants, or contaminants remain at the site above levels that allow for unlimited use and unrestricted exposure following the completion of all remedial actions. Barring a change in the governing laws, another review for the remedies in this report should be completed within five years from the date of USEPA's concurrence letter of this document. The final USEPA's concurrence letter for the last grouping of the Seventh Five-Year Remedy Review Report is due no later than December 31, 2028.

IX. OU-SPECIFIC FIVE-YEAR REMEDY REVIEW REPORTS

The OU-specific Five-Year Remedy Reviews for the remedies evaluated in this document are included in Appendix C through Appendix L.

X. REFERENCES

FFA, 1993. *Federal Facility Agreement for the Savannah River Site*, Administrative Docket Number 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2025. South Carolina Hazardous and Mixed Waste Permit, Permit Number SC1 890 008 989, 2025 RCRA Permit Renewal for the Savannah River Site, issued on October 27, 2025, Module III – Postclosure Care and Module IV - Groundwater Requirements, Section B, F-Area Hazardous Waste Management Facility, South Carolina Department of Environmental Services, Division of Waste Management, Bureau of Land and Waste Management, Columbia, SC

SRNS, 2014. *Fourth Five-Year Remedy Review Report for the Savannah River Site (U) Aiken, South Carolina,* SRNS-RP-2012-00011, Revision 1.1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2015. Fifth Five-Year Remedy Review Report for the Savannah River Site Operable Units with Native Soil Covers and/or Land Use Controls (U) Aiken, South

Carolina, SRNS-RP-2014-00902, Revision 1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2017. Fifth Five-Year Remedy Review Report for the Savannah River Site Operable Units with Groundwater Remedies (U) Aiken, South Carolina, SRNS-RP-2015-00609, Revision 1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2018a. Fifth Five-Year Remedy Review Report for the Savannah River Site Operable Units with Engineered Cover Systems (U) Aiken, South Carolina, SRNS-RP-2016-00609, Revision 1,1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2018b. Fifth Five-Year Remedy Review Report for the Savannah River Site Operable Units with Geosynthetic or Stabilization/Solidification Cover Systems (U) Aiken, South Carolina, SRNS-RP-2016-00610, Revision 1,1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2018c. Fifth Five-Year Remedy Review Report for the Savannah River Site Operable Units with Operating Equipment (U) Aiken, South Carolina, SRNS-RP-2017-00567, Revision 1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2019. Sixth Five-Year Remedy Review Report for Savannah River Site Operable Units with Native Soil Covers and/or Land Use Controls (U), Aiken, South Carolina, SRNS-RP-2018-00811, Revision 1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2020. Sixth Five-Year Remedy Review Report for Savannah River Site Operable Units with Groundwater Remedies (U) Aiken, South Carolina, SRNS-RP-2019-00511, Revision 1, Savannah River Nuclear Solutions, Savannah River Site, Aiken, SC

SRNS, 2021. *Sixth Five-Year Remedy Review Report for Savannah River Site Operable Units with Engineered Cover System (U)* Aiken, South Carolina, SRNS-RP-2020-00420, Revision 1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2022. Sixth Five-Year Remedy Review Report for Savannah River Site Operable Units with Geosynthetic or Stabilization/Solidification Cover Systems (U), Aiken, South Carolina, SRNS-RP-2021-04229, Revision 1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2023. *Sixth Five-Year Remedy Review Report for Savannah River Site Operable Units with Operating Equipment (U)*, Aiken, South Carolina, SRNS-RP-2022-00468, Revision 1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

USEPA, 2001. *Comprehensive Five-Year Review Guidance*, EPA 540-R-01-007, OSWER No. 9355.7-03B-P, U.S. Environmental Protection Agency, Office of Emergency and Remedial Response

USEPA, 2011. *Recommended Evaluation of Institutional Controls: Supplement to the "Comprehensive Five-Year Review Guidance"*, OSWER Directive 9355.7-18, U.S. Environmental Protection Agency, Office of Solid Waste and Emergency Response

USEPA, 2012. Clarifying the Use of Protectiveness Determinations for Comprehensive Environmental Response, Compensation, and Liability Act Five-Year Reviews, OSWER Directive 9200.2-111, U.S. Environmental Protection Agency, Office of Solid Waste and Emergency Response

USEPA, 2016. *Five-Year Review Recommended Template*, OSWER 2016 Directive 9022.0-89, U.S. Environmental Protection Agency, Office of Solid Waste and Emergency Response, Washington, D.C.

WSRC, 1997. *Five-Year Review of Records of Decision Report (U),* WSRC-RP-97-403, Revision 0, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1998. *Final Remediation Report for the D-Area Burning/Rubble Pits (431-D and 431-1D) (U)*, WSRC-RP-97-406, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2002a. Corrective Measures Implementation Report/Post-Construction Report/ Final Remediation Report for the SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, 904-55G), WSRC-RP-2001-4123, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2002b. *Post-Construction Report for the K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)*, WSRC-RP-2002-4095, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC


WSRC, 2003a. Post-Construction Report/Corrective Measures Implementation Report/ Final Remediation Report for the Ford Building Seepage Basin (904-91G), WSRC-RP-2003-4038, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2003b. *Second Five-Year Review Report for the Savannah River Site (U),* WSRC-RP-2001-4163, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2005. Post-Construction Report/Corrective Measures Implementation Report/ Final Remediation Report for Central Shops Burning/Rubble Pits (631-G and 631-3G) (U), WSRC RP-2004-4104, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2006. *Area Completion Strategy for the Savannah River Site (U)*, ERD-EN-2005-0084, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2008. *Third Five-Year Remedy Review Report for the Savannah River Site (U)*, WSRC-RP-2007-4063, Revision 1.1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

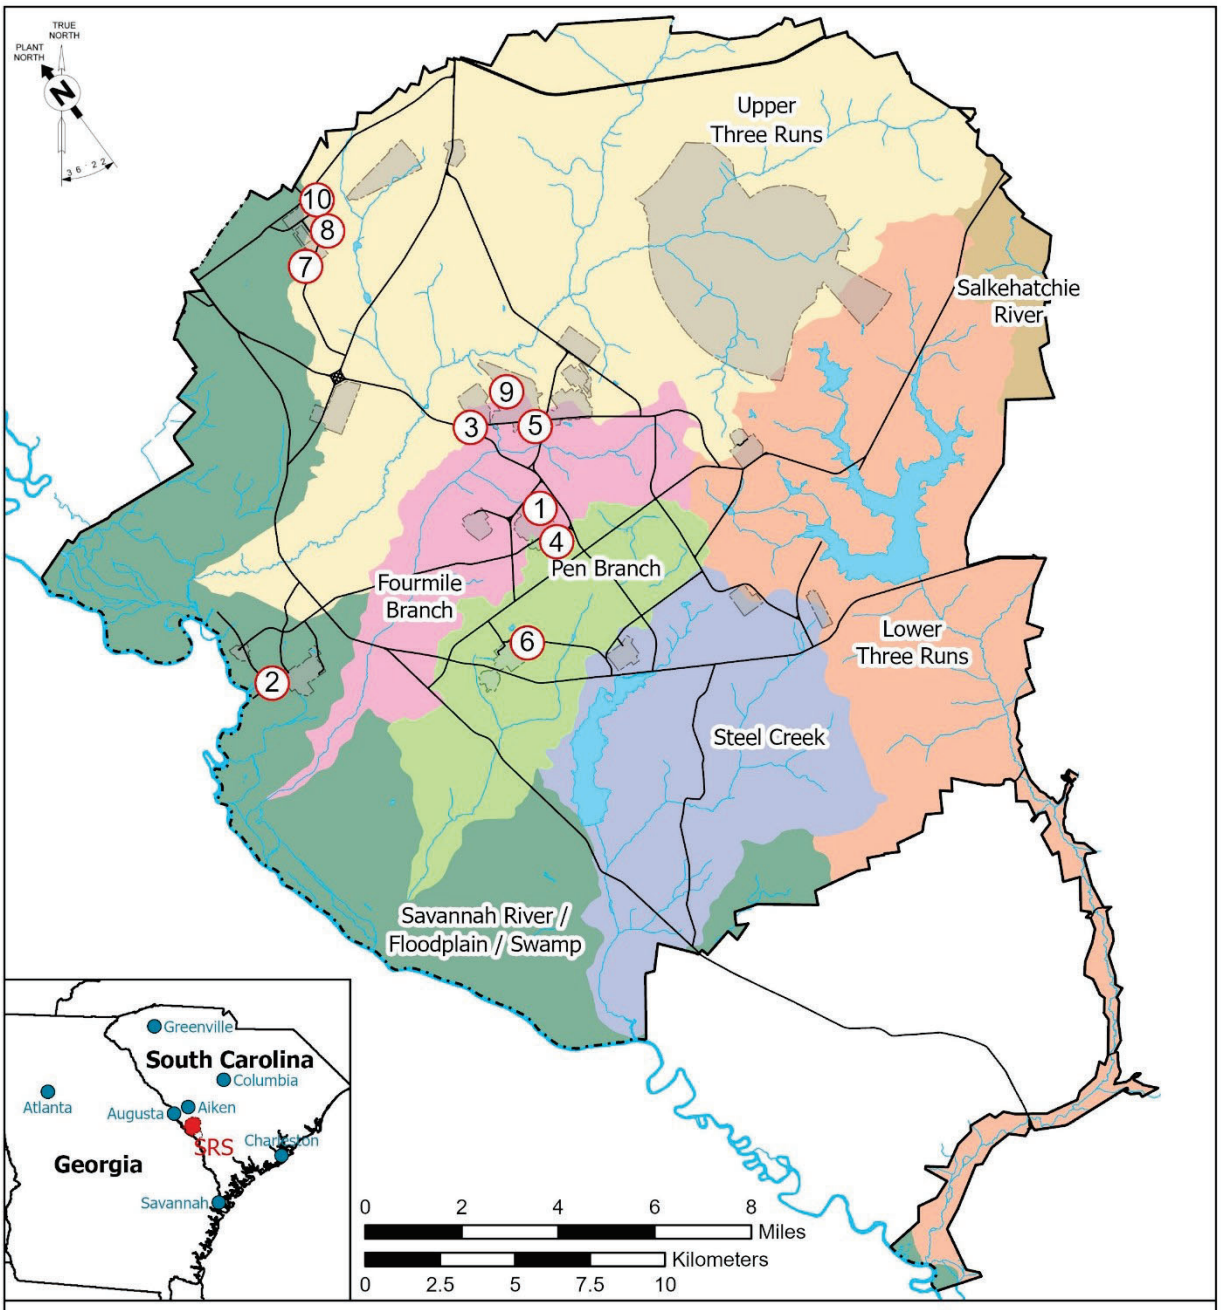

1. Central Shops Burning/Rubble Pits (631-1G/631-3G)
2. D-Area Burning/Rubble Pits (431-D/431-1D)
3. F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, 904-43G])
4. Ford Building Seepage Basin (904-41G)
5. H-Area Hazardous Waste Management Facility (H-Area Seepage Basins [904-44G, 904-45G, 904-46G, 904-56G])
6. K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-25G)
7. M-Area Hazardous Waste Management Facility (Lost Lake [904-51G] and M-Area Settling Basin [904-112G])
8. Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)
9. Mixed Waste Management Facility
10. SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, 904-55G)

Figure 1. Location Map for SRS OUs with Engineered Cover Systems

This page is intentionally left blank.

Table 1. Five-Year Review Summary Form

SITE IDENTIFICATION			
Site Name:	Savannah River Site		
EPA ID:	SC1890008989		
Region:	**4**	**State: SC**	**City/County:** Aiken/Aiken
SITE STATUS			
NPL Status:	Final		
Multiple OUs?:	Yes	**Has the Site achieved Construction Completion?**	No
REVIEW STATUS			
Lead Agency: Other Federal Agency **If "Other Federal Agency" was selected above, enter Agency Name:** U.S. Department of Energy			
Author Name (Federal or State Project Manager): N/A			
Author Affiliation: Savannah River Nuclear Solutions, LLC			
Review Period: June 15, 2025 – December 31, 2025 (SRS OUs with Engineered Cover Systems)			
Date of Site Inspections: June 2025 through December 2025 (SRS OUs with Engineered Cover Systems)			
Type of Review: Statutory			
Review Number: 7			
Triggering Action Date: December 31, 2023 (includes all five phases)			
Due Date (Five Years after Triggering Action Date): December 31, 2028 (includes all five phases)			

This page is intentionally left blank.

Table 2. SRS OUs with Engineered Cover Systems

#	Appendix	Operable Unit	SEMS No.	Decision Document Issuance Year[a]	Remedial Action	Area Covered (acres)	LUCs (acres)
1	C	Central Shops Burning/Rubble Pits (631-1G/631-3G)	50	2003	Stormwater Management, LUCs	0.43	2.8
2	D	D-Area Burning/Rubble Pit (431-D/431-1D)	15	1997	LUCs	0.54	0.7
3	E	F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, 904-43G])	6	1993	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	7	10
4	F	Ford Building Seepage Basin (904-91G)	58	2002	Excavation, Consolidation, Soil Cover, LUCs	0.22	0.3
5	G	H-Area Hazardous Waste Management Facility (H-Area Seepage Basins [904-44G, 904-45G, 904-46G, 904-56G])	7	1993	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	22	25
6	H	K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)	40	2001	Soil Cover, Groundwater Mixing Zone, LUCs	0.8	1.2
7	I	M-Area Hazardous Waste Management Facility (Lost Lake [904-51G] and M-Area Settling Basin [904-112G])	1	1992	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	2.4	4.5
8	J	Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)	2	1992	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	0.2	3.5
9	K	Mixed Waste Management Facility (643-28E)	33	1994	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	58	85
10	L	SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G)	47	2000	Excavation, Offsite Disposal, LUCs	2.1	2.6

a Reflects the year the decision document (i.e., RODs, EARODs, IRODs, and ROD Amendments) was issued or the year of the last signature on the decision document.

This page is intentionally left blank.

Table 3. LUC Summary Table

Operable Units	Media, Engineered Controls, and Areas that do not support UU/UE based on current conditions	LUCs Needed	LUCs Called for in the Decision Documents	Impacted Parcel(s)[a]	LUC Objectives[b]	Title of LUC Instrument Implemented and Date (or Planned)
Central Shops Burning/Rubble Pits (631-1G, 631-3G)	Soils	Yes	Yes	50	• Preclude residential use of the area • Prevent contact, removal, and excavation of the buried waste in the pits	WSRC 2005
D-Area Burning/ Rubble Pits (431-D, 431-1D)	Soils	Yes	Yes	15	• Prevent hypothetical future industrial workers from exposure to PCBs in surface and subsurface soils at concentrations exceeding target risk levels	WSRC 1998
F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, 904-43G])	Soils, Groundwater	Yes	Yes	6	• Preclude unauthorized access or intrusive activities	SCDES 2025
Ford Building Seepage Basin (904-91G)	Soils	Yes	Yes	58	• Maintain the use of the OU for industrial activities only • Prevent unauthorized access to the closed FBSB OU as long as the waste remains a threat to human health and environment • Preserve the cover and prevent disturbance of the dispositioned soil.	WSRC 2003a

Table 3. LUC Summary Table *(continued)*

Operable Units	Media, Engineered Controls, and Areas that do not support UU/UE based on current conditions	LUCs Needed	LUCs Called for in the Decision Documents	Impacted Parcel(s)[a]	LUC Objectives[b]	Title of LUC Instrument Implemented and Date (or Planned)
H-Area Hazardous Waste Management Facility (904-44G, 904-45G, 904-46G, 904-56G)	Soils, Groundwater	Yes	Yes	7	• Preclude unauthorized access or intrusive activities	SCDES 2025
K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)	Soils, Groundwater	Yes	Yes	40	• Prevent contact, removal, or excavation of buried waste in the OU areas designated in the LUCIP and preclude future residential or agricultural use of the area • Prevent unauthorized access to groundwater	WSRC 2002b
M-Area Hazardous Waste Management Facility (Lost Lake [904-112G] and M-Area Settling Basin [904-51G])	Soils, Groundwater	Yes	Yes	1	• Restrict access to authorized personnel with appropriate training or applicable requirements • Preclude unauthorized access or intrusive activities	SCDES 2025
Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)	Soils, Groundwater	Yes	Yes	2	• Restrict access to authorized personnel with appropriate training or applicable requirements • Preclude unauthorized access or intrusive activities	SCDES 2025

Table 3. LUC Summary Table *(continued/end)*

Operable Units	Media, Engineered Controls, and Areas that do not support UU/UE based on current conditions	LUCs Needed	LUCs Called for in the Decision Documents	Impacted Parcel(s)[a]	LUC Objectives[b]	Title of LUC Instrument Implemented and Date (or Planned)
Mixed Waste Management Facility (643-28E)	Soils, Groundwater	Yes	Yes	33	• Restrict access to authorized personnel with appropriate training or applicable requirements • Preclude unauthorized access or intrusive activities	SCDES 2025
SRL Seepage Basin (904-53G1, 904-53G2, 904-54G, 904-55G)	Soils	Yes	Yes	47	• Control access to the SRLSB unit in accordance with the current site use/site clearance programs	WSRC 2002a

a The Impacted Parcel(s) identification is represented by the SEMS number.
b The LUC objectives statements were obtained directly from the referenced LUC document. LUC objective statements vary in complexity due to the age of the document and guidance in place at the time the remedial decision was selected.

UU – unlimited use
UE – unrestricted exposure

This page is intentionally left blank.

Table 4. Operation and Maintenance Cost Comparison for SRS OUs with Engineered Cover Systems

Operable Unit	Main Remedy	Remedy Decision Document Year[a]	FY2021-FY2025 O&M Estimated Cost	FY2021-FY2025 O&M Actual Cost	% of Estimate	Comments
Central Shops Burning/Rubble Pits (631-1G/631-3G)	Stormwater Management, LUCs	2003	$40,000	$160,629	302%	Actual costs are higher than estimated because estimated costs in the ROD did not fully include all O&M activities for site maintenance, inspections, and monitoring.
D-Area Burning/Rubble Pit (431-D/431-1D)	LUCs	1997	$3,000	$$73,035	2335%	Actual costs are higher than estimated because costs for annual inspections and cover system maintenance were not included in the ROD estimate.
F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, and 904-43G])	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	1993	0	$402,576	N/A	No estimated costs were provided in the ROD for the RCRA unit.
Ford Building Seepage Basin (904-91G)	Excavation, Consolidation, Soil Cover, LUCs	2002	$50,000	$58,725	17%	Actual costs are as expected.
H-Area Hazardous Waste Management Facility (H-Area Seepage Basins [904-44G, 904-45G, 904-46G, and 904-56G])	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	1993	0	$1,055,994	N/A	No estimated costs were provided in the ROD for the RCRA unit.

Table 4. Operation and Maintenance Cost Comparison for SRS OUs with Engineered Cover Systems (continued/end)

Operable Unit	Main Remedy	Remedy Decision Document Year[a]	FY2021-FY2025 O&M Estimated Cost	FY2021-FY2025 O&M Actual Cost	% of Estimate	Comments
K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)	Soil Cover, Groundwater Mixing Zone, LUCs	2001	$27,812	$187,695	575%	Actual costs are higher than expected because groundwater monitoring and reporting have continued longer than expected.
M-Area Hazardous Waste Management Facility (Lost Lake [904-51G] and M-Area Settling Basin [904-112G])	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	1992	0	$186,800	87%	Although not required by RCRA, estimated costs were provided in the IROD for the RCRA unit.
Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	1992	0	$169,083	69%	Although not required by RCRA, estimated costs were provided in the IROD for the RCRA unit.
Mixed Waste Management Facility (643-28E)	In Situ Stabilization/Solidification, RCRA Soil Cover, LUCs	1994	0	$1,409,626	N/A	No estimated costs were provided in the ROD for the RCRA unit.
SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G)	Excavation, Offsite Disposal, LUCs	2000	$25,000	$115,938	364%	Actual costs are higher than expected because annual O&M costs were not included in the ROD estimate.

a Reflects the year the decision document (i.e., RODs, EARODs, IRODs, and ROD Amendments) was issued or the year of the last signature on the decision document.

Table 5. Protectiveness Determination/Statements from the Sixth Five-Year Remedy Review for SRS OUs with Engineered Cover Systems (SRNS 2018a)

SEMS No.	Operable Unit	Protectiveness Determination	Protectiveness Statement
50	Central Shops Burning/Rubble Pits (631-1G, 631-3G)	Protective	The remedy at the CSBRP OU is protective of human health and the environment.
15	D-Area Burning/Rubble Pits (431-D, 431-1D)	Protective	The remedy at the DBRP OU is protective of human health and the environment.
6	F-Area Hazardous Waste Management Facility (F-Area Seepage Basins [904-41G, 904-42G, 904-43G])	Protective	The remedy at the FHWMF OU is protective of human health and the environment.
58	Ford Building Seepage Basin (904-91G)	Protective	The remedy at the FBSB OU is protective of human health and the environment.
7	H-Area Hazardous Waste Management Facility (904-44G, 904-45G, 904-46G, 904-56G0	Protective	The remedy at the HHWMF OU is protective of human health and the environment.
40	K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)	Protective	The remedy at the KBRP/KRP OU is protective of human health and the environment.
1	M-Area Hazardous Waste Management Facility (Lost Lake [904-112G] and M-Area Settling Basin [904-51G])	Protective	The remedy at the MHWMF OU is protective of human health and the environment.
2	Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)	Protective	The remedy at the Met Lab HWMF OU is protective of human health and the environment.
33	Mixed Waste Management Facility (643-28E)	Protective	The remedy at the MWMF OU is protective of human health and the environment.
47	SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, 904-55G)	Protective	The remedy at the SRLSB OU is protective of human health and the environment.

Table 6. Operable Units without Issues and Recommendations in the Seventh Five-Year Remedy Review Report

OU(s) without Issues/Recommendations Identified in the Five-Year Review	
SEMS #:	1, 2, 6, 7, 15, 33, 40, 47, 58

Table 7. Issues and Recommendations Identified in the Seventh Five-Year Remedy Review Report

Issues and Recommendations Identified in the Five-Year Review				
SEMS #: 50	**Issue Category:** Remedy performance			
	Issue: Water-level measurements have remained below the bottom of the basin for more than five years.			
	Recommendation: Eliminate water-level sampling based on requirements set in the Post Construction Report (WSRC 2005)			
Affect Current Protectiveness	**Affect Future Protectiveness**	**Implementing Party**	**Oversight Party**	**Milestone Date**
No	No	USDOE	USEPA/SCDES	12/31/2026

N/A – Not Applicable

Table 8. Protectiveness Statements for the Seventh Five-Year Remedy Review Report for SRS OUs with Engineered Cover Systems

PROTECTIVENESS STATEMENT(S)		
Operable Unit: Central Shops Burning/Rubble Pits (631-1G and 631-3G) (CSBRP) OU SEMS # 50	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the CSBRP OU was institutional controls (i.e., LUCs) with enhanced stormwater as stated in the 2003 ROD. The remedy at the CSBRP OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media.		
Operable Unit: D-Area Burning/Rubble Pits (431-D and 431-1D) (DBRP) OU SEMS # 15	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the DBRP OU was institutional controls (i.e., LUCs) as stated in the 1997 ROD. The remedy at the DBRP OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media.		
Operable Unit: F-Area Hazardous Waste Management Facility (HWMF) (904-41G, 904-42G, and 904-43G) OU SEMS #6	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the FHWMF OU was in situ stabilization/solidification, RCRA soil cover, and institutional controls (i.e., LUCs) as stated in the 1993 ROD. The remedy at the F-Area HWMF OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media and groundwater.		
Operable Unit: Ford Building Seepage Basin (904-91G) (FBSB) OU SEMS #58	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the FBSB OU was excavation, consolidation, soil cover, and institutional controls (i.e., LUCs) as stated in the 2002 ROD. The remedy at the FBSB OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media.		
Operable Unit: H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G) OU SEMS #7	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the HHWMF OU was in situ stabilization/solidification, RCRA soil cover, and institutional controls (i.e., LUCs) as stated in the 1993 ROD. The remedy at the H-Area HWMF OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media and groundwater.		

Table 8. Protectiveness Statements for the Seventh Five-Year Remedy Review Report for SRS OUs with Engineered Cover Systems *(continued)*

PROTECTIVENESS STATEMENT(S)		
Operable Unit: K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) (KBRP/KRP) OU SEMS #40	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the KBRP/KRP OU was soil cover, groundwater mixing zone, and institutional controls (i.e., LUCs) as stated in the 2001 ROD. The remedy at the KBRP/RP is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media.		
Operable Unit: M-Area HWMF (904-112G and 904-51G) OU SEMS #1	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the MHWMF OU was in situ stabilization/solidification, RCRA soil cover, and institutional controls (i.e., LUCs) as stated in the 1992 ROD. The remedy at the M-Area HWMF OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media and groundwater.		
Operable Unit: Metallurgical Laboratory (Met Lab) HWMF (904-110G) OU SEMS #2	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the Met Lab HWMF OU was in situ stabilization/solidification, RCRA soil cover, and institutional controls (i.e., LUCs) as stated in the 1992 ROD. The remedy at the Met Lab HWMF OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media and groundwater.		
Operable Unit: Mixed Waste Management Facility (643-28E) (MWMF) OU SEMS #33	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the MWMF OU was in situ stabilization/solidification, RCRA soil cover, and institutional controls (i.e., LUCs) as stated in the 1994 ROD. The remedy at the MWMF OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media and groundwater.		

Table 8. Protectiveness Statements for the Seventh Five-Year Remedy Review Report for SRS OUs with Engineered Cover Systems *(continued/end)*

PROTECTIVENESS STATEMENT(S)		
Operable Unit: Savannah River Laboratory (SRL) Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G) (SRLSB) OU SEMS #47	***Protectiveness Determination:*** Protective	***Addendum Due Date (if applicable):*** N/A
Protectiveness Statement: The selected remedy for the SRLSB OU was excavation, offsite disposal, and institutional controls (i.e., LUCs) as stated in the 2000 ROD. The remedy at the SRLSB OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media.		

This page is intentionally left blank.

APPENDIX A. SEVENTH FIVE-YEAR REMEDY REVIEW REPORT PHASED REVIEWS

I. FIVE-YEAR REMEDY REVIEW PHASES

The size of the Savannah River Site (SRS) five-year remedy review reports has grown considerably since the first report was issued in 1997 with respect to the number of operable unit (OU) remedies evaluated and the level of detail required. Beginning with the Fifth Five-Year Remedy Review Report, the U.S. Department of Energy, U.S. Environmental Protection Agency (USEPA), and South Carolina Department of Environmental Services (SCDES) agreed to segregate the OUs into five groupings based on remedy similarity with a different group submitted annually on a five-year cycle. This phased approach not only reduces the volume of future remedy reports but is also more effective in identifying and resolving issues for similar remedies.

The SRS OUs are grouped by the following remedy types:

1. Native Soil Covers and/or Land Use Controls (LUCs);
2. Groundwater Remedies;
3. Engineered Cover Systems;
4. Geosynthetic or Stabilization/Solidification (S/S) Cover Systems; and
5. Operating Equipment.

The trigger date for submittal of the next five-year remedy review report to the regulatory agencies is based on the USEPA signature date of the previous report. The final signature for the last grouping of the Seventh Five-Year Remedy Review Report is due no later than December 31, 2028. The remedy reviews for the five OU remedy groups are issued in compliance with the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) and the National Oil and Hazardous Substances Pollution Contingency Plan to ensure the five-year limit between decision documents is not exceeded.

A list of the SRS OUs with remedy decision documents grouped into one of the five phased reviews is provided in Table A-1. Table A-1 will be updated in future remedy review

reports as additional remedy decision documents are approved. A general description of the five remedy types is provided below.

Phase 1: Native Soil Covers and/or LUCs

For purposes of the seventh five-year phased remedy review, SRS OUs with native soil covers and/or LUCs as the selected remedy are grouped under the Native Soil Covers and/or LUCs category.

Native soil covers are often implemented at SRS to protect against human and/or ecosystem exposure to waste or contaminated material left in place. Native soil covers are appropriate when water infiltration and leaching of contaminants to groundwater are not a concern. A typical soil cover is 0.30 to 0.61 m (12 to 24 in) thick and is usually vegetated to minimize erosion. Native soil covers are usually low in cost and construction materials are readily available from SRS local sources. Native soil covers may be combined with other remedial actions but require LUCs as a component of the remedy. For these units, native soil covers were in place prior to selection of the remedial action. For this reason, only LUCs were required as the final remedial action for the OUs with existing soil covers discussed in the Native Soil Covers and/or LUCs report.

LUCs are maintained for all OUs where residual hazardous substances, pollutants, or contaminants remain on-site or have been left in place above levels that are acceptable for unlimited use and unrestricted exposure. LUCs may be implemented as a stand-alone remedy when active measures are determined not to be practicable or combined with other remedial actions. LUCs involve institutional controls (i.e., administrative controls) and engineering controls and can include monitoring, maintenance, reporting, access restrictions, signage, fencing, and land use restrictions. In older SRS remedy documents, the term “institutional controls” was often used in place of the broader LUC term.

Phase 2: Groundwater Remedies

For purposes of the seventh five-year phased remedy review, SRS OUs that have monitoring activities associated with Monitored Natural Attenuation (MNA) or a Mixing Zone (MZ) permit, as well as interim remedial actions are grouped in the Groundwater

Remedies category. Groundwater remedies that include operating equipment are discussed in the remedy review report for operating equipment.

SRS uses a graded approach to groundwater remediation. The selection of groundwater remediation technologies for a specific contamination area is based on the size, contaminant type, contaminant concentration, and configuration of the plume. These attributes are the result of the nature and mass of the source of contamination and the subsurface characteristics in the area of the plume. Many large plumes consist of several zones that are most efficiently addressed with separate complementary corrective action/ remedial technologies. The highest concentrations of contaminants are found in the source zone. The most robust, high-mass-removal technologies, for example electrical resistance heating, are best suited for remediation of the source zone. In the primary plume zone, active remedies such as pump-and-treat, or low-energy remedies such as in situ oxidation may be appropriate. In the dilute fringe zone, contaminants are generally low in concentration and can often be treated with passive techniques.

Low-energy-consumption, low-carbon emission systems are used at SRS to remediate vadose zone soils for the purpose of preventing groundwater contamination. These "green" technologies leverage natural systems to protect and remediate groundwater. Many existing soil vapor extraction (SVE) systems have been converted from active vacuum extraction to low-energy MicroBlower™ and/or passive BaroBalls™ systems. BaroBall™ and MicroBlower™ systems are two types of SVE systems currently in operation at SRS. BaroBalls™ rely on natural fluctuations in barometric pressure to pump volatile organic compounds (VOCs) from the subsurface to the atmosphere at individual SVE wells. SVE wells with MicroBlowers™ are designed to use solar power to generate a vacuum that exhausts VOC vapors from individual wells. Both MicroBlowers™ and BaroBalls™ are low-energy-consumption, low-carbon-emission devices that remove VOC contaminants from the subsurface.

MNA is a passive groundwater remedial action where the fringe and dilute areas of a plume degrade by natural biogeochemical or physical processes such as biodegradation, radioactive decay, dilution, and simple dispersion. MNA remedies must be accompanied

by source control, such as those discussed above, and a technical justification that conditions are favorable for natural attenuation. The groundwater plume should not be expanding significantly, and surface water standards cannot be exceeded at the groundwater discharge point. MNA remedy justifications are supported by groundwater modeling and a commitment to continued monitoring and reporting. When only the uppermost aquifer is impacted, SCDES may issue a MZ permit that is essentially a permit for an MNA remedy. SRS has a mixture of CERCLA Record of Decisions (RODs) that require MNA as the final action for groundwater under CERCLA, and RODs that require SCDES MZ permits to implement the MNA remedy.

Phase 3: Engineered Cover Systems

For purposes of the seventh five-year phased remedy review, SRS OUs that selected an engineered cover system or similar cover system as the remedy are grouped in the Engineered Cover Systems category.

The function of an engineered cover system is similar to that of a native soil cover: to protect against human and/or ecosystem exposure to waste or contaminated material left in place. Although engineered covers do not completely prevent infiltration, they can achieve very low permeabilities if well compacted. Compaction is important to reduce damage from differential settlement and is often used at SRS to remediate OUs that contain diverse waste material such as rubble pits/piles. Another objective of using engineered cover systems is to promote more effective surface drainage and to minimize infiltration.

SRS OUs were placed in this grouping if the selected cover features/performance requirements exceeded those of basic native soil cover. For example, an OU with a remedy that selected cover and/or fill material with a higher clay content to minimize infiltration or for drainage and slope contouring was included in this category even if the clay material did not have engineering compaction requirements.

Phase 4: Geosynthetic or Stabilization/Solidification Cover Systems

For purposes of the seventh five-year phased remedy review, SRS OUs that installed a geosynthetic or S/S cover system are grouped in the Geosynthetic or S/S Cover Systems category.

Many cover systems are designed to protect groundwater by minimizing the infiltration of rainwater through the contaminated material left in place. Geosynthetic cover systems are constructed at SRS OUs when there is a concern that contamination left in place may leach to groundwater above acceptable levels. A typical cross section of a geosynthetic cover system consists of a vegetative/soil protective layer, a geosynthetic drainage layer, an impermeable geosynthetic liner, and compacted common fill placed over the contaminated material. A specific hydraulic conductivity to reduce storm water infiltration, usually 1E-07 cm/s or less, is specified in the design. Low permeability covers are often paired with SVE units that remove VOCs from the subsurface soil to prevent migration of contaminants to groundwater.

In some cases, radioactively contaminated soils have been stabilized with in-situ grouting followed by installation of a low permeability cover (i.e., compacted clay, concrete, etc.) to deter migration of contaminants to the groundwater. Not only does S/S technology stabilize waste left in place, the in-situ containment also provides another layer of protection to prevent intrusion and exposure to contaminated material.

Phase 5: Operating Equipment

For purposes of the seventh five-year phased remedy review, SRS OUs that have ongoing active remediation systems are grouped under the Operating Equipment category.

A range of active remediation systems are used at SRS. SVE systems are used to remove VOCs from vadose zone source areas before the contaminants can migrate to the water table. Pump and treat systems (e.g., air strippers and associated recovery wells) are used to remove contaminant mass and exert hydraulic control over contaminated groundwater plumes. Thermal technologies have been employed in several areas to mobilize dense non-aqueous phase liquid (DNAPL) VOCs in the vadose zone and groundwater. Dynamic

Underground Stripping is a technology employed at SRS that utilizes steam injection to enhance removal from large DNAPL source zones. Electrical Resistance Heating has been used in smaller DNAPL source zones.

II. SRS OUS WITH REMEDIAL DECISIONS

The following tables are included for information only and provide tracking for all SRS OUs with approved remedial decisions, including No Action sites [i.e., RODs, Early Actions RODs (EARODs), Interim RODs (IRODs), ROD Amendments, and Explanation of Significant Differences (ESDs)].

- Table A-2 provides a summary of SRS OUs for remedial actions without operating equipment;
- Table A-3 provides a summary for SRS OUs for remedial actions with operating equipment;
- Table A-4 chronologically lists all SRS issued decision documents. Document numbers are provided for reference;
- Table A-5 provides a summary of SRS OUs with the No Remedial Actions selected in the decision documents; and
- Table A-6 provides the list of OU subunits with remedial actions selected and their associated Superfund Enterprise Management System (SEMS) number.

Table A-1. Seventh Five-Year Remedy Review Report Phases for SRS OUs

Native Soil Covers and/or LUCs		Groundwater		Engineered Cover Systems		Geosynthetic or Stabilization/Solidification Cover Systems		Operating Equipment	
Submittal Date[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*
2023	2024	2024	2025	2025	2026	2026	2027	2027	2028
C-Area Operable Unit		C-Area Groundwater		Central Shops Burning/Rubble Pits (631-1G and 631-3G)		B-Area Operable Unit		A-Area Burning/Rubble Pits (731-A/731-1A) and Rubble Pit (731-2A), Miscellaneous Chemical Basin (731-4A) and Metals Burning Pit (731-5A)	
C-, K-, and L-Reactor Complexes		Chemicals, Metals, and Pesticides Pit (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, 080-190G)		D-Area Burning/Rubble Pits (431-D and 431-1D)		C-Area Reactor Seepage Basins (904-66G, 904-67G, and 904-68G)		A-Area Miscellaneous Rubble Pile (731-6A)	
Early Construction and Operational Disposal Site (ECODS) L-1, N-2, P-2, and R-1A, R -1B, R -1C		D-Area Oil Seepage Basin (631-G)		F-Area Hazardous Waste Management Facility (HWMF) (904-41G, 904-42G, 904-43G)		D-Area Expanded Operable Unit Consisting of D-Area Ash Basin (488-D) and D-Area Rubble Pit (431-2D)		A/M-Area Groundwater	
ECODS N-1, Central Shops Scrap Lumber Pile (631-2G), Building 690-N (Ford Building)		L-Area Southern Groundwater		Ford Building Seepage Basin (904-91G)		E-Area Low-Level Waste Facility (643-26E)		C-Area Burning/Rubble Pit (131-C)	
F-Area Burning/Rubble Pits (231-F, 231-1F, and 231-2F)		R-Area Operable Unit[c]		H-Area HWMF (904-44G, 904-45G, 904-46G, 904-56G)		F-Area Retention Basin (281-3F)		D-Area Operable Unit	
Gunsite 012		R-Area Reactor Seepage Basins (904-57G, 904-58G, 904-59G, 904-60G, 904-103G, and 904-104G) and 108-4R Overflow Basin		K-Area Burning/Rubble Pit (131-K) and Rubble Pile (631-20G)		F-Area Tank Farm		F-Area Groundwater Operable Unit	
Heavy Equipment Wash Basin (NBN)				M-Area HWMF (904-51G and 904-112G)		General Separations Area Consolidation Unit		H-Area Groundwater Operable Unit	
K-Area Bingham Pump Outage Pit (643-1G)				Metallurgical Laboratory HWMF (904-110G)		H-Area Tank Farm		M-Area Settling Basin Inactive Process Sewer Lines (081-M)	

Table A-1. Seventh Five-Year Remedy Review Report Phases for SRS OUs (*continued/end*)

Native Soil Covers and/or LUCs		Groundwater		Engineered Cover Systems		Geosynthetic or Stabilization/Solidification Cover Systems		Operating Equipment	
Submittal Date[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*	*Submittal Date*[a]	*Issuance Year*
2023	2024	2024	2025	2025	2026	2026	2027	2027	2028
L-Area and P-Area Bingham Pump Outage Pits (643-2G, 643-3G, and 643-4G)				Mixed Waste Management Facility (643-28E)		K-Area Reactor Seepage Basin (904-65G)		M-Area Operable Unit	
Lower Three Runs Integrator Operable Unit (IOU)				SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G)		L-Area Oil and Chemical Basin (904-83G)		P-Area Burning/Rubble Pit (131-P)	
R-Area Bingham Pump Outage Pits (643-8G, 643-9G and 643-10G) and R-Area Unknown Pits #1, #2, and #3						L-Area Reactor Seepage Basin (904-64G)		TNX Area Operable Unit	
Silverton Road Waste Unit (731-3A)						Old F-Area Seepage Basin (904-49G)			
Wetland Area at Dunbarton Bay in Support of Steel Creek IOU[b]						P-Area Operable Unit			
						P-Area Reactor Seepage Basin (904-61G, 904-62G, and 904-63G)			
						R-Area Burning/Rubble Pits (131-R and 131-1R) and R-Area Rubble Pile (631-25G)			
						T-Area Operable Unit			

a Represents December submittal date of the Revision 0 document for each five-year remedy review report, unless USDOE, USEPA, and SCDES agree on a revised submittal date. The submittal date of the Revision 0 Engineered Cover Systems was revised to March 2026 based on regulatory approval of USDOE extension request letter (RDDD-26-104, dated November 4, 2025).

b ROD was issued on October 12, 2023. This OU was not included in the first phase of the seventh five-year review (i.e., native soil covers and/or LUCs) because the remedy had not been implemented.

c R-Reactor Complex will be discussed as part of R-Area Operable Unit.

Table A-2. Summary of Remedial Actions without Operating Equipment at SRS

Unit Name	FYR Phase	OU	Area Covered (acres)	Volume Covered (yd^3)	Volume Stabilized (yd^3)	Volume Consolidated (yd^3)	Volume Removed (yd^3)	LUC (acres)
Compacted Native Soil								
Central Shops Burning/Rubble Pits (631-5G)	1	CSBRP 5G	0.15	0	0	0	0	0
Early Construction and Operational Disposal Site (ECODS) C-1	1	CAOU	0.16	0	0	0	0	1.27
ECODs L-1	1	ECODS L-1	0.40	0	0	0	0	0.94
ECODs N-2	1	ECODS N-2	0.47	0	0	0	0	1.31
ECODs P-2	1	ECODS P-2	0.18	0	0	0	0	2.42
ECODs R-1A, R-1B, R-1C	1	ECODS R-1A, -1B, -1C	0.3	0	0	0	0	1.76
F-Area Burning/Rubble Pits (231-F, 231-1F, and 231-2F)	1	FBRP	1.18	0	0	0	0	3.8
K-Area Bingham Pump Outage Pit (BPOP) (643-1G)	1	KBPOP	0.55	0	0	0	0	0.59
L-Area BPOP (643-2G and 642-3G)	1	L/P-BPOP	0.31	0	0	0	0	0.73
P-Area BPOP (643-4G)	1	L/P-BPOP	0.28	0	0	0	0	0.41
R-Area BPOP (643-8G, 643-9G and 643-10G) and R-Area Unknown Pits #1, #2, and #3	1	RBPOP	0.88	0	0	0	0	3.1
Silverton Road Waste Unit (731-3A)	1	SRWU	1.36	0	0	0	0	5.3
Central Shops Burning/Rubble Pits (631-1G and 631-3G)	3	CSBRP	0.43	0	0	0	0	2.81
D-Area Burning/Rubble Pits (431-D and 431-1D)	3	DBRP	0.54	0	0	0	0	0.73
A-Area Burning/Rubble Pits (731-A and 731-1A) and Rubble Pit (731-2A), Miscellaneous Chemical Basin (731-4A), Metals Burning Pit (731-5A)	5	ABRP/RP MCB/MBP	9.95	0	0	0	10,200	10.1
M-Area Operable Unit	5	MAOU	0.84	3,600	0	4,350	0	70.9
Land Use Controls Only								
C-Area Operable Unit	1	CAOU	0	0	0	0	0	56.5
C-Reactor Complex	1	CKL Rx	0	0	0	0	0	3.4
K-Reactor Complex	1	CKL Rx	0	0	0	0	0	3.8
L-Reactor Complex	1	CKL Rx	0	0	0	0	0	3.5
D-Area Operable Unit (488-2D and west end of 488-1D)	5	DAOU	0	0	0	0	315,821	245
Gunsite 012	1	Gunsite 012	0	0	0	0	0	8.9
Heavy Equipment Wash Basin (NBN)	1	HEWB	0	0	0	0	0	0.3
Lower Three Runs IOU	1	LTR IOU	9821.5	0	0	0	0	9821.5
Wetland Area at Dunbarton Bay	1	WADB	0	0	0	0	22,000	39

Table A-2. Summary of Remedial Actions without Operating Equipment at SRS *(continued)*

Unit Name	FYR Phase	OU	Area Covered (acres)	Volume Covered (yd^3)	Volume Stabilized (yd^3)	Volume Consolidated (yd^3)	Volume Removed (yd^3)	LUC (acres)
Water Cover								
PAR Pond (685-G) (Including the Pre-Cooler Ponds and Canals)	1	PAR Pond	1,340	0	0	0	0	2556.1
Geosynthetic Clay (hydraulic conductivity 1E-07 cm/sec, 1E-08 cm/sec)								
General Separations Area Consolidation Unit	4	GSACU	77.3	0	0	50,950	0	86
D-Area Expanded Operable Unit consisting of D-Area Ash Basin (488-D) and D-Area Rubble Pit (431-2D)	4	DEXOU	25	0	0	110,110	74	43.27
E-Area Low-Level Waste Facility (643-26E)	4	E-Area LLWF	13.6	123,072	0	0	0	0
T-Area Operable Unit	4	TAOU	9.4	0	0	1,531	0	47.58
P-Area Reactor Seepage Basin (904-61G, 904-62G, and 904-63G)	4	PRSB	2.3	0	7,400	1,928	0	3.13
R-Area Burning/Rubble Pits (131-R and 131-1R) and Rubble Pile (631-25G)	4	RBRP/RP	0.32	0	0	0	250	0.44
Compacted Clay (hydraulic conductivity 1E-07 cm/sec)								
F-Area Hazardous Waste Management Facilities (HWMFs) (904-41G, 904-42G, and 904-43G)	3	F-HWMF	6.8	0	0	0	0	10
H-Area HWMFs (904-44G, 904-45G, 904-46G, 904-56G)	3	H-HWMF	22.1	0	0	0	0	25
M-Area HWMFs (904-51G and 904-112G)	3	M-HWMF	2.4	0	37,800	39,700	0	4.5
Metallurgical Laboratory HWMF (904-110G)	3	Met Lab HWMF	0.2	0	0	0	0	3.5
Mixed Waste Management Facility (943-28E)	3	MWMF	58	0	0	0	0	85
P-Area Burning/Rubble Pit (131-P)	5	PBRP	0.6	0	0	0	0	0.89
Compacted Clay w/Waste Solidification (hydraulic conductivity 1E-05 cm/sec)								
C-Area Reactor Seepage Basins (904-66G, 904-67G, and 904-68G)	4	CRSB	3.1	0	2,667	0	0	3.1
F-Area Retention Basin (281-3F)	4	FRB	0.59	0	1,150	42	0	1.07
Old F-Area Seepage Basin (904-49G)	4	OFASB	1.8	0	10,154	0	0	1.8
L-Area Reactor Seepage Basin (904-64G)	4	LRSB	1.73	0	0	0	0	1.73
L-Area Oil and Chemical Basin (904-83G)	4	LAOCB	0.45	0	2,170	200	0	1.32
K-Area Reactor Seepage Basin (904-65G)	4	KRSB	0.2	0	583	0	0	0.74
Asphalt/Concrete								
R-Area Operable Unit	2	RAOU	1.55	0	123,091	0	13,404	450
R-Area Reactor Seepage Basin (904-57G, 904-58G, 904-59G, 904-60G, 904-103G, and 904-104G) and 108-4R Overflow Basin	2	RRSB	18.1	0	0	370	0	37.8

Table A-2. Summary of Remedial Actions without Operating Equipment at SRS *(continued/end)*

Unit Name	FYR Phase	OU	Area Covered (acres)	Volume Covered (yd^3)	Volume Stabilized (yd^3)	Volume Consolidated (yd^3)	Volume Removed (yd^3)	LUC (acres)
Asphalt/Concrete								
Heavy Water Components Test Reactor	4	BAOU	0.15	0	123,091	0	0	0.15
P-Area Operable Unit	4	PAOU	0.86	0	117,981	0	10,905	85.32
F-Area Tank Farm	4	FTF	0.72	0	0	0	0	NA*
H-Area Tank Farm	4	HTF	0.23	0	0	0	0	NA*
Compacted Common Fill (no hydraulic conductivity requirement)								
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G)	2	CMP Pits	0.3	0	0	0	0	7.1
R-Area Ash Basin (188-R)	2	RAOU	15	0	0	0	0	15
Ford Building Seepage Basin (904-91G)	3	FBSB	0.22	0	0	0	0	0.28
K-Area Burning/Rubble Pit (131-K) and Rubble Pile (631-20G)	3	KBRP	0.8	0	0	10,000	0	1.15
SRL Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G)	3	SRLSB	2.1	0	0	0	6,200	2.56
P-007 Outfall	4	PAOU	4.5	0	0	0	8,000	4.5
P-Area Ash Basin (188-P)	4	PAOU	13.7	0	0	0	0	13.7
A-Area Miscellaneous Rubble Pile (731-6A)	5	AMRP	1.2	0	0	0	23.7	3.08
D-Area Operable Unit (Bubble Tower and Moderator Processing)	5	DAOU	0.7	0	0	16,500	116.7	245
C-Area Burning/Rubble Pit (131-C)	5	CBRP	0.6	0	0	0	0	141.2
D-Area Coal Pile Runoff Basin (489-D) (25% northern portion)	5	DAOU	4.8	0	0	5,720	0	4.96
New TNX Seepage Basin (904-102G)	5	NTSB	0.51	0	0	0	0	2.24

ABRP/RP = A-Area Burning/Rubble Pits and Rubble Pit
AMRP = A-Area Miscellaneous Rubble Pile
BAOU = B-Area Operable Unit
BPOP = Bingham Pump Outage Pits
CAOU = C-Area Operable Unit
CBRP = C-Area Burning/Rubble Pit
CKL Rx = C-, K-, and L-Reactor Complexes
CMP Pits = Chemicals, Metals, and Pesticides Pits
CSBRP = Central Shops Burning/Rubble Pit
CRSB = C-Area Reactor Seepage Basin
DAOU = D-Area Operable Unit
DBRP = D-Area Burning/Rubble Pit
DEXOU = D-Area Expanded Operable Unit
ECODS = Early Construction and Operational Disposal Site
FBRP = F-Area Burning/Rubble Pits
FBSB = Ford Building Seepage Basin
FRB = F-Area Retention Basin
FTF = F-Area Tank Farm
GSACU = General Separations Area Consolidation Unit
HEWB = Heavy Equipment Wash Basin (NBN)
HWMF = Hazardous Waste Management Facility
HTF = H-Area Tank Farm
KBRP = K-Area Burning/Rubble Pit
KRSB = K-Reactor Seepage Basin
LAOCB = L-Area Oil and Chemical Basin
LLWF = Low-Level Waste Facility
LRSB = L-Area Reactor Seepage Basin
LTR IOU = Lower Three Runs Integrator Operable Unit
MAOU = M-Area Operable Unit
MCB/MBP = Miscellaneous Chemical Basin / Metals Burning Pit
Met Lab = Metallurgical Laboratory
MWMF = Mixed Waste Management Facility
NBN = no building number
NTSB = New TNX Seepage Basin
OFASB = Old F-Area Seepage Basin
PAOU = P-Area Operable Unit
PAR Pond = PAR Pond (685-G) (Including the Pre-Cooler Ponds and Canals
PBRP = P-Area Burning/Rubble Pit (131-P)
PRSB = P-Reactor Seepage Basin
RAOU = R-Area Operable Unit
RBRP/RP = R-Area Burning/Rubble Pits and Rubble Pile
RRSB = R-Area Reactor Seepage Basin
SRLSB = SRL Seepage Basin
SRWU = Silverton Road Waste Unit
TAOU = T-Area Operable Unit

cm/sec = centimeter per second
FYR = Five-Year Remedy
yd3 = cubic yards

*NA = Not applicable. The Land Use Control Implementation Plan will be deferred until final closure of the entire OU. Therefore, the LUC area has not been established.

This page is intentionally left blank.

Table A-3. Summary of Remedial Actions with Operating Equipment at SRS

Unit Name	FYR Phase	OU	Start	Finish	ZOI Area (acres)	Volume Treated	Volume Removed (as of 2025)	COCs
Pump-and-Treat								
Water Treatment Units								
F-Area Groundwater OU	5	FAGW	1997	2003	250	345,718,674 gal	--	--
H-Area Groundwater OU	5	HAGW	1997	2003	250	347,165,473 gal	--	--
Air Stripper								
A-Area Groundwater OU	5	A/M GW	1992	2022	1,600	1,914,506,457 gal	17,306 lbs	PCE, TCE
M-Area Groundwater OU	5	A/M GW	1983	Ongoing	--	5,267,510,897 gal	588,699 lbs	PCE, TCE
TNX-Area Groundwater OU	5	TNX GW	1996	2007	80	275,070,482 gal	125	VOC, CCl_4
Airlift Recirculation Pumps								
A/M-Area Groundwater OU	5	A/M GW	1997	2020	0.08	1,900,000,000 gal	542	PCE, TCE
Miscellaneous Chemical Basin (731-4A)	5	A/M GW	2002	2011			46	VOC
Thermal Treatments								
Dynamic Underground Stripping								
A/M-Area Groundwater OU	5	A/M GW	2000	2001	1.1	1,600,000 gal	70,000 lbs	VOC
A/M-Area Groundwater OU	5	A/M GW	2005	2010	3+	12,000,000 gal	450,000 lbs	VOC
Electrical Resistance Heating with Soil Vapor Extraction								
C-Area Groundwater OU	5	CMP Pits	2006	2006	0.02	1,800 gal	730 lbs	TCE
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G)	2	CMP Pits	2008	2009	0.05	5,300 gal	2,300 lbs	VOCs
Detritiation								
D-Area Operable Unit	5	DAOU	2009	2011	--	1,650 gal	472 Ci	Tritium
Soil Vapor Extraction								
Mechanical								
A-Area Burning/Rubble Pits (731-A and 731-1A) and Rubble Pit (731-2A), Miscellaneous Chemical Basin (731-4A), Metals Burning Pit (731-5A)	5	ABRP/RP MCB/MBP	2008	2017	0.34	55,000 yd^3	143 lbs	TCE
Miscellaneous Chemical Basin (731-4A)	5	A/M GW	2001	2002	--	582 yd^3	170 lbs	TCE
A-Area Miscellaneous Rubble Pile (731-6A)	5	AMRP	2004	2017	--	6,000 yd^3	146 lbs	VOCs
A/M-Area Groundwater OU (WSTS)	5	A/M GW	2012	2019	--	--	2,582 lbs	VOCs
A/M-Area Groundwater OU (A014 - 782-3M)	5	A/M GW	1995	Ongoing	--	--	9,629 lbs	VOCs

Table A-3. Summary of Remedial Actions with Operating Equipment at SRS *(continued)*

Unit Name	FYR Phase	OU	Start	Finish	ZOI Area (acres)	Volume Treated	Volume Removed (as of 2025)	COCs
Soil Vapor Extraction (continued)								
Mechanical (continued)								
A/M-Area Groundwater OU (A-014 - Mobile #3)	5	A/M GW	2008	Ongoing	--	--	11,645 lbs	VOCs
C-Area Burning/Rubble Pit (131-C)	5	CBRP	2000	2004	0.28	4,500 yd^3	2,100 lbs	VOCs
M-Area Settling Basin Inactive Process Sewer Lines (081-M)	5	MIPSL	2007	2021	0.05	1,200 yd^3	4,474 lbs	PCE, TCE
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) Field A	2	CMP Pits	2002	2005	0.56	9,000 yd^3	9,300 lbs	VOCs
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) Field B	2	CMP Pits	2001	2002	0.21	3,400 yd^3	230 lbs	VOCs
MicroBlowers™								
A-Area Burning/Rubble Pits (731-A and 731-1A) and Rubble Pit (731-2A)	5	ABRP/RP MCB/MBP	2003	Ongoing	0.07	1,200 yd^3	78 lbs	VOCs
Miscellaneous Chemical Basin (731-4A), Metals Burning Pit (731-5A)	5	ABRP/RP MCB/MBP	2001	Ongoing	0.04	580 yd^3	18 lbs	VOCs
A/M-Area Groundwater OU (DUS)	5	A/M GW	2006	Ongoing	--	--	4,716 lbs	VOCs
A/M-Area Groundwater OU (WSTS)	5	A/M GW	2015	Ongoing	--	--	2632 lbs	VOC
A/M-Area Groundwater OU (SRNL)	5	A/M GW	2015	Ongoing	--	--	171 lbs	
A/M-Area Groundwater OU (MAPSL)	5	A/M GW	2016	Ongoing	--	--	1,295 lbs	
A/M-Area Groundwater OU (MRS-34)	5	A/M GW	2016	Ongoing	--	--	92 lbs	
C-Area Burning/Rubble Pit (131-C)	5	CBRP	2004	Ongoing	0.03	465	454 lbs	VOCs
D-Area Operable Unit (Bubble Tower)	5	DAOU	2010	Ongoing	0.25	4,033 yd^3	42 lbs	VOCs
M-Area Settling Basin Inactive Process Sewer Lines (081-M)	5	MIPSL	2008	2020	--	4,033 yd^3	236 lbs	VOCs
A-Area Miscellaneous Rubble Pile (731-6A)	5	AMRP	2017	2020	--	-- yd^3	20 lbs	VOCs
P-Area Operable Unit PSAs 3A and 3B	4	PAOU	2010	2012	--	94,622 yd^3	45 lbs	VOCs
TNX-Area Groundwater OU	5	TNX GW	2007	Ongoing	--	1,500 yd^3	12 lbs	VOCs

Table A-3. Summary of Remedial Actions with Operating Equipment at SRS *(continued/end)*

Unit Name	FYR Phase	OU	Start	Finish	ZOI Area (acres)	Volume Treated	Volume Removed (as of 2025)	COCs
Soil Vapor Extraction (continued)								
BaroBalls™ (continued)								
A-Area Burning/Rubble Pits (731-A and 731-1A) and Rubble Pit (731-2A)	5	ABRP/RP MCB/MBP	2003	Ongoing	0.22	3,500 yd^3	34.4	TCE
Miscellaneous Chemical Basin (731-4A)	5	ABRP/RP MCB/MBP	2001	Ongoing	0.19	3,200 yd^3	37.4	TCE, PCE
A/M-Area Groundwater OU	5	A/M GW	1998	Ongoing	--	--	--	--
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) Field B	2	CMP Pits	2001	2010	0.21	3,374 yd^3	--	--
M-Area Operable Unit	5	MAOU	2010	Ongoing	0.59	4,350 yd^3	--	--
P-Area Burning/Rubble Pit (131-P)	5	PBRP	2004	Ongoing	0.03	1,400 yd^3	--	--
Metallurgical Laboratory (Met Lab)	3	Met Lab	1998	Ongoing	--	--	--	TCE, PCE
TNX	5	TNX	1996	Ongoing	--	--	--	VOC
Injection								
Base Injection with Vertical Barrier Walls								
F-Area Groundwater OU	5	FAGW	2005	Ongoing	--	--	503,442,197 gal	--
H-Area Groundwater OU	5	HAGW	2010	Ongoing	--	--	43,313,880 gal	--
Edible Oil								
TNX-Area Groundwater OU	5	TNX GW	2008	2010	--	--	--	--

A/M GW = A/M-Area Groundwater
ABRP/RP = A-Area Burning/Rubble Pits and Rubble Pit
AMRP = A-Area Miscellaneous Rubble Pile
CBRP = C-Area Burning/Rubble Pit
CMP Pits = Chemical, Metals, and Pesticides Pits
COC = contaminant of concern
DAOU = D-Area Operable Unit
DUS = Dynamic Underground Stripping
FAGW = F-Area Groundwater
HAGW = H-Area Groundwater
MAOU = M=Area Operable Unit
MCB/MBP = Miscellaneous Chemical Basin / Metals Burning Pit
MIPSL = M-Area Settling Basin Inactive Process Sewer Lines
PAOU = P-Area Operable Unit
PBRP = P-Area Burning/Rubble Pit
PSA = Potential Source Area
TNX GW = TNX Groundwater
WSTS = Western Sector Treatment System
Ci = curies
FYR = Five-Year Remedy
gal = gallon
lbs = pounds
OU = operable unit
PCE = tetrachloroethylene
TCE = trichloroethylene
VOC = volatile organic compound
yd3 = cubic yards
ZOI = zone of influence

-- No data

This page is intentionally left blank.

Table A-4. Chronological Listing of SRS Issued Decision Documents

Document Title[a]	Document Number	Rev.	Issuance Date[b]
Consent Decree Signed			***May 26, 1988***
NPL Listing Effective Date			***December 21, 1989***
A/M Area Groundwater IROD (RCRA)	WSRC-RP-92-744	0	September 16, 1992
M-Area Hazardous Waste Management Facility (904-51G, 904-112G) IROD (RCRA)	**WSRC-RP-92-743**	**0**	**September 6, 1992**
Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) IROD (RCRA)	**WSRC-RP-92-745**	**0**	**September 16, 1992**
Federal Facility Agreement Declared Effective			***August 16, 1993***
F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) ROD (RCRA)	**WSRC-RP-93-1042**	**1**	**October 1, 1993**
H-Area Hazardous Waste Management Facility (904-44G, 904-45G, 904-46G, 904-56G) ROD (RCRA)	**WSRC-RP-93-1043**	**1**	**September 10, 1993**
Mixed Waste Management Facility (643-28E) ROD (RCRA)[c]	**WSRC-RP-93-1511**	**1**	**September 23, 1994**
Tank 105-C Hazardous Waste Management Facility ROD (RCRA)[c]	WSRC-RP-94-106	1	September 23, 1994
TNX Groundwater Operable Unit IROD[c]	WSRC-TR-94-0375	1	November 16, 1994
PAR Pond (685-G) IROD[c]	WSRC-RP-93-1549	0	February 16, 1995
D-Area Oil Seepage Basin (631-G) IROD[c]	WSRC-RP-93-1550	1	March 6, 1995
F-Area Groundwater Operable Unit (904-41G, 904-42G, and 904-43G) IROD (RCRA)[c]	WSRC-RP-94-1162	1	April 13, 1995
H-Area Groundwater Operable Unit (904-44G, 904-45G, 904-46G, and 904-56G) IROD (RCRA)[c]	WSRC-RP-94-1163	1	April 13, 1995
M-Area West Unit (631-21G) ROD[c]	WSRC-RP-95-626	0	September 29, 1995
Old Radioactive Waste Burial Ground (643-E) IROD	WRSC-RP-96-102	0	July 25, 1996
Burma Road Rubble Pit (231-4F) ROD	WSRC-RP-96-101	1	July 25, 1996
D-Area Burning/Rubble Pits (431-D, 431-1D) ROD	**WSRC-RP-96-867**	**1**	**July 3, 1997**
F-Area Burning/Rubble Pits (231-F, 231-1F, and 231-2F) ROD	WSRC-RP-96-868	1	July 3, 1997
Grace Road Site (631-22G) ROD	WSRC-RP-96-160	1	July 3, 1997
Gunsite 113 Access Road Unit (631-24G) ROD	WSRC-RP-96-833	1	July 3, 1997
Gunsite 720 Rubble Pit Unit (631-16G) ROD	WSRC-RP-96-832	1	July 3, 1997
Silverton Road Waste Unit (713-3A) ROD	WSRC-RP-96-171	1	July 3, 1997
Central Shops Burning/Rubble Pit (631-6G) ROD	WSRC-RP-96-873	1	July 3, 1997

Table A-4. Chronological Listing of SRS Issued Decision Documents *(continued)*

Document Title[a]	Document Number	Rev.	Issuance Date[b]
Old F-Area Seepage Basin (904-49G) ROD	WRSC-RP-96-872	1.1	July 3, 1997
First Five-Year Remedy Review	***WSRC-RP-97-403***	***0***	***August 27, 1997***
TNX Groundwater Operable Unit ESD	WSRC-RP-97-169	1	October 10, 1997
K-Area Bingham Pump Outage Pit (643-1G) ROD	WSRC-RP-97-178	1	June 11, 1998
C-, F-, K-, and P-Area Coal Pile Runoff Basins (189-C, 289-F, 189-K, 189-P) ROD[c]	WSRC-RP-97-850	1	November 10, 1998
L-Area Oil and Chemical Basin and L-Area Acid/Caustic Basin (904-83G, 904-79G) ROD	WSRC-RP-97-143	1	November 10, 1998
716-A Motor Shops Seepage Basin (904-101G) ROD	WSRC-RP-97-840	0	November 16, 1998
Fire Department Hose Training Facility (904-113G) ROD	WSRC-RP-97-171	1	November 16, 1998
Old F-Area Seepage Basin (904-49G) ESD	WSRC-RP-98-4123	1	December 16, 1998
D-Area Oil Seepage Basin (631-G) ROD	WSRC-RP-97-402	1	May 7, 1999
C-Area Burning/Rubble Pit (131-C) IROD	WSRC-RP-98-4039	0	May 7, 1999
F-Area Retention Basin (281-3F) ROD	WSRC-RP-97-145	1.1	May 19, 1999
Ford Building Waste Site (643-11G) ROD	WSRC-RP-98-4066	1	October 13, 1999
Chemicals, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) IROD	WSRC-RP-98-4192	1.1	January 19, 2000
SRL Seepage Basins (904-51G1, 904-52G2, 904-52G, and 904-55G) ROD	**WSRC-RP-97-848**	**1.1**	**April 26, 2000**
C-Reactor Seepage Basins (904-66G, 904-67G, and 904-68G) Plug-In ROD ESD	WSRC-RP-2000-4032	0	October 18, 2000
L & P Bingham Pump Outage Pits (643-2G, 643-3G, and643-4G) ROD	WSRC-RP-98-4015	1	October 18, 2000
Burma Road Rubble Pit, 231-4F ESD[c]	WSRC-RP-98-4170	1	February 6, 2001
A-Area Burning/Rubble Pits (731-A, 731-1A) and Rubble Pit (731-2A) IROD	WSRC-RP-2000-4001	1	February 9, 2001
Miscellaneous Chemical Basin/Metals Burning Pit (731-4A, 731-5A) IROD	WSRC-RP-98-4031	1.1	February 9, 2001
West of SRL "Georgia Fields" Site (631-19G) ROD	WSRC-RP-99-4164	0	February 22, 2001
F-Area Retention Basin (281-3F) ESD[c]	WSRC-RP-2000-4079	1	June 7, 2001
K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) ROD[c]	**WSRC-RP-97-862**	**1**	**August 20, 2001**
ORWBG Old Solvent Tanks (650-01E through 650-22E) IROD	WSRC-RP-2000-4193	1	September 27, 2001
Ford Building Seepage Basin ROD	**WSRC-RP-2000-4156**	**1**	**April 5, 2002**

Table A-4. Chronological Listing of SRS Issued Decision Documents *(continued)*

Document Title[a]	Document Number	Rev.	Issuance Date[b]
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) IROD Amendment	WSRC-RP-2000-4158	1.2	April 8, 2002
K-Area Reactor Seepage Basin (904-65G) ESD[c]	WSRC-RP-99-4200	1.1	September 16, 2002
General Separations Area Consolidation Unit ROD	WSRC-RP-2002-4002	0	October 25, 2002
Central Shops Sludge Lagoon (080-24G) ROD	WSRC-RP-2000-4189	1	November 15, 2002
C-Area & L-Area Reactor Seepage Basin ROD Amendment	WSRC-RP-2002-4063	1	December 5, 2002
R-Area Acid/Caustic Basin (904-77G) ROD	WSRC-RP-2002-4015	1	February 10, 2003
L-Area Burning/Rubble Pit (131-L) and Rubble Pile (131-3L) and Gas Cylinder Disposal Facility (131-2L) ROD	WSRC-RP-98-4195	1.1	February 17, 2003
A-Area Burning/Rubble Pits (731-A, 731-1A) and Rubble Pit (731-2A) ESD	WSRC-RP-2001-4281	1	March 10, 2003
R-Area Bingham Pump Outage Pits (643-8G, 643-9G and 643-10G) and R-Area Unknown Pits #1, #2, and #3 ROD	WSRC-RP-2001-4129	1.1	April 28, 2003
TNX Area Groundwater Operable Unit ESD[c]	WSRC-RP-2001-00764	0	May 19, 2003
Central Shops Burning/Rubble Pits (631-1G and 631-3G) ROD	**WSRC-RP-2001-4265**	**1.1**	**June 30, 2003**
P-Area Burning/Rubble Pit (131-P) ROD	WSRC-RP-2000-4197	1	August 8, 2003
A-Area Miscellaneous Rubble Pile (731-6A) ROD	WSRC-RP-2001-4197	1.3	August 11, 2003
P-Area Reactor Seepage Basin (904-61G, 904-62G, and 904-63G) Plug-In ROD ESD	WSRC-RP-2002-4105	1.1	October 2, 2003
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) Second IROD Amendment	WSRC-RP-2001-4232	1.1	October 21, 2003
L-Area Hot Shop (717-G) ROD	WSRC-RP-2002-4025	1.1	November 3, 2003
Road A Chemical Basin (904-111G) ROD	WSRC-RP-2002-4153	0	November 3, 2003
Second Five-Year Remedy Review[c]	***WSRC-RP-2001-4163***	***1.1***	***February 12, 2004***
R-Area Reactor Seepage Basins (904-57G, 904-58G, 904-59G, 904-60G, 904-103G, and 904-104G) and 108-4R Overflow Basin ROD	WSRC-RP-2003-4093	1	March 18, 2004
TNX Burying Ground (643-G), New TNX Seepage Basin, Old TNX Seepage Basin and TNX Groundwater (082-G) ROD	WSRC-RP-2003-4017	1	April 7, 2004
SRL Oil Test Site (808-16G) ROD	WSRC-RP-2003-4164	1	September 20, 2004
R-Area Burning/Rubble Pits (131-R and 131-1R) and Rubble Pile (631-25G) ROD	WSRC-RP-2004-4004	1	September 28, 2004
C-Area Reactor Groundwater IROD	WSRC-RP-2004-4022	1	October 15, 2004
D-Area Expanded Operable Unit (Consisting of D-Area Ash Basin [488-D] and D-Area Rubble Pit [431-2D]) ROD	WSRC-RP-2004-4007	1	December 17, 2004
Old F-Area Seepage Basin (904-49G) ROD Amendment	WSRC-RP-2003-4136	1	December 17, 2004
Heavy Equipment Wash Basin and Central Shops Burning/Rubble Pit (631-5G) ROD	WSRC-RP-2003-4185	1.1	January 28, 2005
Chemical, Metals, and Pesticides Pits (080-170G, 080-171G, 080-180G, 080-181G, 080-182G, 080-183G, and 080-190G) ROD	WSRC-RP-2004-4090	1	May 10, 2005

Table A-4. Chronological Listing of SRS Issued Decision Documents *(continued)*

Document Title[a]	Document Number	Rev.	Issuance Date[b]
Silverton Road Waste Unit (731-3A) ESD	WSRC-RP-2004-4092	1.1	June 16, 2005
TNX Area OU ESD	WSRC-RP-2005-4030	1	November 7, 2005
Hydrofluoric Acid Spill (631-4G) ROD	WSRC-RP-2005-4000	0	December 28, 2005
T-Area OU ROD	WSRC-RP-2004-4070	1	January 4, 2006
K-Area Sludge Land Application Site (761-4G) and PAR Pond Sludge Land Application Site (761-5G) ROD	WSRC-RP-2005-4064	1	June 30, 2006
211-FB Pu-239 Release (081-F) ROD	WSRC-RP-2005-4090	1	September 18, 2006
M-Area Inactive Process Sewer Lines (081-M) ROD	WSRC-RP-2006-4001	1	April 26, 2007
L-Area Southern Groundwater ROD	WSRC-RP-2006-4052	1.1	May 9, 2007
A-Area Burning/Rubble Pits (731-A, 731-1A) and Rubble Pit (731-2A) and the Miscellaneous Chemical Basin/Metals Burning Pit (731-4A, 731-5A) ROD	WSRC-RP-2005-4095	1.1	August 2, 2007
C-Area Burning/Rubble Pit (131-C) and Old C-Area Burning/Rubble Pit (NBN) ROD	WSRC-RP-2007-4082	1	July 9, 2008
Third Five-Year Remedy Review	***WSRC-RP-2007-4063***	***1.1***	***January 28, 2009***
P-Area Operable Unit Early Action ROD	WSRC-RP-2008-4037	1.1	January 29, 2009
M-Area Operable Unit ROD	WSRC-RP-2008-4030	1	February 5, 2009
M-Area Operable Unit ESD	SRNS-RP-2009-00406	1	July 9, 2009
P-Area Operable Unit Early Action ROD ESD	SRNS-RP-2009-00704	1	October 27, 2009
C-, K-, L- and R-Reactor Complexes Early Action ROD	SRNS-RP-2009-00707	1	December 8, 2009
E-Area Low Level Waster Facility (Slit Trench Disposal Units 1 and 2) IROD	SRNS-RP-2009-00538	1	January 22, 2010
Early Construction and Operational Disposal Site L-1, N-2, P-2, R-1A, R-1B, R-1C ROD	SRNS-RP-2009-00072	1	March 30, 2010
E-Area Low Level Waste Facility (Slit Trench Disposal Units 1 and 2) ESD	SRNS-RP-2009-01128	1	April 22, 2010
P-Area Operable Unit ROD	SRNS-RP-2009-01368	1	July 22, 2010
Gunsite 218 Rubble Pile ROD	SRNS-RP-2010-00051	1	October 22, 2010
R-Area Operable Unit ROD	SRNS-RP-2010-01062	1	April 20, 2011
L-Area Northern Groundwater ROD	SRNS-RP-2011-00134	1	June 20, 2011
Gunsite 012 (including ECODS G-3) ROD	SRNS-RP-2010-01232	1	June 27, 2011
D-Area Operable Unit Early Action ROD	SRNS-RP-2010-00162	1.2	September 26, 2011
PAR Pond Unit: Lower Three Runs IOU Tail Portion (Middle and Lower Subunits) ESD	SRNS-RP-2012-00121	1	September 13, 2012

Table A-4. Chronological Listing of SRS Issued Decision Documents *(continued)*

Document Title[a]	Document Number	Rev.	Issuance Date[b]
B-Area Operable Unit ROD	SRNS-RP-2012-00354	1	April 16, 2013
F-Area Tank Farm (Waste Tanks 17 and 20) IROD	SRR-CWDA-2013-00111	1	April 30, 2013
TNX Area Operable Unit (Second ESD to the ROD)	SRNS-RP-2012-00205	1	June 12, 2013
F-Area Tank Farm (Waste Tanks 18 and 19) ESD to the IROD	SRR-CWDA-2013-00007	1.1	September 23, 2013
Fourth Five-Year Remedy Review	***SRNS-RP-2012-00011***	***1.1***	***February 4, 2014***
L-Area Southern Groundwater Operable Unit (ESD to the ROD)	SRNS-RP-2012-00736	1	September 10, 2014
F-Area Tank Farm (Waste Tanks 5 and 6) ESD to the IROD	SRR-CWDA-2014-00008	1	September 11, 2014
C-Area Operable Unit Early Action ROD	SRNS-RP-2014-00836	1	September 2, 2015
Fifth Five-Year Remedy Review for SRS OUs with Native Soil Covers and/or LUCs	***SRNS-RP-2014-00902***	***1***	***November 30, 2015***
H-Area Tank Farm (Waste Tank 16) IROD	SRR-CWDA-2015-00157	1	August 16, 2016
Fifth Five-Year Remedy Review for SRS OUs with Groundwater Remedies	***SRNS-RP-2015-00419***	***1***	***February 2, 2017***
H-Area Tank Farm (Waste Tank 12) ESD to the IROD	SRR-CWDA-2016-00107	0	April 20, 2017
Fifth Five-Year Remedy Review for SRS OUs with Engineered Covers	***SRNS-RP-2016-00609***	***1***	***February 21, 2018***
Fifth Five-Year Remedy Review for SRS OUs with Geosynthetic or S/S Cover Systems	***SRNS-RP-2016-00610***	***1.1***	***March 27, 2018***
Wetland Area at Dunbarton Bay in Support of Steel Creek Integrator Operable Unit ROD	SRNS-RP-2013-00730	1	June 20, 2018
Fifth Five-Year Remedy Review Report for SRS OUs with Operating Equipment	***SRNS-RP-2017-00567***	***1***	***December 5, 2018***
G-Area Oil Seepage Basin (761-13G) Operable Unit ROD	SRNS-RP-2018-01050	1	June 26, 2019
Sixth Five-Year Remedy Review Report for SRS OUs with Native Soil Covers and/or LUCs	***SRNS-RP-2018-00811***	***1***	***November 5, 2019***
D-Area Operable Unit Second EAROD	SRNS-RP-2018-00461	1	September 24, 2020
Sixth Five-Year Remedy Review Report for SRS OUs with Groundwater Remedies	***SRNS-RP-2019-00511***	***1***	***December 9, 2020***

Table A-4. Chronological Listing of SRS Issued Decision Documents *(continued/end)*

Document Title[a]	Document Number	Rev.	Issuance Date[b]
Stormwater Outfall A-013 (NBN) ROD	SRNS-RP-2020-00904	1	September 30, 2021
Sixth Five-Year Remedy Review Report for SRS OUs with Engineered Cover Systems	***SRNS-RP-2020-00420***	***1***	***December 21, 2021***
Lower Three Runs Integrator Operable Unit ROD	SRNS-RP-2020-00542	1	December 21, 2021
Sixth Five-Year Remedy Review Report for SRS OUs with Geosynthetic or Solidification/Stabilization Cover Systems	***SRNS-RP-2021-04229***	***1***	***December 28, 2022***
Wetland Area at Dunbarton Bay in Support of Steel Creek IOU ESD to the ROD	SRNS-RP-2022-00982	1	August 10, 2023
Early Construction and Operational Disposal Site N-1 (South of N Area) (NBN), Central Shops Scrap Lumber Pile (631-2G), and Building 690-N, Process Heat Exchanger Repair Facility (AKA Ford Building) Operable Unit ROD[d]	SRNS-RP-2022-01284	1	October 12, 2023
F-Area Tank Farm (F-Area Diversion Boxes 5 and 6) ESD to the IROD	SRMC-CWDA-2023-00006	1	October 12, 2023
Sixth Five-Year Remedy Review Report for SRS OUs with Operating Equipment	***SRNS-RP-2022-00468***	***1***	***December 22, 2023***
Seventh Five-Year Remedy Review Report for SRS OUs with Native Soil Covers and/or LUCs	***SRNS-RP-2023-00715***	***1***	***January 7, 2025***
Seventh Five-Year Remedy Review Report for SRS OUs with Groundwater Remedies	***SRNS-RP-2024-00934***	***1***	***January 15, 2026***

a Shaded text identifies the SRS OUs evaluated in this report for the third phase of the seventh five-year remedy review (i.e., engineered cover systems).

b Unless otherwise noted, the Issuance Date represents the date that the public was notified that the Three-Party signed document was available.

c This is the last signature date instead of the Issuance Date.

d Early Construction and Operational Disposal Site N-1 (NBN) (ECODS N-1), Central Shops Scrap Lumber Pile (631-2G) (CSSLP), and Building 690-N, Process Heat Exchanger Repair Facility (also known as Ford Building) Operable Unit is included in the native soil covers and/or LUCs phase. However, since the seventh five-year remedy review document development occurred before completion of the remedy implementation, ECODS N-1, CSSLP, and Ford Building OU was not discussed in this review cycle.

Table A-5. Summary of No Remedial Actions at SRS OUs

Operable Unit	Remedial Action
No Action/No Further Action	
211-FB Pu-239 Release (081-F)	No Action
716-A Motor Shops Seepage Basin (904-101G)	No Action
Burma Road Rubble Pit (231-4F)	No Action
Central Shops Burning/Rubble Pit (631-6G)	No Action
Central Shops Sludge Lagoon (080-24G)	No Action
C-, F-, K-, and P-Area Coal Pile Runoff Basins (189-C, 289-F, 189-K, 189-P)	No Further Action
Fire Department Hose Training Facility (904-113G)	No Action
Ford Building Waste Site (643-11G)	No Further Action (Removal)
G-Area Oil Seepage Basin (761-13G)	No Action
Gas Cylinder Disposal Facility (131-2L)	No Further Action (Removal)
Grace Road Site (631-22G)	No Action
Gunsite 113 Access Road Unit (631-24G)	No Action
Gunsite 218 Rubble Pile (621-23G)	No Action
Gunsite 720 Rubble Pit Unit (631-16G)	No Action
Hydrofluoric Acid Spill (631-4G)	No Action
K-Area and PAR Pond Sludge Land Application Site (761-4G and 761-5G)	No Action
L-Area Burning/Rubble Pit (131-L)	No Action
L-Area Hot Shop (717-G)	No Further Action
L-Area Northern Groundwater (NBN)	No Action
L-Area Rubble Pile (131-3L)	No Further Action (Removal)
M-Area West Unit (631-21G)	No Action
R-Area Acid/Caustic Basin (904-77G)	No Action
Road A Chemical Basin (904-111G)	No Action
SRL Oil Test Site (080-16G)	No Action
Stormwater Outfall A-013 (NBN)	No Action
West of SRL "Georgia Fields" Site (631-19G)	No Action
No Action/No Further Action OUs Associated with OUs Requiring Remedial Action	
108-4R Overflow Basin (108-4R)[1]	No Further Action
489-D Coal Pile Runoff Basin – Southern 75% Subunit[2]	No Further Action
A-Area Burning/Rubble Pit (731-1A)[3]	No Action
A-Area Burning/Rubble Pit (731-A)[3]	No Action
Central Shops Burning/Rubble Pit (631-5G)[4]	No Action
ECODS B-3 and B-5 (NBN)[5]	No Further Action
ECODS G-3 (Adjacent to Gunsite 012) (NBN)[6]	No Action
L-Area Acid/Caustic Basin (904-79G)[7]	No Action
Metals Burning Pit (731-5A)[3]	No Action
Rubble Pile Across from Gunsite 012 (NBN)[6]	No Action
R-Area Rubble Pile (631-25G)[8]	No Action

Table A-5. Summary of No Remedial Actions at SRS OUs (*continued/end)*

Operable Unit	Remedial Action
RCRA Units that are No Further Action under CERCLA	
H-Area Hazardous Waste Management Facility (904-44G, 904-45G, 904-46G, 904-56G)	No Further Action (Low Permeability Cap)
Tank 105-C Hazardous Waste Management Facility (NBN)	No Further Action
F-Area Hazardous Waste Management Facility (904-41G, 904-42G, 904-43G)	No Further Action (Low Permeability Cap, In Situ S/S)
Mixed Waste Management Facility (643-28E)	No Further Action (Low Permeability Cap)

1 – Included with R-Reactor Seepage Basins (904-103G, 904-104G, 904-57G, 904-58G, 904-59G, and 904-60G)
2 – Included with D-Area Operable Unit
3 – Included with A-Area Burning/Rubble Pits (731-A and731-1A) and Rubble Pit (731-2A), Miscellaneous Chemical Basin (731-4A) and Metals Burning Pit (731-5A)
4 – Included with Heavy Equipment Wash Basin (NBN)
5 – Included with B-Area Operable Unit
6 – Included with Gunsite 012
7 – Included with L-Area Oil and Chemical Basin (904-83G)
8 – Included with R-Area Burning/Rubble Pits (131-R and 131-1R)

Table A-6. List of OU Subunits with Remedial Actions

#	OU Subunits[a,b]	SEMS #
1	A-Area Burning/Rubble Pit, 731-1A	28
	A-Area Burning/Rubble Pit, 731-A	
	A-Area Rubble Pit, 731-2A	
	Miscellaneous Chemical Basin, 731-4A	
	Metals Burning Pit, 731-5A	
2	A-Area Miscellaneous Rubble Pile, 731-6A	30
3	A/M Area Groundwater	36
4	B-Area Operable Unit	48
5	C-Area Burning/Rubble Pit, 131-C	31
	Old C-Area Burning/Rubble Pit, NBN	
6	C-Area Groundwater	82
7	C-Area Process Sewer Line as Abandoned, NBN	79
	C-Area Reactor Area Cask Car Railroad Tracks as Abandoned, NBN	
	C-Reactor Discharge Canal, NBN	
	ECODS C-1 (Near C-Area Reactor Discharge Canal), NBN	
	Potential Release from C-Area Disassembly Basin, NBN	
	Potential Release from C-Area Reactor Cooling Water System, 186/190-C	
8	C-Area Reactor Seepage Basin, 904-66G	60
	C-Area Reactor Seepage Basin, 904-67G	
	C-Area Reactor Seepage Basin, 904-68G	
9	Central Shops Burning/Rubble Pit, 631-1G	50
	Central Shops Burning/Rubble Pit, 631-3G	
10	CMP Pit, 080-170G	24
	CMP Pit, 080-171G	
	CMP Pit, 080-180G	
	CMP Pit, 080-181G	
	CMP Pit, 080-182G	
	CMP Pit, 080-183G	
	CMP Pit, 080-190G	
11	C-, K-, L-Reactor Complexes	79, 90, 91
12	D-Area Burning/Rubble Pit, 431-D	15
	D-Area Burning/Rubble Pit, 431-1D	
13	D-Area Ash Basin, 488-D	67
	D-Area Rubble Pit, 431-2D	
14	D-Area Oil Seepage Basin, 631-G	27
15	D-Area Coal Pile Runoff Basin, 489-D	63
	D-Area Waste Oil Facility, 484-10D	
	D-Area Asbestos Pit, 080-20G	
	Combined Spills from 483-D and Associated Areas, NBN	
	D-Area Process Sewer Lines as Abandoned, NBN	
16	E-Area Low Level Waste Facility, 643-26E	86
17	ECODS L-1, NBN	22
	ECODS P-2, NBN	
	ECODS R-1A, -1B, -1C, NBN	
	ECODS N-2, NBN	

Table A-6. List of OU Subunits with Remedial Actions *(continued)*

#	OU Subunits[a,b]	SEMS #
18	ECODS N-1 (South of N Area), NBN	93
	Central Shops Scrap Lumber Pile, 631-2G	
	Building 690-N, Process Heat Exchanger Repair Facility (Ford Building)	
19	F-Area Burning/Rubble Pit, 231-1F	14
	F-Area Burning/Rubble Pit, 231-2F	
	F-Area Burning/Rubble Pit, 231-F	
20	F-Area Groundwater Operable Unit (904-41G, 904-42G, 904-43G)	8
21	F-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-41G)	6
	F-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-42G)	
	F-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-43G)	
22	F-Area Retention Basin, 281-3F	23
23	F-Area Tank Farm, Waste Tanks 17 and 20	
	F-Area Tank Farm, Waste Tanks 18 and 19	
	F-Area Tank Farm, Waste Tanks 5 and 6	
24	Ford Building Seepage Basin, 904-91G	58
25	General Separations Area Consolidation Unit including Old Radioactive Waste Burial Ground, 643-E and Old Solvent Tanks (650-01E through 650-22E)	32
	Warner's Pond, 685-23G and Spill on 03/08/1978 of Unknown Seepage Basin Pipe Leak in H-Area Seepage Basin, NBN and Spill on 02/08/1978 of Unknown H-Area Process Sewer Line Cave-In, NBN	
	H-Area Retention Basin, 281-3H and Spill on 05/01/1956 of Unknown Amount of Retention Basin Pipe Leak, NBN	
	HP-52 Ponds, NBN	
26	Gunsite 012 Rubble Pile, NBN	78
	Rubble Pile across from Gunsite 012, NBN	
27	H-Area Groundwater	9
28	H-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-44G)	7
	H-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-45G)	
	H-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-46G)	
	H-Area Hazardous Waste Management Facility (F-Area Seepage Basin, 904-56G)	
29	H-Area Tank Farm, Waste Tank 12[c]	89
	H-Area Tank Farm, Waste Tank 16[c]	
30	Heavy Equipment Wash Basin, NBN	53
31	K-Area Bingham Pump Outage Pit, 643-1G	20
32	K-Area Burning/Rubble Pit, 131-K	40
	K-Area Rubble Pile, 631-20G	
33	K-Area Reactor Seepage Basin, 904-65G	55
34	L-Area Bingham Pump Outage Pit, 643-2G	26
	L-Area Bingham Pump Outage Pit, 643-3G	
	P-Area Bingham Pump Outage Pit, 643-4G	39
35	L-Area Oil Chemical Basin, 904-83G	17
36	L-Area Reactor Seepage Basin, 904-64G	65
37	L-Area Southern Groundwater, NBN	77
38	Lower Three Runs IOU, NBN	35
	PAR Pond (including the Pre-Cooler Ponds and Canals(, 685-G	
	Old R-Area Discharge Canal, NBN	

Table A-6. List of OU Subunits with Remedial Actions *(continued)*

#	OU Subunits[a,b]	SEMS #
39	M-Area Hazardous Waste Management Facility: Lost Lake, 904-112G	1
	M-Area Hazardous Waste Management Facility: M-Area Settling Basin, 904-51G	
40	M-Area Settling Basin Inactive Process Sewers to Manhole 1, 081-M	19
41	Inactive Clay Process Sewer Lines (Including Potential Release of TCT, TET, TCE, HNO_3, U, Heavy Metals from 321-M Abandoned Sewer Line), NBN	92
	Salvage Yard, 741-A	
	M-Area Underground Sump 321-M #001	
	M-Area Underground Sump 321-M #002	
	M-Area Test Pile Facility, 305-A	
42	Metallurgical Laboratory Hazardous Waste Management Facility, 904-110G	2
43	Mixed Waste Management Facility, 643-28E	33
44	Old F-Area Seepage Basin, 904-49G	16
45	P-Area Burning/Rubble Pit, 131-P	59
46	P-Area Ash Basin (including Outfall P-007), 188-P	94
	Potential Release from P-Area Disassembly Basin, NBN	
	Potential Release from P-Area Reactor Cooling Water System, 186/190-P	
	P-Area Reactor Area Cask Car Railroad Tracks as Abandoned, NBN	
	P-Area Process Sewer Lines as Abandoned, NBN and Spill on 3/15/79 of 5500 Gallons of Contaminated Water, NBN	
47	P-Area Reactor Seepage Basin, 904-61G	66
	P-Area Reactor Seepage Basin, 904-62G	
	P-Area Reactor Seepage Basin, 904-63G	
48	R-Area Bingham Pump Outage Pit, 643-10G	38
	R-Area Bingham Pump Outage Pit, 643-8G	
	R-Area Bingham Pump Outage Pit, 643-9G	
	R-Area Unknown Pit #1 (Runk-1), NBN	
	R-Area Unknown Pit #2 (Runk-2), NBN	
	R-Area Unknown Pit #3 (Runk-3), NBN	
49	R-Area Burning/Rubble Pit, 131-1R	43
	R-Area Burning/Rubble Pit, 131-R	
	R-Area Rubble Pit, 631-25G	
50	Area on the North Side of Building 105-R	95
	Laydown Area North of 105-R	
	R-Area Cooling Water Effluent Sump, 107-R	
	Potential Release of $NaOH/H_2SO_4$ from 183-2R, NBN	
	R-Area Ash Basin, 188-R	
	Potential Release from R-Area Disassembly Basin, NBN	
	R-Area Reactor Area Cask Car Railroad Tracks as Abandoned, NBN	
	Release from the Decontamination of R-Reactor Disassembly Basin, NBN	
	Combined Spills North of Building 105-R, NBN	
	R-Area Process Sewer Lines as Abandoned, NBN	
	R-Area Reactor Building, 105-R	

Table A-6. List of OU Subunits with Remedial Actions *(continued/end)*

#	OU Subunits[a,b]	SEMS #
51	R-Area Reactor Seepage Basin, 904-103G	25
	R-Area Reactor Seepage Basin, 904-104G	
	R-Area Reactor Seepage Basin, 904-57G	
	R-Area Reactor Seepage Basin, 904-58G	
	R-Area Reactor Seepage Basin, 904-59G	
	R-Area Reactor Seepage Basin, 904-60G	
52	Silverton Road Waste Unit, 731-3A	13
53	SRL Seepage Basin, 904-53G1	47
	SRL Seepage Basin, 904-53G2	
	SRL Seepage Basin, 904-54G	
	SRL Seepage Basin, 904-55G	
54	Neutralization Sump, 678-T	96
	X-001 Outfall Drainage Ditch, NBN	
	TNX Outfall Delta, Lower Discharge Gully and Swamp, NBN	
	TNX-Area Process Sewer Lines and Tile Fields as Abandoned, NBN	
55	TNX Groundwater, 082G	21
	New TNX Seepage Basin, 901-102G	29
	Old TNX Seepage Basin, 904-76G	
	TNX Burying Ground, 643-5G (Including Spill on 1/12/53 of ½ Ton of Uranyl Nitrate, NBN)	
56	Wetland Area at Dunbarton Bay[c]	71

a OU subunits include RCRA/CERCLA units and RCRA regulated units. Deactivation & Decommissioning facilities are not represented.

b Shaded text identifies the SRS OUs evaluated in this report for the third phase of the seventh five-year remedy review (i.e., engineered cover systems).

c ECODS N-1, CSSLP, and Ford Building OU is included in the native soil covers and/or LUCs phase. However, since the seventh five-year remedy review document development occurred before the remedy implementation, this OU was not included in this review cycle.

APPENDIX B. EVALUATION OF CHANGES IN STANDARDS AND TOXICITY

This appendix provides an evaluation of changes in standards and toxicity for chemical and radiological constituents since the last five-year remedy review was initiated in 2020 for the Savannah River Site (SRS) operable units (OUs) evaluated in this report. The purpose of the evaluation is to determine if there are any changes in standards or toxicity values that would call into question the protectiveness of the remedy. No protectiveness issues with respect to changes in standards and toxicity were identified in the previous five-year remedy review report (SRNS 2021).

An evaluation was performed for analytes that were identified as constituents of concern (COCs) for the OUs discussed in Appendix C through Appendix L. As discussed in Appendix A, the OUs evaluated in this report were grouped in the Engineered Cover Systems category and were designed to have a lower permeability and more effective surface drainage as compared to native soil covers. The Engineered Cover Systems category includes OUs that used common fill or clayey material and had some form of engineering controls (i.e., soil material requirements, soil compaction requirements, and/or storm water management systems).

The U.S. Environmental Protection Agency (USEPA) Regional Screening Levels (RSLs) for Non-Radiological Constituents (November 2024), USEPA Preliminary Remediation Goals (PRGs) for Radionuclides (July 2025), and USEPA Maximum Contaminant Levels (MCLs) for radiological and chemical constituents were evaluated in this review. These values were compared to the values available in 2020 when the last five-year remedy review for SRS OUs in the Engineered Systems category was initiated (SRNS 2021). Standards and toxicity values for both the industrial worker and hypothetical residential receptor are provided for comparative purposes for most media.

The comparison tables do not make any distinction between COCs that were the primary drivers for the selected remedial action and other analytes that were simply addressed through the same remedy. Most importantly, the values presented in Tables B-1 through B-3 are not cleanup levels and should not be considered remedial goals unless otherwise

noted in the OU-specific remedy reviews. For this reason, the information in Appendix B is not standalone, but must be considered in context with the information and selected remedy presented in the OU-specific reviews located in Appendix C through Appendix L.

Changes to a standard or toxicity factor are unique to each analyte and are often related to revisions in exposure assumptions, reference doses, cancer potency factors, and exposure pathways used to calculate the screening values. For the reasons explained in the previous paragraph, the impact that more stringent RSLs or PRGs have on protectiveness must be considered with respect to the OU-specific remedy. In most cases, a change in a standard or toxicity value is irrelevant because the analyte(s) may no longer be present or is (are) significantly reduced due to biodegradation, decay or excavation and offsite disposal activities. In addition, exposure to contaminants left in place are effectively prevented by the remedy, i.e. engineered cover system and land use controls.

Therefore, risk-based cleanup goals for each OU evaluated in this five-year remedy review do not warrant revision as a result of changes to toxicity criteria, RSLs/PRGs, exposure factors/assumptions, or risk methodology, because the remedy is effective in eliminating the exposure pathways of concern. In addition, there are no changes in land use, including zoning changes, routes of exposure or receptors, or changes in the physical site conditions that would compromise the protectiveness of the remedy.

In November 2016, a major revision to the approach for calculating PRGs for radiological constituents was announced by USEPA. The primary change was that the plus daughter (+D) isotopes designation was removed and the secular equilibrium (SE) PRG calculation was identified as the preferred (i.e., default) value. The PRGs for each daughter are combined with the parent on a fractional basis to produce a single PRG for the parent, and the resulting PRG is based on secular equilibrium of the full chain regardless of half-life. Decay is not included in this PRG option, as the assumption of SE is that the parent is continually being renewed. This was the default PRG calculation option used in the previous five-year remedy review prior to release of the Peak PRG option described in the following paragraph.

In October 2020, a new PRG option, called the Peak PRG, was added to the USEPA website; it calculates the activity of the parent radionuclide to be protective of the peak excess lifetime cancer risk for the entire decay chain over time. The underlying assumption of the Peak PRG option is that the pure isotope was released, and progeny begin ingrowth and decay. The Peak PRG is calculated for the time period when the parent and progeny activities present the most risk. The Peak PRG is now the preferred default PRG option for use at Superfund Sites.

SE only occurs when the half-life of the progeny is much shorter than the half-life of the parent. When the progeny has a longer half-life than the parent, equilibrium does not exist. The assumption of SE in these cases significantly overestimates the activity of the progeny, resulting in a much lower PRG. The SE PRG also assumes that the parent is continually being renewed, which is not valid for inactive waste units. Therefore, the Peak PRGs in most cases are less conservative (i.e., higher) than the SE PRGs. For comparison, the SE PRGs used in the previous five-year remedy review are shown with the now preferred Peak PRGs in Table B-2.

In May, 2021, the RSL for 1,2-Dichloroethylene (trans) decreased due to using a new subchronic RfD. In November 2021, the RSLs for cadmium decreased due to using subchronic toxicity values in lieu of chronic toxicity values. In May 2023, the RSL for phosphoric acid increased due to a new chronic and subchronic reference dose (RfD). In November 2023, the RSLs for nickel decreased to using a different chronic reference concentration (RfC). In May 2024, the residential soil screening level for lead decreased from 400 mg/kg to 200 mg/kg. If other sources of lead are present, the screening level is 100 mg/kg. In November 2024, the RSLs for chromium increased due to a new chronic RfD, chronic RfC, oral slope factor, and inhalation risk. Cyanide increased slightly; however the change was insignificant and no explanation was provided for the change. Additionally, RSLs for mercury decreased, but no explanation was provided.

The evaluation for each remedy to determine if exposure assumptions, toxicity data, cleanup levels, and remedial action objectives are still valid is discussed in each OU-specific review located in Appendix C through Appendix L. The evaluations shown in

Tables B-1 through B-3 and discussed above confirm that there have been some changes in standards or toxicity factors. However, these changes do not affect the protectiveness of the remedies evaluated in this report.

Documents Reviewed

SRNS, 2021. *Sixth Five-Year Remedy Review Report for the Savannah River Site Operable Units with Engineered Cover Systems (U)* Aiken, South Carolina, SRNS-RP-2020-00420, Revision 1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

Table B-1. Comparison of Non-Radiological Standards in Soil Media

Analyte[a]	2020 RSLs[b]		2024 RSLs[c]		SEMS Number(s)[d]
	Residential Soil (mg/kg)	Industrial Worker Soil (mg/kg)	Residential Soil (mg/kg)	Industrial Worker Soil (mg/kg)	
Aluminum	7.7E+04	1.1E+06	7.7E+04	1.1E+06	1, 33
Arsenic	6.8E-01	3.0E+00	6.8E-01	3.0E+00	7, 15, 40, 58
Barium	1.5E+04	2.2E+05	1.5E+04	2.2E+05	6, 7, 33
Cadmium	7.1E+01	9.8E+02	7.1E+00	1.0E+02	6, 7, 33
Chloride	1.8E-01	7.8E-01	1.8E-01	7.8E-01	1
Chloroform	3.2E-01	1.4E+00	3.2E-01	1.4E+00	33
Chromium[e]	3.0E-01	6.3E+00	9.5E-01	2.0E+01	6, 15, 47
Copper	3.1E+03	4.7E+04	3.1E+03	4.7E+04	6, 7
Cyanide	2.3E+01	1.5E+02	2.4E+01	1.6E+02	2, 6
1,1-Dichloroethane	3.6E+00	1.6E+01	3.6E+00	1.6E+01	33
1,2-Dichloroethylene (trans)	1.6E+03	2.3E+04	7.0E+01	3.0E+02	33
Dioxin (2,3,7,8-TCDD)	4.8E-06	2.2E-05	4.8E-06	2.2E-05	15
Iron	5.5E+04	8.2E+05	5.5E+04	8.2E+05	33
Lead	4.0E+02	8.0E+02	2.0E+02	8.0E+02	1, 6, 7, 33
Manganese	1.8E+03	2.6E+04	1.8E+03	2.6E+04	15, 33
Mercury	1.1E+01	4.6E+01	7.1E+00	3.0E+01	6, 7, 47
Nickel	1.5E+03	2.2E+04	1.4E+03	1.7E+04	1, 6, 7, 33
Nitrate	1.3E+05	1.9E+06	1.3E+05	1.9E+06	1, 2, 6, 7
Phenol	1.9E+04	2.5E+05	1.9E+04	2.5E+05	33
Phosphate[f]	3.8E+06	5.7E+07	7.8E+04	1.1E+06	1
Polychlorinated biphenyls (PCBs)					
~Aroclor 1254	2.4E-01	9.7E-01	2.4E-01	9.7E-01	58
~Aroclor 1260	2.4E-01	9.9E-01	2.4E-01	9.9E-01	15
Polycyclic Aromatic Hydrocarbons (PAHs)					
~Benzo[a]anthracene	1.1E+00	2.1E+01	1.1E+00	2.1E+01	40, 50
~Benzo[b]fluoranthene	1.1E+00	2.1E+01	1.1E+00	2.1E+01	40, 50
~Benzo[a]pyrene	1.1E-01	2.1E+00	1.1E-01	2.1E+00	15, 40, 50
~Benzo[k]fluoranthene	1.1E+01	2.1E+02	1.1E+01	2.1E+02	40
~Dibenzo[a,h]anthracene	1.1E-01	2.1E+00	1.1E-01	2.1E+00	40, 50
~Indeno[1,2,3-cd]pyrene	1.1E+00	2.1E+01	1.1E+00	2.1E+01	40, 50
Sulfate	NA	NA	NA	NA	1, 2
Tetrachloroethylene (PCE)	2.4E+01	1.0E+02	2.4E+01	1.0E+02	1, 6, 7, 33
Trichloroethylene (TCE)	9.4E-01	6.0E+00	9.4E-01	6.0E+00	1, 6, 33
1,1,1, Trichloroethane	8.1E+03	3.6E+04	8.1E+03	3.6E+04	1
Vanadium	3.9E+02	5.8E+03	3.9E+02	5.8E+03	7
Zinc	2.3E+04	3.5E+05	2.3E+04	3.5E+05	6, 7, 33

a Analytes listed were identified as COCs for the OUs discussed in Appendix C through Appendix L
b USEPA Nonradiological RSLs, May 2020.
c USEPA Nonradiological RSLs, November 2024.
d OUs and corresponding SEMS number(s) are identified in Appendix A, Table A-6.
e Chromium VI values
f Phosphoric acid values

mg/kg = milligram per kilogram
Revised RSLs are highlighted in orange

Table B-2. Comparison of Radiological Standards in Soil Media

Analyte[a]	2020 PRGs[b]		2025 PRGs[c]		SEMS Number(s)[d]
	Residential Soil (pCi/g)	Industrial Worker Soil (pCi/g)	Residential Soil (pCi/g)	Industrial Worker Soil (pCi/g)	
Actinium-228	1.0E-02	1.5E-02	4.0E+02	5.9E+02	47
Americium-241	5.2E-02	8.4E-02	2.3E+00	4.67E+00	6, 47
Carbon-14	3.2E+02	1.1E+03	3.2E-02	1.1E+03	7, 33
Cesium-137(+D)	4.6E-02	6.9E-02	6.1E-02	9.1E-02	6, 47, 58
Cobalt-60	9.4E-03	1.4E-02	3.3E-02	4.8E-02	6, 7, 47, 58
Curium-243	3.9E-02	6.2E-02	3.5E-01	5.4E-01	6, 47
Curium-244	9.8E-03	1.5E-02	8.7E+00	3.3E+01	6, 47
Europium-154	2.0E-02	3.0E-02	4.7E-02	7.0E-02	58
Iodine-129	2.8E+00	9.2E+00	2.8E+00	9.2E+00	7
Tritium (H-3)	1.3E-01	1.6E-01	2.8E-01	3.0E-01	6, 7, 33
Potassium-40	1.4E-01	2.2E-01	1.4E-01	2.2E-01	47
Lead-212	1.6E-02	2.4E-02	9.9E+07	2.5E+03	47
Neptunium-239	3.7E-02	5.9E-02	5.7E+02	8.3E+02	47
Plutonium-238	1.3E-02	2.0E-02	4.3E+00	1.4E+01	47
Plutonium-239	4.5E-02	7.3E-02	3.8E+00	1.2E+01	47
Radium-226(+D)	1.3E-02	2.0E-02	1.3E-02	2.1E-02	6, 7, 15
Radium-228(+D)	9.9E-03	1.52E-02	3.3E-02	4.9E-02	6, 7, 15, 47
Strontium-90(+D)	3.1E+00	6.8E+00	4.2E+00	9.0E+00	6, 7, 47
Technetium-99	1.1E+02	7.7E+02	1.1E+02	7.7E+02	6, 7
Thorium-228(+D)	1.6E-02	2.4E-02	1.5E-01	2.2E-01	47
Thorium-230	1.3E-02	2.0E-02	1.4E-02	2.2E-02	47
Thorium-232	9.9E-03	1.5E-02	9.9E-03	1.5E-02	47
Uranium-233	8.9E-02	1.5E-01	1.0E-01	1.7E-01	1, 6, 7, 47
Uranium-234	1.3E-02	2.0E-02	2.1E-02	3.4E-02	1, 6, 7, 33, 47
Uranium-235(+D)	4.6E-02	7.3E-02	4.6E-02	7.3E-02	33, 47
Uranium-238(+D)	1.2E-02	2.0E-02	1.3E-02	2.0E-02	1, 6, 33

a Analytes listed were identified as COCs for the OUs discussed in Appendix C through Appendix L
b USEPA Radiological PRGs for soil (November 2019). Default SE that included daughter products from the entire decay chain..
c USEPA Radiological PRGs for soil (July 2025). Default Peak PRG that includes daughter products from the entire decay chain, as appropriate.
d OUs and corresponding SEMS number(s) are identified in Appendix A, Table A-5.

pCi/g = picoCuries per gram
Revised RSLs are highlighted in orange

Table B-3. Non-Radiological Standards in Groundwater Media (MCLs)

Analyte[a]	2020 RSL[b] (µg/L)	2025 RSL[c] (µg/L)	MCL (µg/L)[d]	SEMS Number(s)[e]
Tetrachloroethylene (PCE)	--	--	5	2, 40
Trichloroethylene (TCE)	--	--	5	2, 40

a Analytes listed were identified as COCs for the OUs discussed in Appendix C through Appendix L
b USEPA Non-Radiological RSLs for tapwater, May 2020.
c USEPA Non-Radiological RSLs for tapwater, November 2024.
d Current MCL table is provided for reference only. Comparative analysis is not shown because MCLs have not changed since the previous five-year remedy review.
e OUs and corresponding SEMS number(s) are identified in Appendix A, Table A-5.

This page is intentionally left blank.

APPENDIX C. CENTRAL SHOPS BURNING/RUBBLE PITS (631-1G AND 631-3G) OPERABLE UNIT

I. INTRODUCTION

This report is the fifth five-year review for Central Shops Burning/Rubble Pits (631-1G and 631-3G) (CSBRP) Operable Unit (OU). This review was conducted from July 2025 through December 2025. Contaminants have been left in place at the CSBRP OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the CSBRP OU is protective of human health and the environment. This report documents the results of the review.

II. OU CHRONOLOGY

Table C-1 lists the chronology of site events for the CSBRP OU.

III. BACKGROUND

The CSBRP OU is listed as a Resource Conservation and Recovery Act (RCRA)/ Comprehensive Environmental Response, Compensation, and Liability Act unit in Appendix C of the Federal Facility Agreement (FFA) for Savannah River Site (SRS) (FFA 1993). The media associated with CSBRP OU include soil and groundwater beneath the OU.

The results of the remedial investigation contained in the RCRA Facility Investigation (RFI)/Remedial Investigation (RI) with Baseline Risk Assessment (BRA) for CSBRP (631-1G and 631-3G) OU (WSRC 2001) included an evaluation of the soil, surface water, and groundwater. Polyaromatic hydrocarbons (PAHs) were detected in pit subsurface soils (0.3-1.2 m [1-4 ft]) as a result of burning activities. However, the conclusion of the evaluation was that the CSBRP OU has not contributed to groundwater contamination adjacent to or beneath the CSBRP OU. No other constituents of concern (COCs) were identified for any of the subunits of CSBRP OU, including soil, surface water, and groundwater. However, unacceptable exposure to future human receptors could occur if contaminated subsurface soils are excavated and brought to the surface. Therefore, it was

determined that perched/trapped water associated with existing drainage conditions required mitigation to reduce the uncertainty of future contaminant migration.

Physical Characteristics

The CSBRP OU is located in the central part of the SRS, approximately 10.5 km (6.5 mi) from the nearest site boundary. It is in the northern part of N Area (Central Shops). Figure C-1 shows the location of the CSBRP OU within SRS. Figure C-2 depicts the layout of the CSBRP OU. The water table is approximately 4.6 m (15 ft) below land surface and flows to the west. Prior to 1951, the CSBRP OU area was farmland in an area of moderate relief. The pits are located in cleared areas adjacent to wooded lands.

Initially, the CSBRP OU was composed of two inactive burning/rubble pits, Pit 631-1G and Pit 631-3G, located along the northern and western sides of the Active Burning Area (631-2G) (Figure C-2). However, trenching performed during characterization activities identified that Pit 631-3G was composed of two adjacent pits, which were subsequently named 631-3G and 631-3GA.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates CSBRP OU as being within an industrial area. The future land use for CSBRP OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

CSBRP OU was in operation from the 1950s to about 1985. In 1973, periodic burning of waste ceased, and a layer of soil was placed over the ashes. Pit 631-1G received an estimated 884 m^3 (1,156 yd^3) of asbestos, empty paint cans, ash, paper, and glass. Pit 631-3G received an estimated 10,224 m^3 (13,372 yd^3) of debris consisting of asbestos, empty paint cans, fluorescent light fixtures, paper, cans, lumber, barrels, metal pipes, metal shavings, and electrical switch gear. Additional investigations within Pit 631-3G identified abundant stainless-steel metal shavings, sheet metal, burned wood, and one crushed 208-L

(55-gal) drum. Pit 631-3GA received an estimated 10,224 m^3 (13,372 yd^3) of debris consisting of unburned materials including metal, large concrete slabs, and transite. In addition, burned materials identified in the pit included sheet metal, stainless steel shavings, wire, glass and wood. Figure C-3 presents a photograph of the CSBRP OU before remediation; Figure C-4 and C-5 present photographs of the CSBRP OU in the current condition.

During disposal activities, water that collected in the pits was discharged to the adjacent drainage ditches. Drainage ditches and the flow paths of stormwater runoff have changed over time.

Initial Response

After disposal activities had been completed, the pits and ditches were covered with 1.05 to 3 m (3.5 to 10 ft) of native soil backfill as needed to create a mounded profile and the area was graded to enhance stormwater management.

Basis for Taking Action

The only COCs identified for CSBRP OU based on the RFI/RI/BRA investigation (WSRC 2001) were PAHs. PAHs were detected in pit subsurface soils (0.3-1.2 m [1-4 ft]) as a result of burning activities. According to the protocols for human health risk management for the future restricted (industrial) land use scenario, the presence of PAHs below 0.3 m (1 ft) depth in soils does not pose a human health risk to the industrial worker. However, unacceptable exposure to future human receptors could occur if contaminated subsurface soils are excavated and brought to the surface. No other COCs were determined for any subunit of the CSBRP OU, including groundwater, and there are no applicable or relevant and appropriate requirements associated with CSBRP OU. However, it was determined that continued accumulation of stormwater in contact with the buried materials was an unacceptable condition. Stormwater management needed to be improved to prevent stormwater from infiltrating and accumulating in the pits, which could potentially cause PAHs to migrate to the adjacent wetland (i.e., surface water) or the groundwater. PAHs tend to be immiscible in water. The list of specific PAHs is shown in Table C-2.

Section 7.1 of the Post Construction Report (PCR) / Corrective Measures Implementation Report (CMIR) / Final Remediation Report (FRR) requires water level measurements to be reported in the five-year remedy review report (WSRC 2005).

No remedial goals were established.

IV. REMEDIAL ACTIONS

Remedy Selection

As stated in the Record of Decision (ROD) for CSBRP OU (WSRC 2002), the remedial action objective (RAO) for the CSBRP OU is as follows:

- Maintain restricted (industrial) land use.

The selected remedy for the CSBRP OU was institutional controls (i.e. land use controls [LUCs]) with enhanced stormwater management. The improved stormwater management was needed to prevent stormwater from infiltrating and accumulating at the bottom of the pits and potentially migrating to the adjacent wetland or the groundwater and included water-level monitoring in two wells. The following LUC objectives are necessary to ensure protectiveness of the remedy:

- Minimize the perched water in the Pit 631-3G;
- Maintain the use of the OU for industrial activities only to prevent residential exposure;
- Prevent unauthorized access to the closed CSBRP OU as long as the waste remains a potential threat to human health or the environment in order to protect the industrial worker;
- Provide public notices for disclosing former waste management and disposal activies, and remedial actions taken on the site in order to protect the future residents, trespassers, and industrial workers; and
- Maintain vegetation cover to eliminate erosion and prevent disturbance of the soil in the pit.

Remedy Implementation

The selected final remedy for the CSBRP OU provides the greatest level of protection to human and ecological receptors. The remedy includes the following:

- Installation of two piezometers for monitoring the water level in Pit 631-3G to determine the effects of the drainage enhancement;
- Improvements to stormwater management, which include routing surface water flow away from the pits to minimize water infiltration into the pits and vegetative covers over the pits;
- Establishment of a maintenance program for the 0.17-hectare (0.43-acre) native soil cover; and
- Establishment of LUCs for 1.14 hectares (2.81 acres) (Figure C-6) consisting of general site access controls, groundwater use restrictions, the SRS Site Use / Site Clearance program, and deed restrictions and notifications.

System Operations/Operation and Maintenance

There are no system operation requirements. The following maintenance activities are ongoing:

- The water level in Pit 631-3G is measured monthly with piezometers (CSR 14PZ and CSR 17PZ) to determine if the pit surface area improvements are reducing the water level in the pit as designed. The water level measurements are shown on Figure C-7 and the evaluations are discussed in Section VI. Five-Year Review Process.
- Site inspections (semiannual through 2014; frequency reduced to annual thereafter [USDOE 2014]) and site maintenance.
- Site controls and land use restrictions via the SRS Site Use / Site Clearance Programs, which restrict invasive and permanent installation activities at the CSBRP OU.

Table C-3 compares the actual operation and maintenance (O&M) costs for the five-year remedy review period to the estimated direct O&M costs from the ROD (WSRC 2002). The estimated O&M cost for fiscal year (FY) 2021 to FY2025 was $40,000 for site

inspections and maintenance and LUCs. The actual O&M cost for FY2021 to FY2025 is $160,629. The O&M costs during the last five years (i.e., FY2021 to FY2025) have been higher than estimated because the estimated costs in the ROD did not fully include all O&M activities for site maintenance, inspections, and monitoring.

V. PROGRESS SINCE LAST REVIEW

This is the fifth five-year remedy review for the CSBRP OU. The previous protectiveness statement concluded that implementation of LUCs at the CSBRP OU is expected to remain protective of human health and the environment. LUCs and enhanced stormwater management have been implemented and are functioning properly.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII, Documents Referenced;
- Reviewed the water level measurement data in piezometers CSR 14PZ and CSR 17PZ at Pit 361-3G (Figure C-7);
- Confirmed the implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment C-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Reviewed changes in standards and to-be-considered guidance.

Data Review

The improved stormwater management has been effective in reducing the water level in Pit 631-3G. Generally, reduction of water elevation in Pit 631-3G since the stormwater management improvements were made indicate that the improvements have been working as designed. Data from two piezometers (CSR 14PZ and CSR 17PZ) sampled at CSBRP OU are shown in Figure C-7. Piezometer CSR 14PZ results indicate that water elevation was last above the bottom of the basin (3 m [10 ft]) due to 25.3 cm (10 in) of rain that fell

in February 2020. Piezometer CSR 17PZ has no water elevation measurements above the bottom of the basin. The water level criteria which consist of three consecutive years of decreasing water level in Pit 3G below the basin bottom set by the PCR/CMIR/FRR (WSRC 2005) has been met (2021-present). The water level in the piezometers has been decreasing despite the fact that rainfall amounts have fluctuated from year to year. Average yearly rainfall amounts from 1952 through 2024 are 139.3 cm (54.8 in); the previous ten year rainfall average is 133 cm (52.4) in. Average monthly rainfall amounts from 1952 through 2024 are 11.6 cm (4.6 in); the previous ten year monthly rainfall average is 11.1 cm (4.4 in). Total rainfall amounts for the last five years are 141.4 cm (55.7 in) (2020; monthly average 11.8 cm [4.6 in]), 117.2 cm (46.1 in) (2021, monthly average 9.8 cm [3.84 in]), 106 cm (41.8 in) (2022; monthly average 8.8 cm [3.48 in]), 157.6 cm (62 in) (2023; monthly average 13.1 cm [5.2 in]), and 139.4 cm (54.9 in) (2024; monthly average 11.6 cm [4.6 in]). Piezometer water levels changed minimally, decreased slightly overall, and remained well below the basin bottom elevation despite above average rainfall in 2023 and 2024. The overall decrease in water elevation despite the rainfall fluctuations can be attributed to the stormwater management improvements that were made.

Summary of Inspections and Interviews

Scheduled annual site inspections were conducted from FY2021 through FY2025 (Various). Tasks included on the field inspection checklists (WSRC 2005) include:

- Verifying roads are accessible;
- Verify that the waste unit signs are in acceptable condition;
- Checking the survey benchmarks for damage and visibility;
- Verifying that there are no unauthorized excavations, digging, or construction activities on the soil cover;
- Checking the integrity of vegetative covers and drainage ditches for the presence of excessive erosion, sediment buildup, and any debris restricting water flow;
- Verifying that no woody vegetation is growing on the soils cover;

- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m x 0.9 m (3 ft by 3 ft) in area and that the height of the vegetative cover is not impairing the visual inspection of the soil cover;
- Checking the soil cover for signs of erosion or depressions;
- Checking for evidence of burrowing animals; and
- Noting any other issues that need to be addressed.

The field inspections identified the following issues: active ant mounds on the soil cover. These findings were documented on the field inspection checklists and resolved soon after discovery.

The CSBRP OU was inspected by Savannah River Nuclear Solutions, LLC (SRNS) Environmental Compliance and Area Completion Projects (EC&ACP) on August 19, 2025 and included taking current photographs of the CSBRP OU and reviewing the field inspection checklists. No issues were identified during this inspection. Interviews were conducted with Donny Sahm, Inspection/Maintenance Lead, and Brian Hanshew, O&M Site Manager, on September 09, 2025 at the O&M organization offices. No issues were identified for the CSBRP OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the CSBRP OU that would affect the protectiveness of the remedy.

The CSBRP OU was inspected by SRNS EC&ACP and USDOE personnel on October 29, 2025. No issues were identified for the CSBRP OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, U.S. Environmental Protection Agency (USEPA) and South Carolina Department of Environmental Services (SCDES) personnel was held on March 19, 2026. SRNS personnel were also present in the meeting During the meeting, the participants viewed drone footage of CSBRP OU and were provided with

an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The selected remedy, stormwater management with LUCs is effective in preventing human exposure to contaminants above the 1E-06 risk level and is functioning as intended.

LUCs are meeting the remedial goals established for the CSBRP OU as discussed in Section IV, by eliminating or controlling all routes of exposure to human health.

LUCs have been effective in maintaining restricted (industrial) land use. Annual site inspections and site maintenance have been effective in maintaining the integrity of the soil cover. Based on the site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The Land Use Control Implementation Plan (LUCIP) for the CSBRP OU, located in Appendix F of the PCR/CMIR/FRR, governs LUC implementation, maintenance, monitoring, reporting and enforcement of LUCs (WSRC 2005). The LUCs that are in place include physical access controls to prevent unauthorized contact, removal or excavation of subsurface soils, and restrictions to prevent disturbance of the CSBRP OU. Warning signs are in good condition (Figure C-5), and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

The LUCIP is available on the SRS external webpage in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/) and the Land Use Control Assurance Plan webpage (https://public.srs.gov/ missions-and-programs/environmental-stewardship/lucap/).

Are Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still valid?

The exposure assumptions, toxicity data, cleanup levels, and RAOs used at the time of final remedy selection are still valid. There have been no changes in standards or physical conditions of the CSBRP OU that would affect the protectiveness of the remedy.

The USEPA standards and toxicity values have been updated since submittal of the five-year remedy review as shown in Appendix B. The changes to the values for COCs at the CSBRP OU were not significant, and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-trinitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants were identified as applicable to this OU based on the OU history of contamination. Table C-4 provides the screening results of PFOS and PFAS for the CSBRP OU.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that prevent the remedy from being protective of this OU.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

It is recommended that water-level measurements at the CSBRP OU be discontinued since the water-level measurements have remained well below the bottom of the basin for more than five years and meets the requirement of three consecutive years of decreasing water-level in Pit 631-3G (Table C-5).

X. PROTECTIVENESS STATEMENT(S)

The remedy at CSBRP OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media. All threats to the CSBRP OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the CSBRP OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

USDOE, 2014. Letter, B. T. Hennessey (USDOE) to S. B. Fulmer (SCDHEC) and R. H. Pope (USEPA), Request to Change the Inspection Frequency for Central Shops Burning/Rubble Pits (631-1G and 631-3G) and Ford Building Seepage Basin (904-19G) Operable Units, CERCLIS Numbers: 50 and 58, IACD-14-186, dated August 20, 2014, Department of Energy, Savannah River Operations Office, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC Savannah River Site, Aiken, SC

WSRC, 2001. RCRA Facility Investigation/Remedial Investigation with Baseline Risk Assessment for the Central Shops Burning/Rubble Pits (631-1G and 631-3G) (U), WSRC-RP-98-4043, Revision 1.2, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2002. Record of Decision Remedial Alternative Selection for the Central Shops Burning/Rubble Pits (CSBRP) (631-1G and 631-3G) Operable Unit (U), WSRC-RP-2001-4265, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2005. Post-Construction Report (PCR)/Corrective Measures Implementation Report (CMIR) /Final Remediation Report (FRR) for the Central Shops Burning/Rubble Pits (631-1G and 631-3G/3GA Operable Unit (U), WSRC-RP-2004-4014, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

Various – Inspection Data Sheets - Field Inspection Checklist for Central Shops Burning Rubble Pits Operable Units 631-1G and 631-3G, ER-IDS-019-031, Inspection Period FY 2021 through 2025

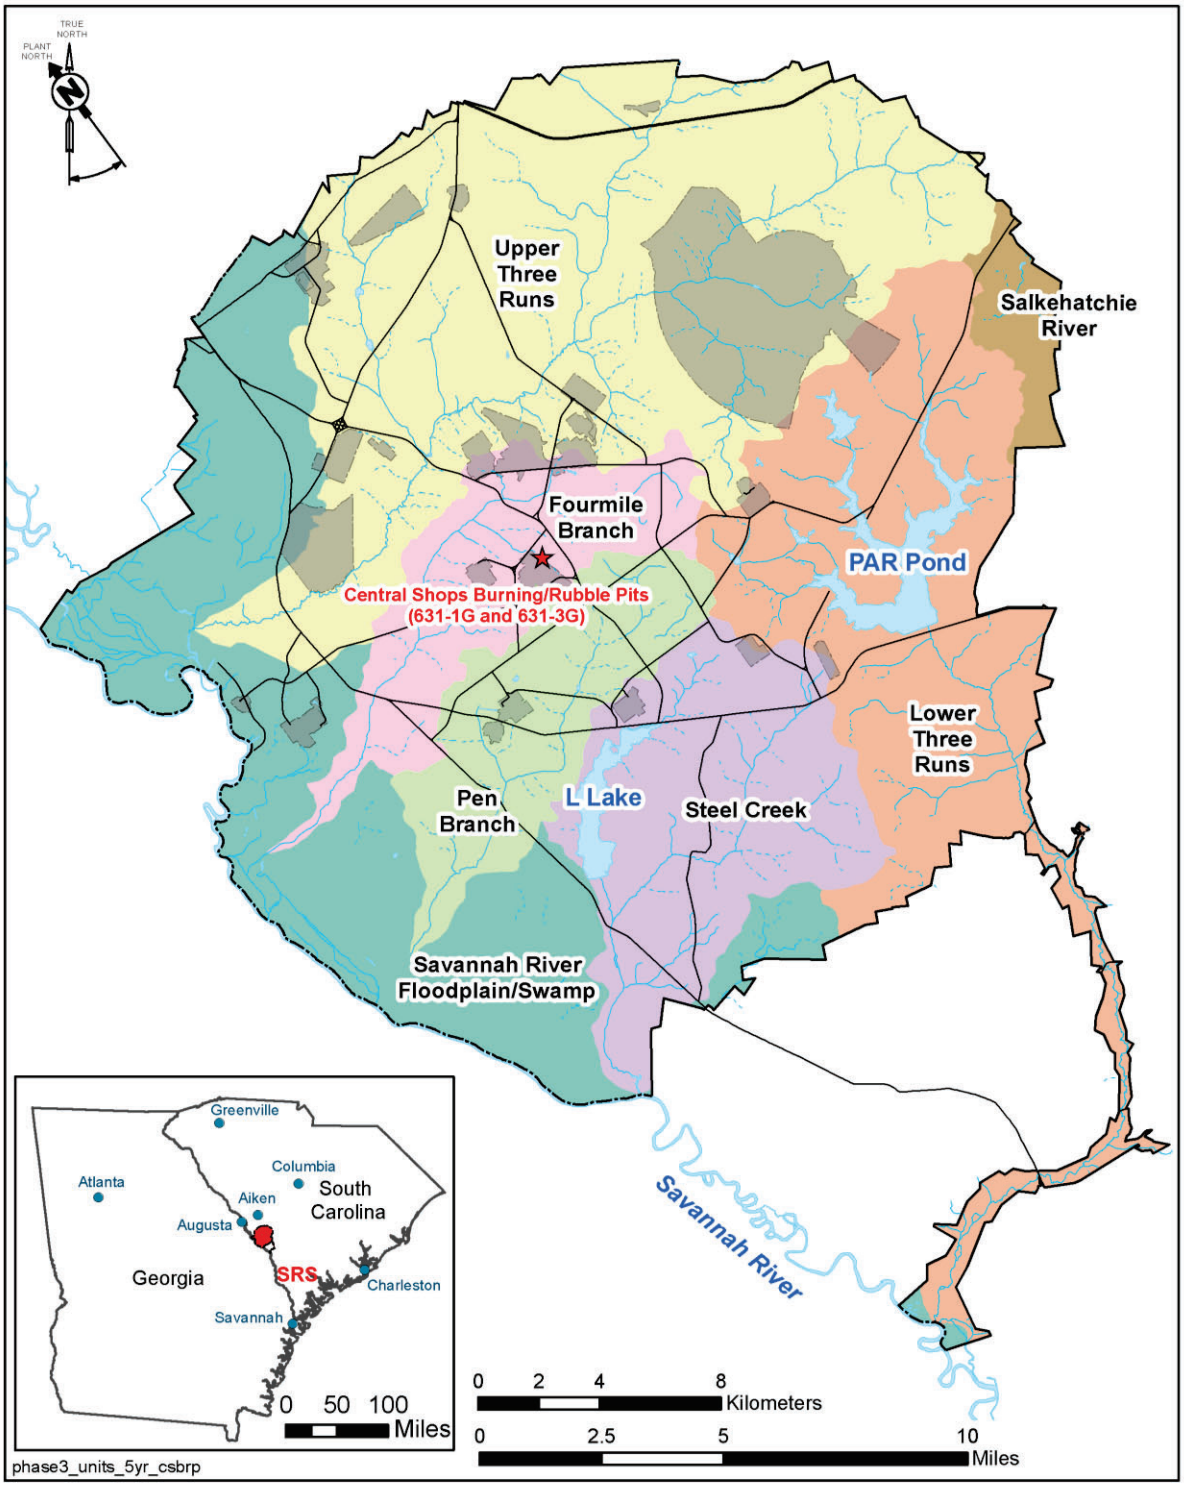


Figure C-1. Location of the CSBRP OU at SRS

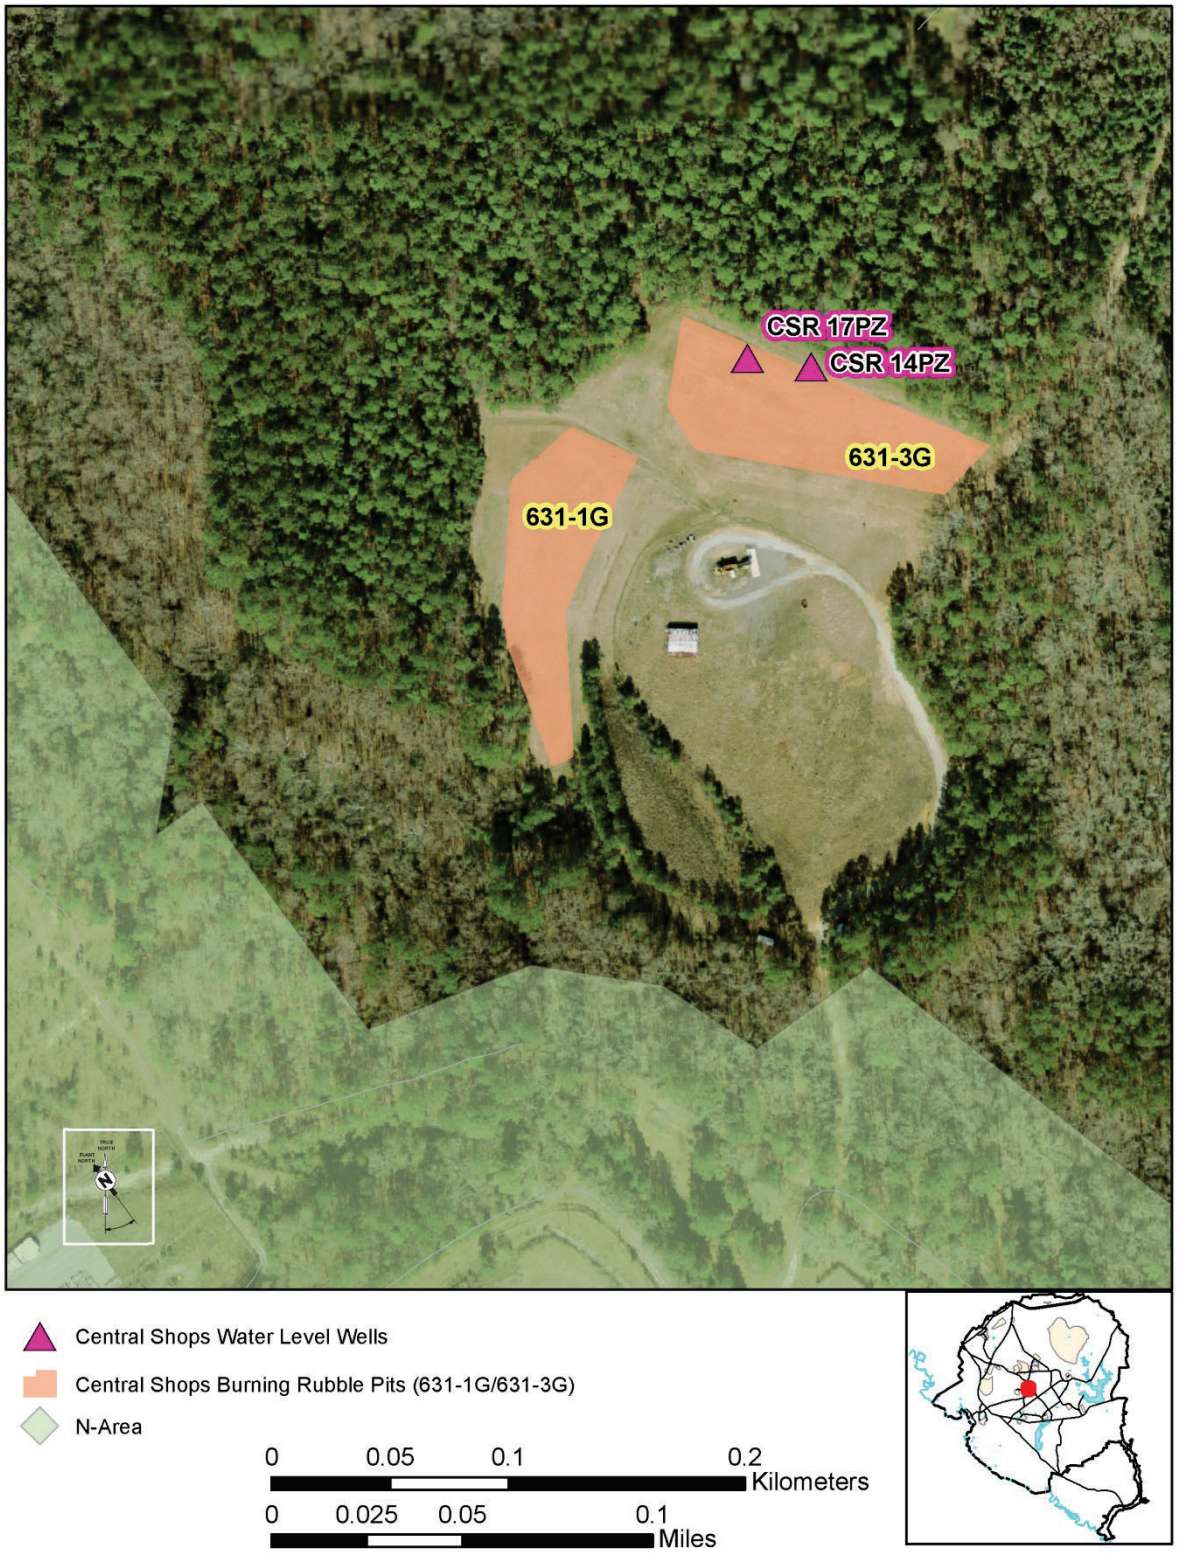


Figure C-2. Layout of the CSBRP OU



Figure C-3. Photograph of CSBRP OU Before Remediation Activities (1985)



Figure C-4. Current Aerial Photograph of CSBRP OU (2025)



Figure C-5. Current Photograph of CSBRP OU (2025)

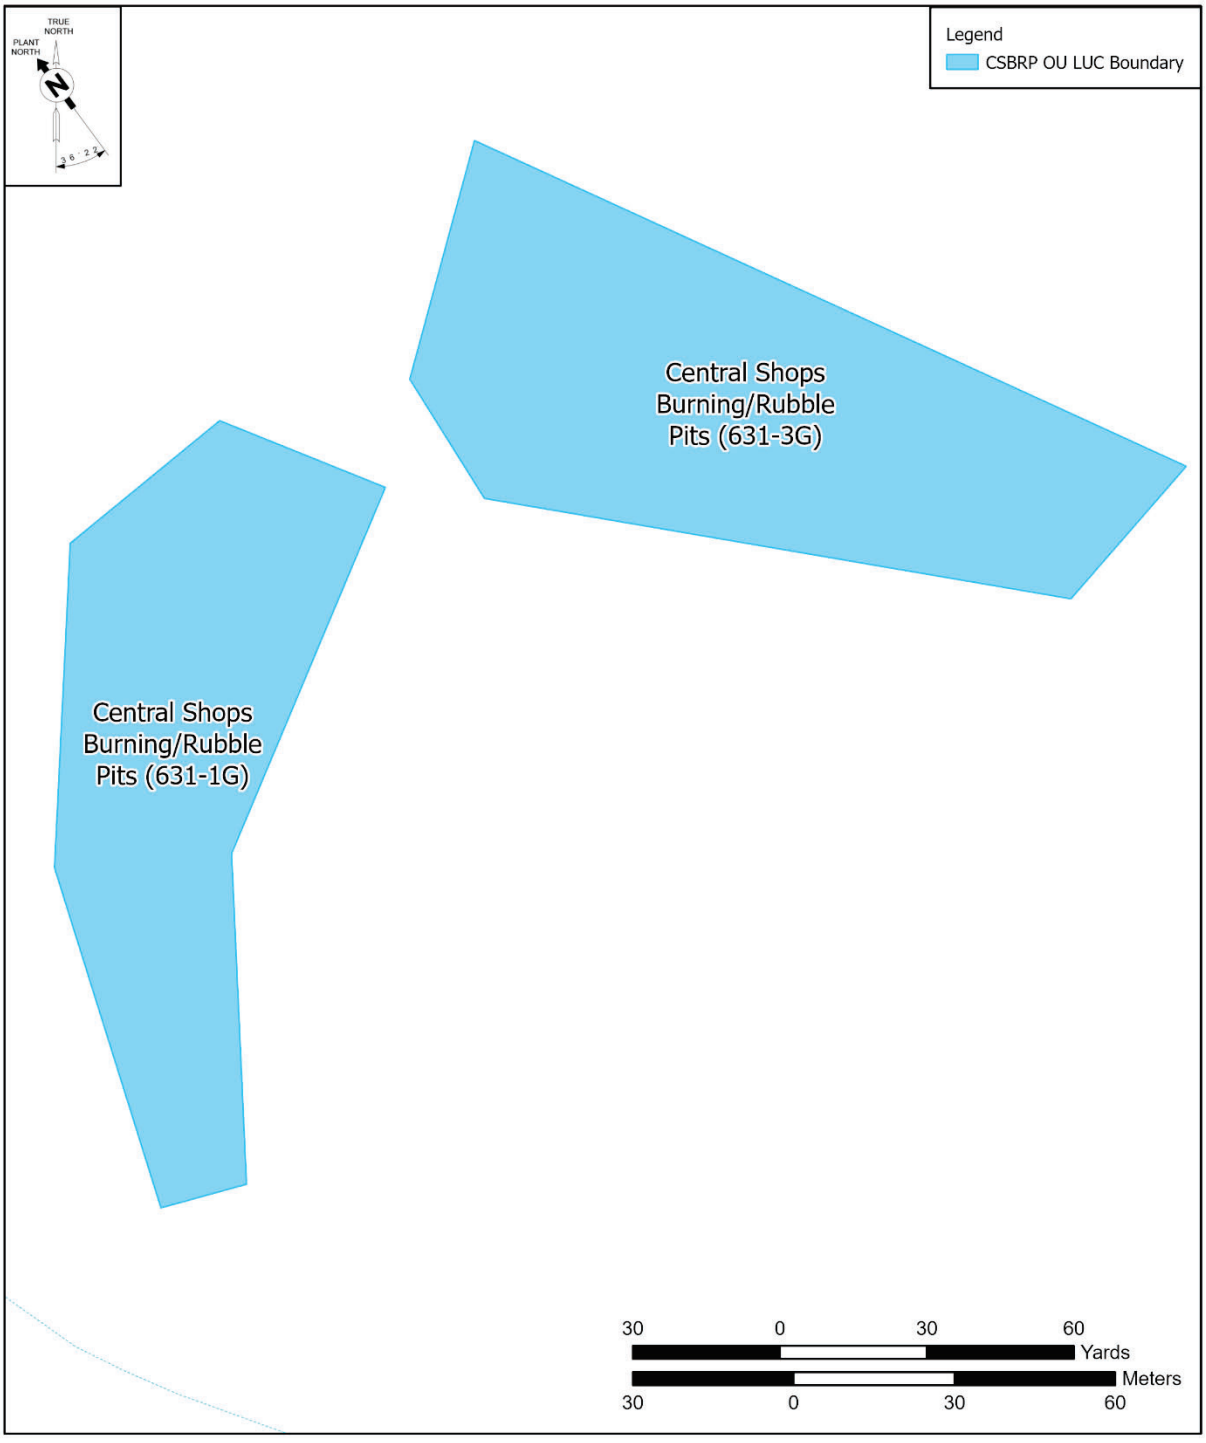


Figure C-6. CSBRP OU LUC Boundary

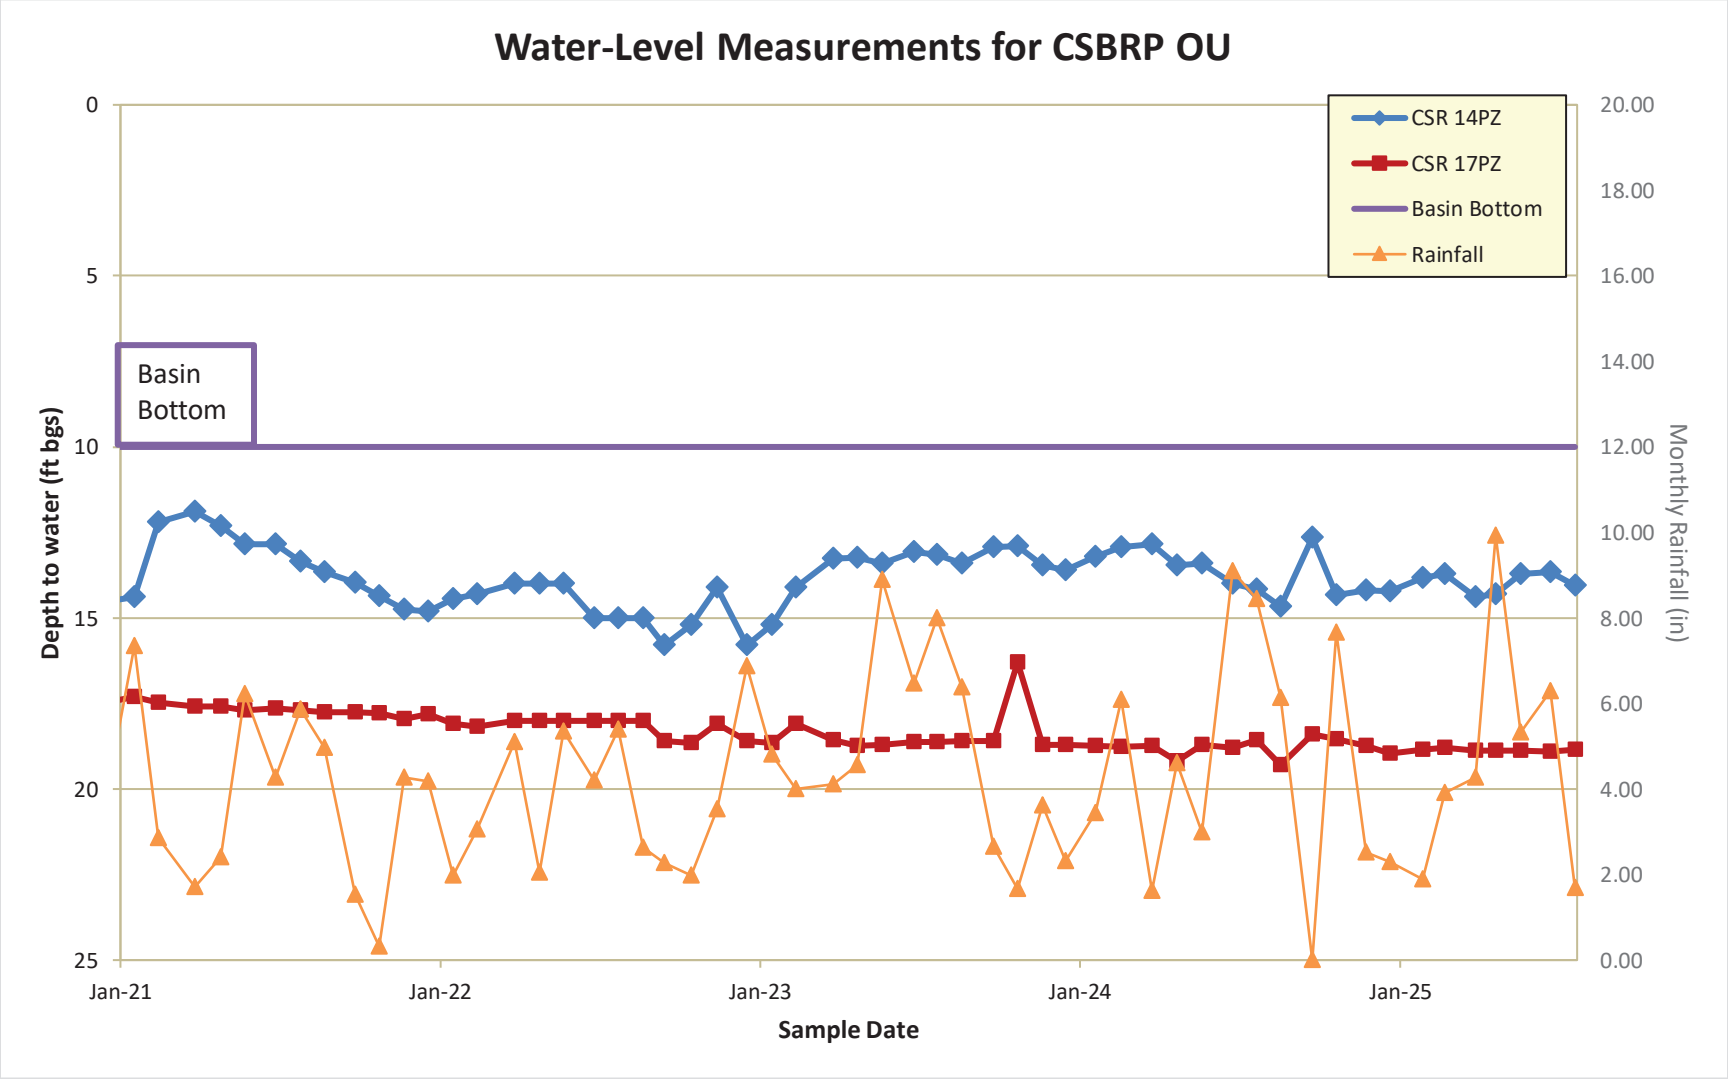


Figure C-7. Water Level Measurements from CSR 14PZ and CSR 17PZ (2021-2025)

This page is intentionally left blank.

Table C-1. Chronology of OU Events

Event	Date
RFI/RI Field Start/Complete	June 1996 / June 4, 2001
ROD Issuance	June 30, 2003
Remedial Action Start/Complete	November 17, 2003 / November 3, 2004
Previous Five-Year Reviews Issuance	January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table C-2. Constituents of Concern for Future Industrial Worker at CSBRP OU

Subunit	Medium	COC	Total Carcinogenic Risk
Pit 631-1G	0-4 ft Soil	Benzo[a]pyrene	2.1E-06
			Total Cumulative Risk = 2.1E-06
Pit 631-3G	0-4 ft Soil	Benzo[a]anthracene	3.0E-06
		Benzo[a]pyrene	1.8E-05
		Benzo[b]fluoranthene	3.8E-06
		Dibenzo[a,h]anthracene	8.9E-06
		Indeno[1,2,3-cd]pyrene	1.9E-06
			Total Cumulative Risk = 3.6E-05

Table C-3. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	Five-Year Total
Total Actual O&M Costs ($)	31,508	25,670	29,26`7	33,349	42,483	160,629
Total ROD Estimated Direct O&M Costs* ($)	20,000	5,000	5,000	5,000	5,000	40,000

*Costs for preparation of the Sixth Five-Year Remedy Review were accounted for in FY2021.

Table C-4. PFOS/PFAS Screening Results for the CSBRP OU

Operable Unit Name:	**CSBRP**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and known uses, including a review of historical PFAS applications and categories, PFAS are not expected to be present at this operable unit.**	

Table C-5. Recommendations and Follow-up Actions for CSBRP OU

Issue	Recommendations/ Follow-up Actions	Party Responsible	Oversight Agency	Milestone Date	Affects Protectiveness? (Y/N)	
					Current	Future
Water-level measurements have remained below the bottom of the basin for more than five years	Eliminate water-level sampling based on requirements set in the PCR/CMIR/FRR (WSRC 2005)	USDOE	SCDES/ USEPA	December 2026	N	N

This page is intentionally left blank.

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU

I. SITE INFORMATION			
Site Name:	**Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU**	**Date of Inspection:**	**08/19/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #50**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**85°F and partly sunny**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☒ Other Stormwater Management Improvements

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(CLICK ALL THAT APPLY)*

1. O&M Staff: Brian Hanshew (Name) — EC&ACP Post-Closure Waste Site O&M Site Manager (Title) — 09/09/2025 (Date)
Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949
Problems/Suggestions: ☐ Report Attached

2. O&M Staff: Donny Sahm (Name) — EC&ACP Post-Closure Waste Site Inspector/Maintenance Lead (Title) — 09/09/2025 (Date)
Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4145
Problems/Suggestions: ☐ Report Attached

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. Local Regulatory Authorities and Response Agencies (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. Other Interviews *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. O&M Documents:

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Field Inspection Checklist for Central Shops Burning Rubble Pits Operable Units 631-1G and 631-3G*, ER-IDS-019-031.

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Water elevation records only.

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

1. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is summarized in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons: _____

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

I. Fencing Damage: ☐ Location shown on site map ☐ Gates secured ☒ N/A

Remarks: OU-specific perimeter fencing is not required by the remedial action.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A
Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdowns
Frequency: Once in 5 years
Responsible Party/Agent: USDOE Savannah River Field Office
Contact: Matt Baker (Name) | Acting FFA Remedial Project Manager (Title) | 10/29/2025 (Date) | 803-952-6211 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A
Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A
Violations have been reported: ☐ Yes ☐ No ☒ N/A
Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A
Remarks:

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident
Remarks:

2. Land use changes onsite: ☒ N/A
Remarks:

3. Land use changes offsite: ☒ N/A
Remarks:

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

VI. GENERAL SITE CONDITIONS	
A. Roads	☒ Applicable ☐ N/A
1. Roads damaged:	☒ Location shown on site map ☒ Roads adequate ☐ N/A
Remarks:	
B. Other Site Conditions	
Remarks: Inspections conducted from FY2021 through FY2025 identified active ant mounds on the soil cover. All issues were resolved soon after discovery.	

VII. LANDFILL COVER/CONTAINMENT	☒ Applicable ☐ N/A
A. Landfill Surface	
1. Settlement (Low spots)**:**	☐ Location shown on site map ☒ Settlement not evident
Areal extent _____ Depth _____	
Remarks:	
2. Cracks:	☐ Location shown on site map ☒ Cracking not evident
Lengths _____ Widths _____ Depths _____	
Remarks:	
3. Erosion:	☐ Location shown on site map ☒ Erosion not evident
Areal extent _____ Depth _____	
Remarks:	
4. Holes:	☐ Location shown on site map ☒ Holes not evident
Areal extent _____ Depth _____	
Remarks:	
5. Vegetative Cover:	☒ Grass ☒ Cover properly established ☒ No signs of stress
Areal extent _____ Depth _____	
Remarks:	

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A

Remarks:_____

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident

Areal extent_____ Depth_____

Remarks:_____

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident

☐ Wet areas ☐ Location shown on site map Areal extent_____

☐ Ponding ☐ Location shown on site map Areal extent_____

☐ Seeps ☐ Location shown on site map Areal extent_____

☐ Soft subgrade ☐ Location shown on site map Areal extent_____

Remarks:_____

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability

Areal extent_____

Remarks:_____

B. Benches ☐ Applicable ☒ N/A

(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A

(Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

D. Cover Penetrations ☒ Applicable ☐ N/A

1. Gas Vents: ☐ Active ☐ Passive
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

2. Gas Monitoring Probes:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

3. Monitoring Wells:
☒ Properly secured/locked ☒ Functioning ☒ Routinely sampled ☒ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☐ N/A
CSR 14PZ and CSR-17PZ water-levels are measured monthly.

4. Leachate Extraction Wells:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

5. Settlement Monuments: ☐ Located ☐ Routinely Surveyed ☒ N/A
Remarks:

E. Gas Collection and Treatment ☐ Applicable ☒ N/A

F. Cover Drainage Layer ☐ Applicable ☒ N/A

G. Detention/Sedimentation Ponds ☐ Applicable ☒ N/A

H. Retaining Walls ☐ Applicable ☒ N/A

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued)*

VIII. LANDFILL COVER/CONTAINMENT *(Continued)*			
I.	**Perimeter Ditches/Offsite Discharge**	☒ Applicable	☐ N/A
1.	**Siltation:**	☐ Location shown on site map	☒ Siltation not evident
	Remarks:		
2.	**Vegetative Growth:**	☐ Location shown on site map	☐ N/A
	Remarks:		
3.	**Erosion:**	☐ Location shown on site map	☒ Erosion not evident
	Remarks:		
4.	**Discharge Structure:**	☐ Location shown on site map	☒ N/A
	Remarks:		
IX. VERTICAL BARRIER WALLS		☐ **Applicable**	☒ **N/A**
X. GROUNDWATER/SURFACE WATER REMEDIES		☐ **Applicable**	☒ **N/A**
X. OTHER REMEDIES			
If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.			
A.	**Stormwater Management Improvements**	☒ Applicable	☐ N/A
Stormwater management improvements included routing surface water flow away from the CSBRPs. The stormwater management improvements are performing as designed.			

Attachment C-1. Five-Year Review Site Inspection Checklist – Central Shops Burning/Rubble Pits (631-1G and 631-3G) OU *(continued/end)*

XI. OVERALL OBSERVATIONS
A. Implementation of the Remedy
Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.). The remedial action for CSBRP OU is LUCs in conjunction with improved stormwater management. The remedy is fully established and functioning as designed. Groundwater elevation is monitored monthly to confirm stormwater management improvements are functioning as designed.
B. Adequacy of O&M
Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy. The O&M procedures consisting of annual site inspection and site maintenance (repair of erosion damage, cover system, and warning signs) and land use controls (SRS Site Use/Site Clearance Programs, which restrict invasive and permanent installation activities at the waste unit) have been implemented. The O&M procedures are adequately maintaining the CSBRP OU and the condition of the warning signs is good. When maintenance activities are identified during inspections (e.g., treating ant mounds), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the CSBRP OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.
C. Early Indicators of Potential Remedy Failure
Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future. N/A
D. Opportunities for Optimization
Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy. N/A

End of Checklist

APPENDIX D. D-AREA BURNING/RUBBLE PITS (431-D AND 431-1D) OPERABLE UNIT

I. INTRODUCTION

This report is the seventh five-year review for the D-Area Burning/Rubble Pits (431-D and 431-1D) (DBRP) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants have been left in place at the DBRP OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the DBRP OU is protective of human health and the environment. This report documents the results of the review.

II. OU CHRONOLOGY

Table D-1 lists the chronology of site events for the DBRP OU.

III. BACKGROUND

The DBRP OU is a Resource Conservation Recovery Act (RCRA) / Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) unit in Appendix C of the Federal Facility Agreement (FFA) for Savannah River Site (SRS) (FFA 1993). The media associated with this OU are soil and groundwater. However, groundwater monitoring was terminated in 2004.

Physical Characteristics

The DBRP OU is located in the western part of the SRS in Barnwell County, approximately 900 m (3,000 ft) east of the Savannah River in D Area (Figure D-1). The topography of the unit is flat with a surface elevation of 39 m (130 ft) above mean sea level and 13.5 m (45 ft) above the Savannah River. The water table is approximately 3 m (10 ft) below ground surface in the area of the unit. Surface drainage is to the west-southwest toward a nearby ephemeral tributary of the Savannah River. Figure D-2 depicts the layout of the DBRP OU.

The OU consists of two contiguous waste pits designated as 431-D and 431-1D, which covers a total area of 0.22 hectares (0.54 acre). The two pits are separated by a 45-m (150-ft) wide berm of undisturbed soil. The pits have been backfilled with soil, and vegetation has been established on the resulting surface. The pit cover is raised above the surrounding terrain to enhance drainage.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates the DBRP OU as being within an industrial area. The future land use for the DBRP OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

Between 1951 and 1973, burning pits were used at SRS to burn various hazardous and non-hazardous wastes. The chemical composition and volumes of the disposed wastes are unknown. Combustible materials (paper, plastics, wood, rubber, rags, cardboard, oil, degreasers, and spent organic solvents) were burned monthly and no known or suspected radioactive materials were allowed in the burning pits. In October 1973, the burning of the waste at the DBRP was discontinued. A layer of soil was placed over the residue in the pits and afterwards the pits were used as rubble pits. Figures D-3 presents the photograph of the DBRP OU before remediation and Figures D-4 and D-5 present photographs of the DBRP OU in the current condition.

Initial Response

In 1983, a 0.3- to 0.9-m (1- to 3-ft) layer of clayey soil was placed over the DBRP contents, and the surface was compacted and mounded above the surrounding terrain. The cover material was placed at a time preceding the preparation of the formal CERCLA investigation and documentation. Vegetation was established to reduce erosion. Five monitoring wells were installed in 1983, 1984, and 1993.

Basis for Taking Action

Soils and groundwater were investigated in two phases of sampling between 1989 and 1993. A RCRA Facility Investigation (RFI) / Remedial Investigation (RI) Report (WSRC 1995b) and Baseline Risk Assessment (BRA) (WSRC 1995a) were completed in 1995. The soils analytical data indicate that little or no contamination of soil has occurred outside of the OU. The analytical data from the 1993 soil samples identified the following constituents of concern (COCs): arsenic, benzo(a)pyrene, chromium, manganese, octachlorodibenzo-p-dioxin, Aroclor-1260 (polychlorinated biphenyl [PCB]), and total alpha-emitting radium. Aroclor-1260 is the primary risk driver, contributing to a carcinogenic risk of 1.0E-05 to a future resident for ingestion of soil. The maximum concentration of 3.39 mg/kg is also greater than the toxic substance control value of 1 mg/kg established for PCBs in high occupancy areas. The RFI/RI Report (WSRC 199b) and BRA (WSRC 1995a) indicated the DBRP OU posed minimal risk to the environment. The risk to future on-unit workers is 1.0E-6. Ingestion of soil in the top two-foot layer by future residents poses a risk of 1.0E-5, primarily from Aroclor-1260. Table D-2 identifies the refined constituents of concern (RCOCs) that requires remedial action.

The groundwater monitoring data indicated that no significant release of hazardous substances to groundwater from the DBRP OU has occurred. Comparison of constituent concentrations from 1984 through 1992 in the four downgradient monitoring wells (identified as DBP wells) indicated little or no constituent concentration increase in groundwater after flowing beneath the DBRP. Arsenic was only detected twice in the DBP monitoring network; the higher value in the December 1993 sample was reported as 0.044 mg/L. The following quarter when the well was re-sampled, arsenic was reported below the detection limit of 0.002 mg/L (WSRC 1997).

Per the Record of Decision (ROD) (WSRC 1997) the risk and hazards associated with the DBRP are summarized below and are the basis for taking action at the DBRP OU:

- Current Land Use – The human health risks are associated with ingestion or inhalation of soils inside the DBRP and ingestion of sediments resulting in a carcinogenic risk.

- Future Land Use – Arsenic and manganese are identified as posing a non-carcinogenic hazard to future resident adults and children and future on-unit workers through groundwater ingestion and inhalation pathways. Arsenic is identified as posing a carcinogenic risk to future on-unit workers and future on-unit residents through the groundwater ingestion pathway. In addition, polyaromatic hydrocarbons and 1,2-dichloroethane are identified as posing a carcinogenic risk to the future on-unit worker through the groundwater ingestion pathway. It should be noted that the arsenic risk was based on a single measured arsenic value in groundwater that was less than the maximum contaminant levels (MCL) for drinking water.
- No ecological risks were identified for the DBRP OU.

None of the risks associated with the soil in the DBRP was found to be greater than 1.0E-04. Aroclor-1260 from the 0-0.6 m (0-2 ft) soil interval in Pit 431-D was the predominant risk driver for future residents contributing 79% of the 1.0E-05 risk. The Hazard Index for this exposure scenario was 0.7. The to-be-considered guidance for PCBs is a recommended soil action level of 1.0 mg/kg for residential use and 10-25 mg/kg for industrial use. The Aroclor 1260 concentration in Pit 431-D is well below the range for industrial land use (WSRC 1997).

The Final Remediation Report (FRR) (WSRC 1998) required full evaluation of all groundwater monitoring data in the five-year remedy review reports. The approved addendum to the FRR (WSRC 2006) terminated groundwater monitoring but continued land use controls (LUCs) and five-year reviews for the DBRP OU.

IV. REMEDIAL ACTIONS

Remedy Selection

As stated in the ROD (WSRC 1997), the remedial action objective (RAOs) for the DBRP OU is as follows:

- Prevent hypothetical future industrial workers from exposure to PCBs in surface and subsurface soils at concentrations that exceed target risk levels. In Pit 431-D, the PCB

recommended soil action levels are 1.0 mg/kg for residential use, and 10-25 mg/kg for industrial use.

- No RAOs were identified for groundwater, but SRS was to verify that no significant groundwater contamination is originating from the DBRP OU and that no remedial action for groundwater is required.

As stated in the ROD, the selected remedial action is as follows:

- Institutional controls (i.e., LUCs) (Figure D-6) and no remedial action for the groundwater with a period of continued groundwater monitoring.

However, as stated in Section III, the approved addendum to the FRR (WSRC 2006) terminated groundwater monitoring.

The following LUC objective is necessary to ensure protectiveness of the remedy:

- Preclude future residential use of this land and prohibit excavation of the soil which might expose future workers to low concentrations of hazardous constituents.

Remedy Implementation

The selected remedial action of LUCs was implemented to meet the RAOs. The LUCs for the DBRP OU include the following:

- Warning signs will be posted in the near term indicating that this area was used to manage hazardous materials;
- Existing SRS access controls will be used to maintain the use of this site for industrial use only;
- Institutional controls (i.e., administrative measures) and use restrictions for on-site workers via the Site Use/Site Clearance Program. Other administrative controls to ensure worker safety include work controls, worker training, and worker briefings of health and safety requirements; and
- In the long-term, if the property is ever transferred to non-federal ownership, the U.S. Government would create a deed for the new property owner in compliance with

Section 120(h) of CERCLA that includes notification disclosing former DBRP OU waste management and disposal activities, results from groundwater monitoring, and remedial actions taken on the site. The deed would also include deed restrictions precluding residential use of the property.

Systems Operations/Operation and Maintenance

There are no system operational requirements.

The following maintenance activities are ongoing:

- Annual site inspections and maintenance (repair of erosion damage, cover maintenance, and warning signs) to maintain this site for industrial use only.

The confirmatory groundwater program was discontinued in 2004 after all sampling data collected showed that none of the COCs in groundwater were detected above MCLs via approval of the Addendum to the FRR (WSRC 2006). Groundwater samples were collected annually from five monitoring wells during the second quarter of each calendar year in accordance with the FRR (WSRC 1998) from 1998 to 2003.

Table D-3 compares the actual operation and maintenance (O&M) costs for the five-year remedy review period to the estimated direct O&M costs from the ROD (WSRC 1997). The estimated O&M cost for fiscal year (FY) 2021 to FY2025 is $3000 for five-year remedy reviews. The actual O&M cost for FY2021 to FY2025 is $73,035 for annual site inspections and maintenance. The O&M costs during the last five years (i.e., FY2021 to FY2025) have been higher than estimated because annual costs for inspections and cover system maintenance were not included in the ROD estimate.

V. PROGRESS SINCE LAST REVIEW

This is the seventh five-year remedy review for the DBRP OU. The previous protectiveness statement concluded that because the remedial actions at DBRP OU are protective, the site is protective of human health and the environment. The LUCs remedy is functioning as intended by the decision documents. Groundwater monitoring results over the five-year

period between 1998 and 2003 indicated that there were no exceedances of MCLs, indicating no appreciable leaching to groundwater of these chemicals.

There were no recommendations or follow-up actions from the last five-year review.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed documents listed in Section XII. Documents Reviewed;
- Confirmed implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel; and documented the results on the Inspection Checklist provided in Attachment D-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Reviewed changes in standards and to-be-considered guidance.

Data Review

A review of the groundwater monitoring program for the five-year period between 1998 and 2003, as summarized in Table D-4, indicated there were no exceedance of MCLs by any of the risk and hazard drivers. The data provides evidence of no appreciable leaching to groundwater of these chemicals. Based on the results of sampling over that five-year period, the U.S. Environmental Protection Agency (USEPA) and the South Carolina Department of Environmental Services (SCDES) approved discontinuing sampling of groundwater for this OU in 2004.

Summary of Inspections and Interviews

Scheduled annual inspections were conducted at the DBRP OU from FY2021 through FY2025 (Various). Tasks included on the field inspection checklists include:

- Verifying roads to waste unit are accessible;
- Verifying that the waste unit signs (4) are in acceptable condition, have the correct information, and are legible from a distance of 7.6 m (25 ft);

- Verifying that there are no excavations, digging, or construction activity on the soil cover;
- Verifying that no woody vegetation is growing on the soils cover and remove or identify as needed;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m x 0.9 m (3 ft by 3 ft) in area. (The height of the vegetation should not impair the visual inspection of the soil cover. This will be determined by the inspector.);
- Checking the soil cover for signs of erosion or depressions (subsidence);
- Checking for signs of burrowing animals; and
- Other.

The field inspections identified the following issues: active ant mounds, fallen tree on hog fence, and woody vegetation growing on the soil cover. These findings were documented on the field inspection checklists and resolved soon after discovery.

The DBRP OU was inspected by SRNS Environmental Compliance and Area Completion Projects (EC&ACP) on September 2, 2025 and included taking current photographs of the DBRP OU and reviewing the field inspection checklists. No issues were identified during this inspection. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the DBRP OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the DBRP OU that would affect the protectiveness of the remedy.

The DBRP OU was inspected by SRNS EC&ACP and USDOE personnel on November 20, 2025. No issues were identified for the DBRP OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, USEPA and SCDES personnel was held on March 19, 2026. SRNS personnel were also present in the meeting. During the meeting, the participants viewed drone footage of DBRP OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection.

The field inspection frequency for the DBRP OU was changed from semiannual to annual in 2015. Scheduled annual inspections performed at the DBRP OU from FY2021 through FY2025 identified the following issues: active ant mounds, fallen tree on hog fence, and woody vegetation growing on the soil cover. These findings were documented on the field inspection checklists and resolved soon after discovery.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, LUCs, is effective in preventing exposure to contaminants above 1E-06 risk level and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Annual site inspections and site maintenance have been effective in maintaining the integrity of the soil cover. Based on the site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The Land Use Control Implementation Plan (LUCIP) for the DBRP OU, located in Section 2.0 of the FRR, governs LUC implementation, maintenance, monitoring, reporting, and enforcement of LUCs (WSRC 1998). The LUCs that are in place include physical access controls to prevent unauthorized contact, removal or excavation of subsurface soils, and restrictions to prevent disturbance of the DBRP OU. Warning signs are in good condition, and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

The LUCIP is available on the SRS external webpage in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/) and the Land Use Control Assurance Plan webpage (https://public.srs.gov/ missions-and-programs/environmental-stewardship/lucap/).

Are Exposure Assumptions, Toxicity Data, Cleanup Levels, and RAOs still valid?

The exposure assumptions, toxicity data, cleanup levels, and RAOs used at the time of final remedy selection are still valid. There have been no changes in standards or physical conditions at the DBRP OU that would affect the protectiveness of the remedy.

The USEPA standards and toxicity values have been updated since submittal of the five-year remedy review as shown in Appendix B. The changes to the values for COCs at the DBRP OU were not significant, and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants were identified as applicable to this OU based on the OU history of contamination. Table D-5 provides the screening results of PFOS and PFAS for the DBRP OU.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Strategy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that prevent the remedy from being protective of this OU.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for this OU.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the DBRP OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media. All threats to the DBRP OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain DBRP OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1995a. *Baseline Risk Assessment for the D-Area Burning/Rubble Pits*, Revision 1, WSRC-RP-94-708, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1995b. *RFI/RI Report for the D-Area Burning/Rubble Pits*, WSRC-RP-94-707, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1997. *Record of Decision Remedial Alternative Selection for the D-Area Burning/Rubble Pits (431-D and 431-1D) (U)*, WSRC-RP-96-867, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1998. *Final Remediation Report for the D-Area Burning/Rubble Pits (431-D and 431-1D) (U)*, WSRC-RP-97-406, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC Savannah River Site, Aiken, SC

WSRC, 2006. Addendum to the Final Remediation Report for the D-Area Burning/Rubble Pits (431-D and 431-1D) Operable Unit (U), WSRC-RP-2005-4084, Revision 1, Washington Savannah River Company, Savannah River Site, Aiken, SC

Various – Inspection Data Sheets - Field Inspection Checklist – D-Area Burning/Rubble Pits (431-D and 431-1D) Operable Unit (U), ER-IDS-019-003, Inspection period 2021 through 2025 (annually)

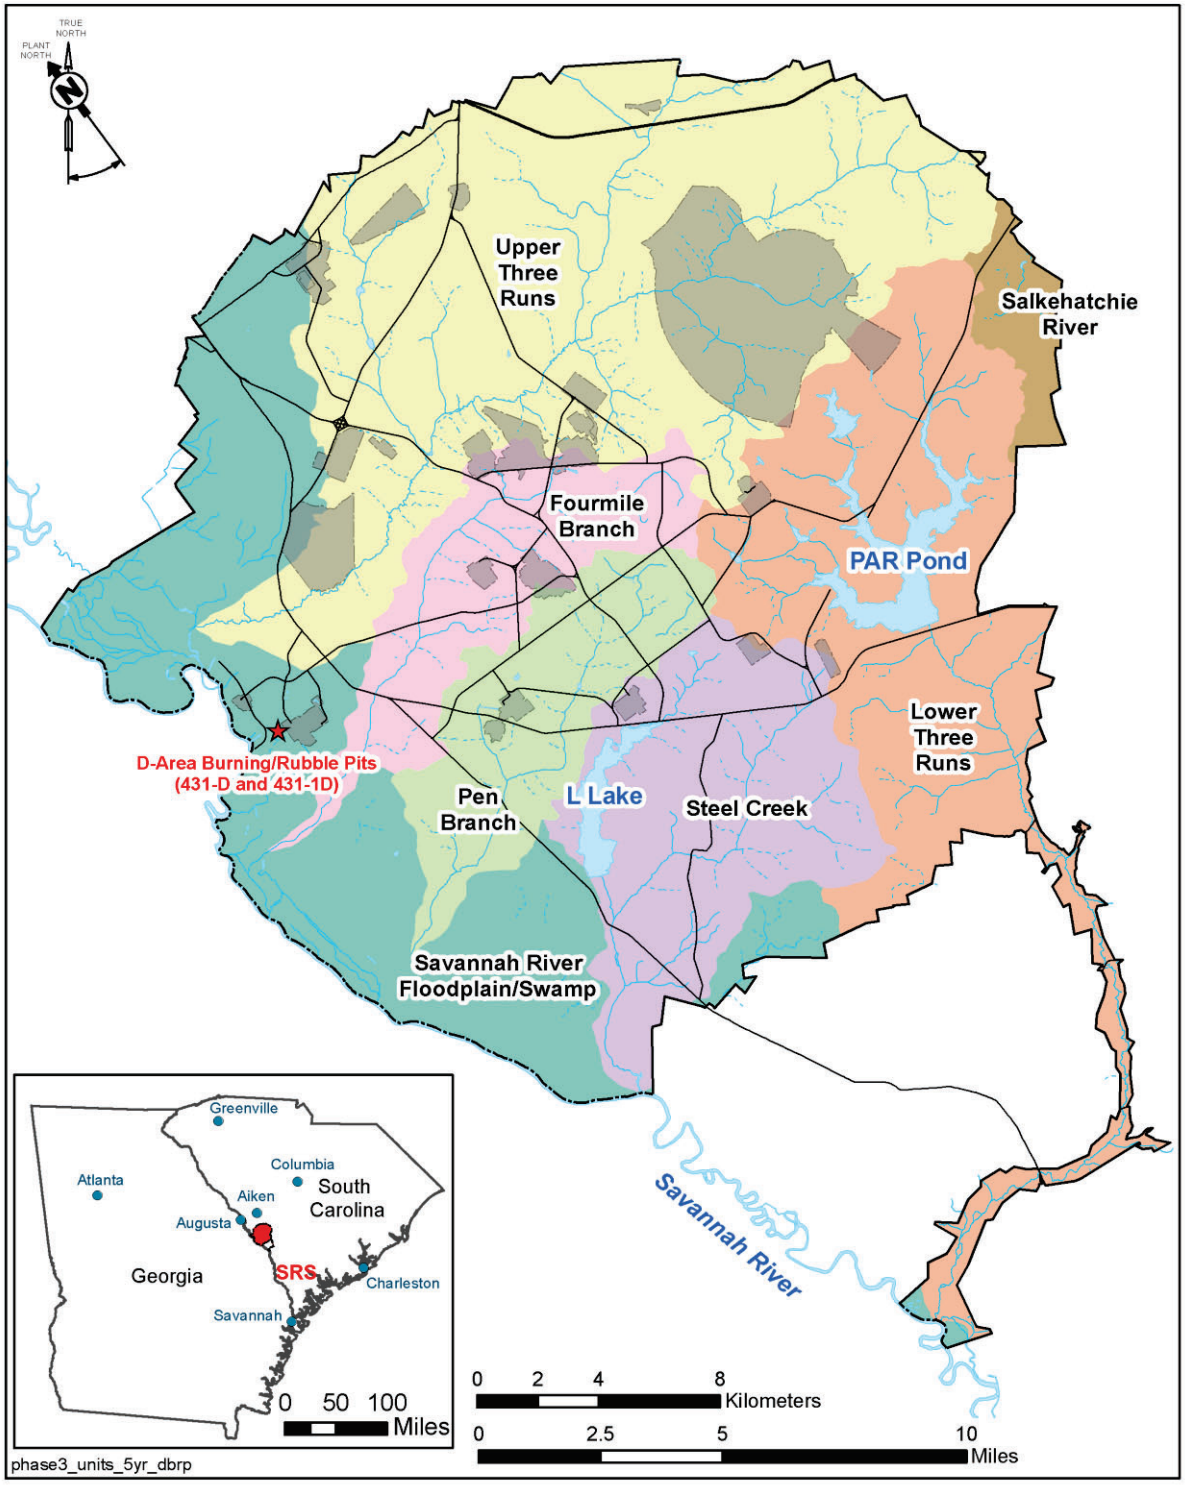


Figure D-1. Location of the DBRP OU at SRS

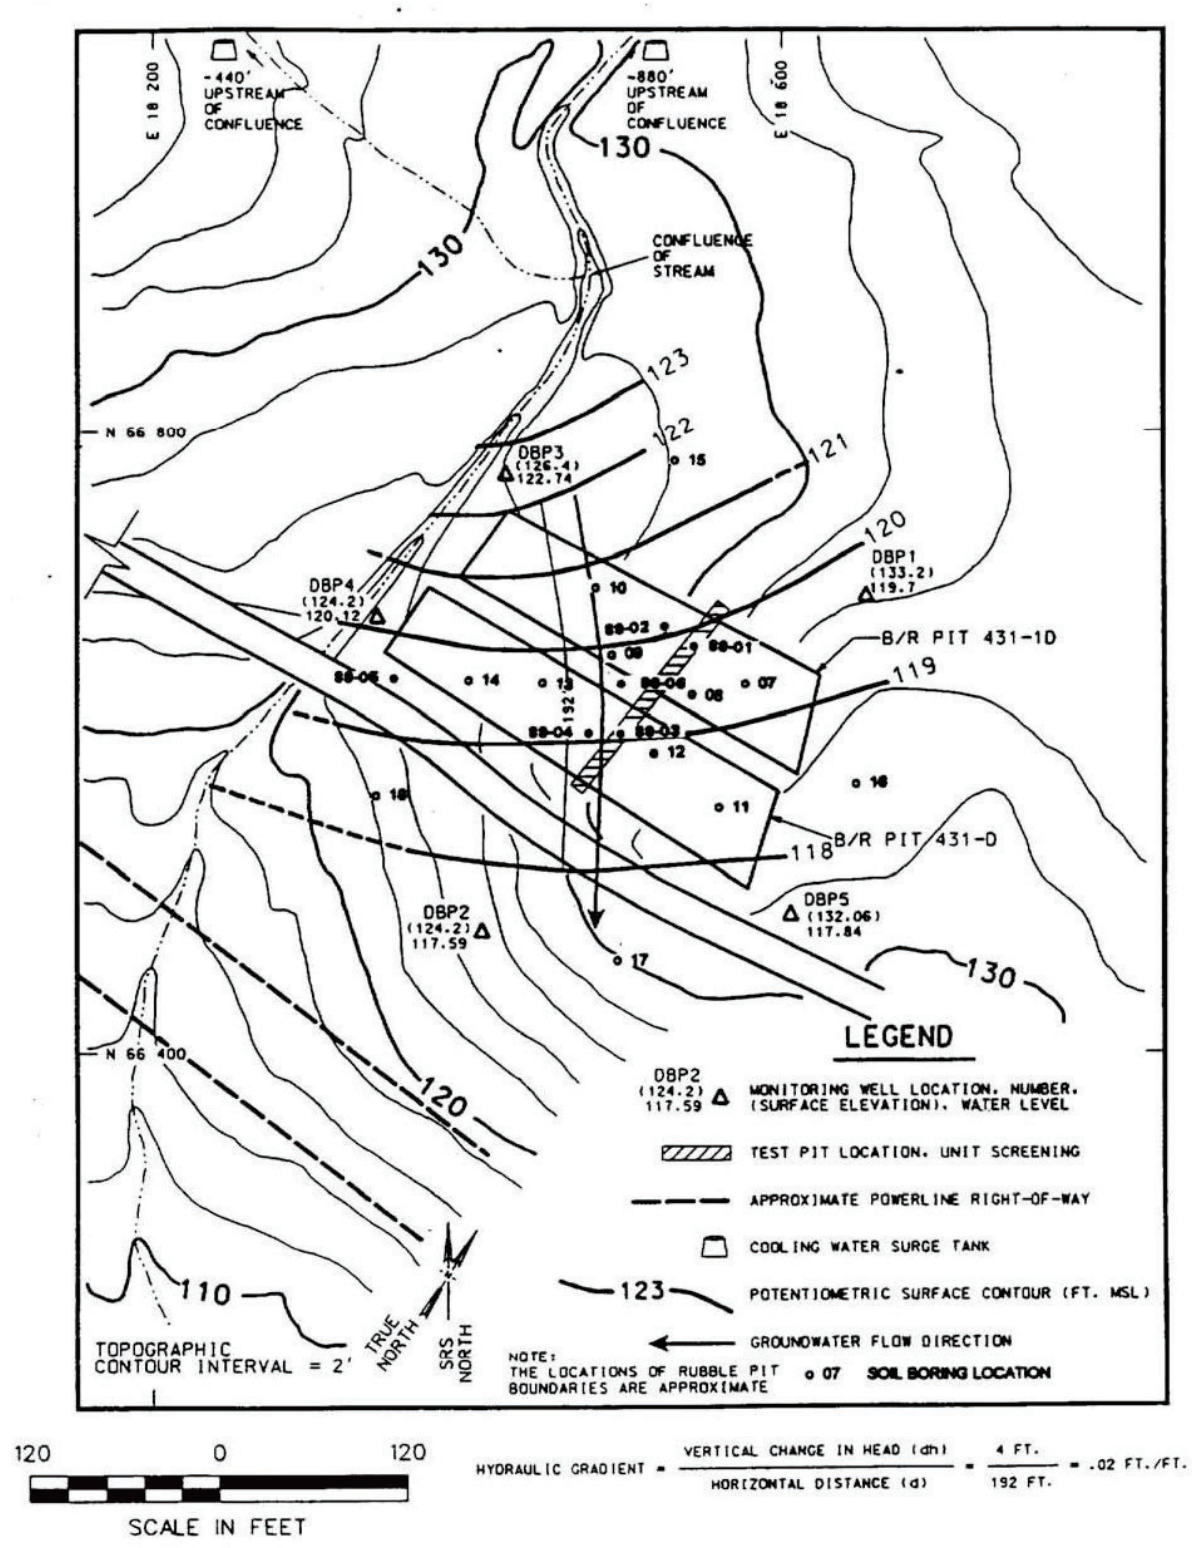


Figure D-2. Site Layout for the DBRP OU



Figure D-3. Photograph of DBRP OU During Active Operation (circa 1973)



Figure D-4. Current Photograph of DBRP OU (2025)



Figure D-5. Current Aerial Photograph of DBRP OU (2025)

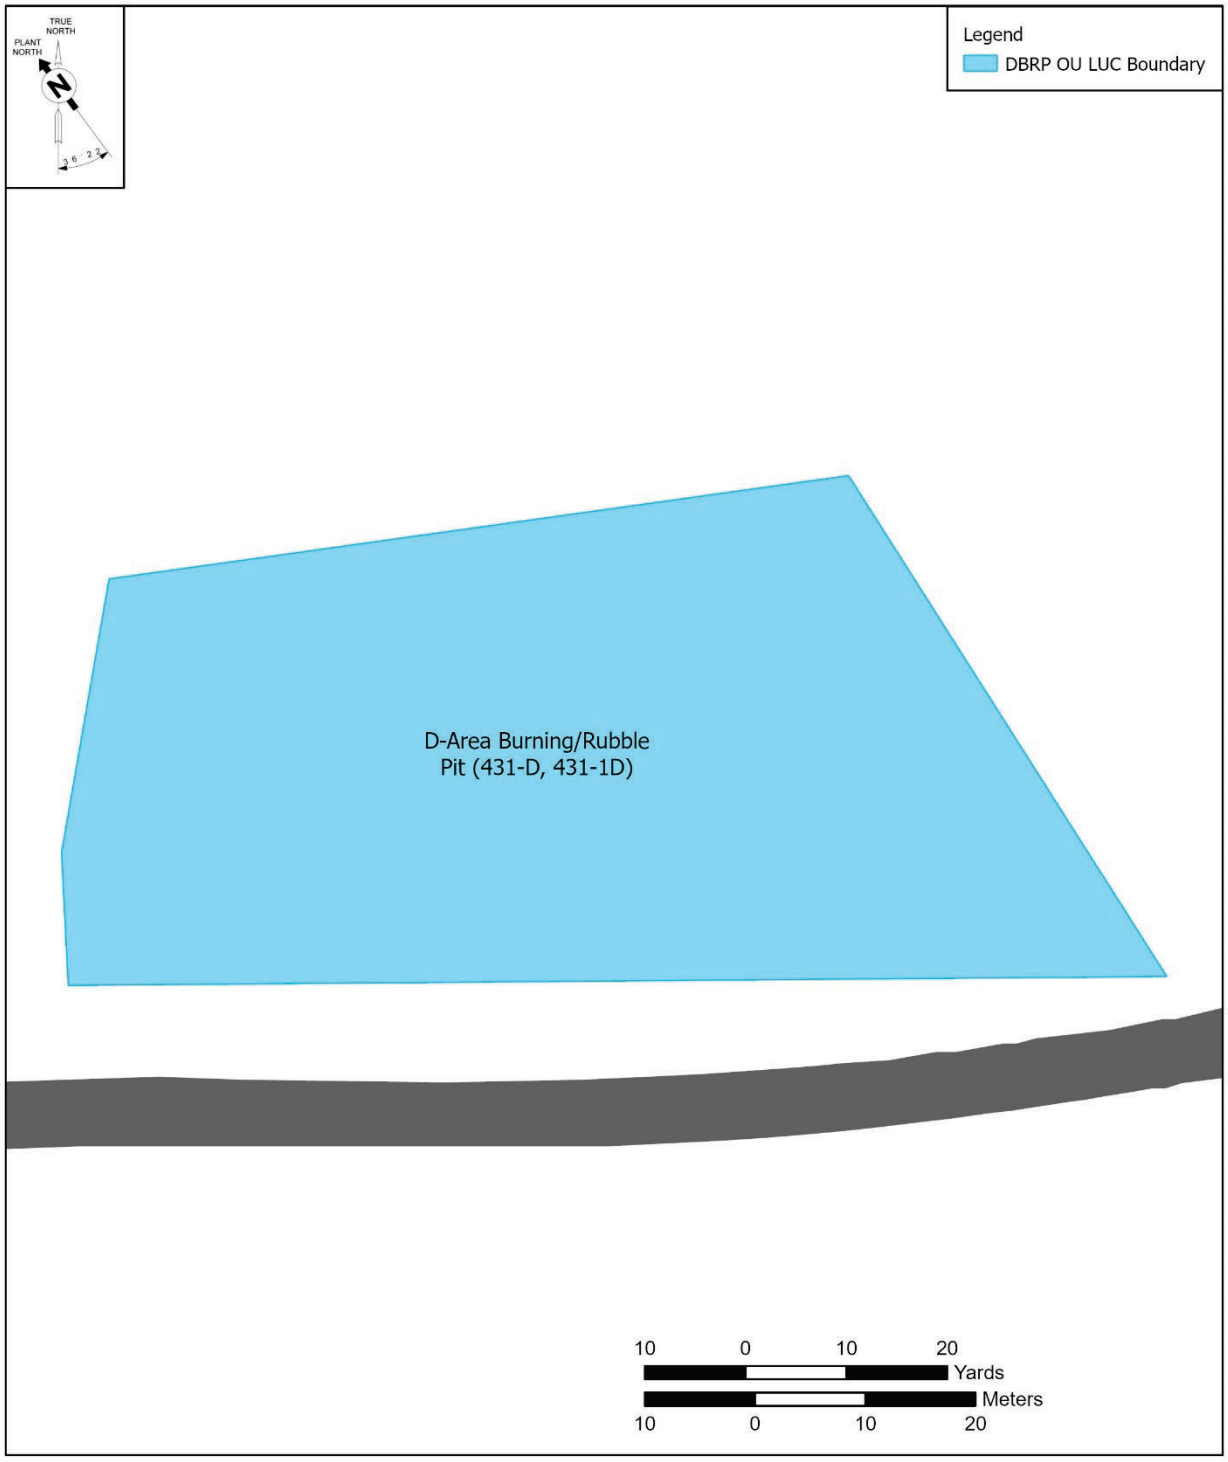


Figure D-6. DBRP OU LUC Boundary

Table D-1. Chronology of OU Events

Event	Date
RFI/RI Field Start / Complete	1989 / November 6, 1996
ROD Issuance	July 3, 1997
Remedial Action Start / Complete	May 12, 1998 / May 12, 1998
Previous Five-Year Reviews	June 30, 1997 / February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table D-2. DBRP Remedial Goals

Unit	Media	RCOC	Type of COC	RG	Basis
D-Area Burning/Rubble Pits (431-D and 431-1D)	Soil	Aroclor 1260	ARAR	2.5E+01	ARAR

Table D-3. Actual versus Estimated O&M Costs

Project Cost	FY2021	FY2022	FY2023	FY2024	FY2025	5-Year Total
Total Actual O&M Costs ($)	21,467	9,212	9,963	13,396	18,997	73,035
Total ROD Estimated Direct O&M Costs* ($)	3,000	0	0	0	0	3,000

*Costs for preparation of the Sixth Five-Year Remedy Review were accounted for in FY2021. Annual O&M costs were not included in the original estimate.

Table D-4. Results of DBRP OU Groundwater Monitoring (1998-2003[4])

Analyte Name	# of Samples	# of Detects	Concentration		Units	Detection Limit[1]	Sample Quantitation Limit[1]	MCL (2005)[2]
			Minimum	Maximum				
1,1,2-Trichloroethane	28	0			µg/L	0.39	5	5
1,2-Dichloroethane	28	0			µg/L	0.53	5	5
Aroclor-1260	28	0			µg/L	0.808	1.09	N/A
Arsenic	32	0			µg/L	7	70	50
Benzene	28	0			µg/L	0.28	5	5
Benzo(a)anthracene	28	0			µg/L	1.83	10.6	0.2
Benzo(a)pyrene	28	0			µg/L	2.74	10.6	0.2
Benzo(b)fluoranthene	28	0			µg/L	1.95	10.6	N/A
Benzo(k)fluoranthene	28	0			µg/L	2.28	10.6	N/A
Chromium	30	10	1.1	27.4	µg/L	3	11	100
Chrysene	28	0			µg/L	1.9	10.6	N/A
Dichloromethane (methylene chloride)	28	6	0.49	4.75	µg/L	4	10	5
Endrin	28	0			µg/L	0.0161	0.109	2
Manganese	29	26	3	905	µg/L	8.6	15	50[3]
Octachlorodibenzo-p-dioxin	26	0			ng/L	4.8	10.1	N/A
Radium, total	21	14	0.649	4.3	pCi/L	1.43	3.79	5
Tritium	30	23	0.32	7.69	pCi/mL	0.926	2.132	20

1 - Maximum detection limit and sample quantitation limit reported to bound the non-detect values.
2 - The MCL (2005) column values are those reported in the Addendum to the FRR (WSRC 2006).
3- Manganese has a secondary MCL promulgated to protect the aesthetics of public water supplies and is not based on toxicity.
4- Groundwater monitoring ended in 2004.
N/A – Not applicable

Table D-5. PFOS/PFAS Screening Results for the DBRP OU

Operable Unit Name:	**DBRP**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and known uses, including a review of historical PFAS applications and categories, PFAS are not expected to be present at this operable unit.**	

This page is intentionally left blank.

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject]

I. SITE INFORMATION			
Site Name:	[Subject]	**Date of Inspection:**	**09/02/2025**
Location and Region	**SRS, USEPA Region 4**	**USEPA ID:**	**SEMS #31**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Sunny 80°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☐ Other _____

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

5. **O&M Staff:** Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949
   Problems/Suggestions: ☐ Report Attached _____

6. **O&M Staff:** Eric Barron (Name) | EC&ACP Post-Closure Waste Site Inspector/Maintenance Coord. (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395
   Problems/Suggestions: ☐ Report Attached _____

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] ***(continued)***

II. INTERVIEWS *(Click all that apply)(Continued)*

7. Local Regulatory Authorities and Response Agencies (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

8. Other Interviews *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. O&M Documents:

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Field Inspection Checklist for D-Area Burning Rubble Pits (431-D and 431-1D)*, ER-IDS-019-003

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] *(continued)*

IV. O&M COSTS

4. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

5. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is summarized in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

6. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons:

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☐ Gates secured ☒ N/A

Remarks: OU-specific perimeter fencing is not required by the remedial action.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A
Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown
Frequency: Once in 5 years
Responsible Party/Agent: USDOE Savannah River Field Office
Contact: Karen Morrow (Name) Director for Closure & Project Management (Title) 11/20/2025 (Date) 803-679-7086 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A
Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A
Violations have been reported: ☐ Yes ☐ No ☒ N/A
Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A
Remarks:

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident
Remarks:

2. Land use changes onsite: ☒ N/A
Remarks:

3. Land use changes offsite: ☒ N/A
Remarks:

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] *(continued)*

VI. GENERAL SITE CONDITIONS			
C. Roads	☒ Applicable	☐ N/A	
1. Roads damaged:	☐ Location shown on site map	☒ Roads adequate	☐ N/A
Remarks:			
D. Other Site Conditions			
Remarks: Inspections conducted from 2021 through 2025 identified active ant mounds, fallen tree on hog fence, and woody vegetation growing on the soil cover. All issues were resolved soon after discovery.			
VII. LANDFILL COVER/CONTAINMENT	☒ Applicable	☐ N/A	
A. Landfill Surface			
1. Settlement (Low spots)**:**	☐ Location shown on site map	☒ Settlement not evident	
Areal extent _____	Depth _____		
Remarks:			
2. Cracks:	☐ Location shown on site map	☒ Cracking not evident	
Lengths _____	Widths _____	Depths _____	
Remarks:			
3. Erosion:	☐ Location shown on site map	☒ Erosion not evident	
Areal extent _____	Depth _____		
Remarks:			
4. Holes:	☐ Location shown on site map	☒ Holes not evident	
Areal extent _____	Depth _____		
Remarks:			
5. Vegetative Cover: ☒ Grass	☒ Cover properly established	☐ No signs of stress	
Areal extent _____	Depth _____		
Remarks:			

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A

Remarks:_____

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident

Areal extent_____ Depth_____

Remarks:_____

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident

☐ Wet areas	☐ Location shown on site map	Areal extent_____
☐ Ponding	☐ Location shown on site map	Areal extent_____
☐ Seeps	☐ Location shown on site map	Areal extent_____
☐ Soft subgrade	☐ Location shown on site map	Areal extent_____

Remarks:_____

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability

Areal extent_____

Remarks:_____

B. Benches ☐ Applicable ☒ N/A

(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A

(Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

D. Cover Penetrations ☐ Applicable ☒ N/A

E. Gas Collection and Treatment ☐ Applicable ☒ N/A

F. Cover Drainage Layer ☐ Applicable ☒ N/A

G. Detention/Sedimentation Ponds ☐ Applicable ☒ N/A

H. Retaining Walls ☐ Applicable ☒ N/A

I. Perimeter Ditches/Offsite Discharge ☐ Applicable ☒ N/A

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A

Attachment D-1. Five-Year Review Site Inspection Checklist – [Subject] *(continued)*

X.OTHER REMEDIES
If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.
A. Soil Vapor Extraction System ☐ Applicable ☒ N/A

XI. OVERALL OBSERVATIONS
A. Implementation of the Remedy
Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.). The remedial action for DBRP OU is LUCs with a period of groundwater monitoring (terminated in 2004). A summary report, including the data and interpretation was submitted to USDOE, SCDES, and USEPA following each groundwater monitoring event. During five annual consecutive monitoring and reporting cycles, no constituents of concern exceeded the MCL; therefore, USDOE, SCDES, and USEPA concurred with terminating the groundwater monitoring at DBRP OU in 2004. The LUC remedy is fully established and functioning as designed.
B. Adequacy of O&M
Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy. The O&M procedures consisting of annual site inspections and site maintenance (repair of erosion damage, cover system, and warning signs) and LUCs (SRS Site Use/Site Clearance Programs, which restrict invasive and permanent installations activities at the waste unit) have been implemented. The O&M procedures are adequately maintaining the DBRP OU and the condition of the warning signs is good. When maintenance activities are identified during inspection (e.g., treating ant mounds, removing fallen trees off of fencing, vegetation removal), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the DBRP OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.
C. Early Indicators of Potential Remedy Failure
Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future. N/A
D. Opportunities for Optimization
Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy. N/A

End of Checklist

APPENDIX E. F-AREA HAZARDOUS WASTE MANAGEMENT FACILITY (904-41G, 904-42G, AND 904-43G) OPERABLE UNIT

I. INTRODUCTION

This report is the seventh five-year review for the F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) (FHWMF) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants have been left in place at the FHWMF OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the FHWMF OU is protective of human health and the environment. This report documents the results of the review.

The remedy for this unit is conducted under the Savannah River Site (SRS) Resource Conservation and Recovery Act (RCRA) program. The Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) remediation requirements are met by the RCRA program; therefore, a separate review of the RCRA Corrective Action is not duplicated in this document.

II. OU CHRONOLOGY

Table E-1 lists the chronology of site events for the FHWMF OU.

III. BACKGROUND

The FHWMF OU is listed as a RCRA Unit in Appendix C of the Federal Facility Agreement (FFA) for SRS (FFA 1993). The media associated with the FHWMF OU is soil.

The groundwater is being addressed by the F-Area Groundwater OU and will be discussed in the five-year remedy review reports for the SRS OUs with operating equipment. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS.

Physical Characteristics

The FHWMF is located in the central portion of SRS, approximately 8 km (5 mi) from the nearest site boundary (Figure E-1). The FHWMF consists of three unlined basins, F-1 (904-41G), F-2 (904-42G) and F-3 (904-43G) and the associated F-Area Inactive Process Sewer Line (FIPSL). Figure E-2 shows the site layout for the FHWMF. The dimensions and volumetric capacity of the basins were as follows:

- Basin F-1 – 27 m x 84 m x 3.2 m (90 ft x 280 ft x 10.7 ft), 6.1 million L (1.6 million gal);
- Basin F-2 – 27 m x 159 m x 3.2 m (90 ft x 530 ft x 10.7 ft), 11.7 million L (3.1 million gal); and
- Basin F-3 – 93 m x 216 m x 3.4 m (310 ft x 720 ft x 11.2 ft), 59.8 million L (15.8 million gal).

At the time of closure, the FHWMF had a combined maximum operating capacity of 77.6 million L (20.5-million gal) of wastewater.

The FIPSL that was used to convey wastewater to the FHWMF is outside the scope of the FHWMF Record of Decision (ROD). The FIPSL RCRA closure action will be completed as part of the closure of the F-Area Tank Farm and Separations facility to avoid impacting underground and overhead interferences necessary to ensure safe operation of the F-Area facilities (SRNS 2022).

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates the FHWMF OU as being within an industrial area. The future land use for the FHWMF OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

The FHWMF operated from 1955 until November 7, 1988. During that time, the FHWMF received waste effluents from F-Area chemical separation facilities processes such as the

nitric acid recovery unit, waste storage system evaporator overheads, and general-purpose evaporator overheads.

Significant amounts of nitrate and caustic were received in the basins. Radioactive releases were greater than 99% tritium (SRNS 2022). The first soil samples at the FHWMF were collected in Basin F-3 in 1971, a year after the U.S. Environmental Protection Agency (USEPA) was formed, and five years before RCRA was enacted in 1976. A 1984 soil coring study of all three basins indicated that approximately 90% of the radionuclides, cations, and anions were concentrated within the top 0.3 m (1 ft) of basin soil.

Initial Response

Preventative actions at FHWMF were conducted pursuant to the requirements of RCRA per Settlement Agreement 87-27-SW.

Closure of the three basins began in 1989 and was completed in February 1991. The three basins were closed by dewatering; physically and chemically stabilizing the remaining sludges with a layer of granite, limestone, and blast furnace slag; and placing a protective multi-layer cover system over them to reduce rainwater contact with basin bottoms.

The FHWMF was certified closed in February 1991 and was accepted by the South Carolina Department of Environmental Services (SCDES) in April 1991 as being in compliance with RCRA requirements.

Basis for Taking Action

The FHWMF OU was subject to closure under South Carolina Hazardous Waste Management Regulations (SCHWMR) R.61-79-265 Interim Status Standards for Owners and Operators of Hazardous Waste Treatment, Storage, and Disposal Facilities (SRNS 2022). Per the approved 2025 RCRA Hazardous Waste Permit Renewal (SCDES 2025), post-closure care is regulated under SCHWMR R.61-79-264. In addition, an ongoing corrective action and monitoring program at the FHWMF is administered through the 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025). The monitoring program consists of monitoring for impacts to groundwater, seepline surface water, and surface water of Fourmile Branch.

Characterization efforts prior to the ROD (WSRC 1993) indicated contamination was present in basin surface water, basin soil, basin sludge and the Floridian Aquifer System soils/sediments (SRNS 2022). The constituents of concern (COCs) identified were barium, cadmium, chromium, lead, mercury, copper, cyanide, nickel, zinc, gross alpha, gross beta, nitrate, radium-226, radium-228, tritium, americium-241, cesium-137, curium-243/244, curium-246, cobalt-60, strontium-90, technetium-99, uranium-233/234, uranium-238 tetrachloroethylene, and trichlorofluoromethane. No remedial goals were established in the ROD for soils (WSRC 1993).

IV. REMEDIAL ACTIONS

Remedy Selection

Preventative alternatives were developed for the FHWMF within the RCRA closure process in 1988. The FHWMF closure was begun in 1989 and completed in July 1991. Preventative activities at the FHWMF became subject to CERCLA when SRS was placed on the National Priorities List in December 1989. As documented in the ROD, the RCRA closure was selected as the final action under CERCLA. Therefore, no further action under CERCLA was necessary for the FHWMF (WSRC 1993).

The remedial action objectives (RAOs) are to prevent the physical exposure to contaminants and to mitigate further migration of contaminants to the groundwater by minimizing a liquid medium pathway (rainwater percolation) for transport. The FHWMF RCRA preventative action of stabilization and placement of all contaminated materials under a low-permeability cap satisfied both RAOs.

Post-closure requirements will be met by:

- Maintaining the integrity and effectiveness of the final cover, including making repairs to the RCRA cap as necessary to correct the effects of settling, subsidence, erosion, or other events;
- Maintaining and controlling the groundwater monitoring system and complying with all other applicable requirements;

- Taking measures to prevent run-on and runoff from eroding or otherwise damaging the final cover; and
- Repairing security control devices.

Remedy Implementation

Implementation of the selected final action remedy (i.e., the RCRA preventative action) included the following activities:

- Dewatering the basins to eliminate free liquids and to solidify the remaining waste and residues;
- Stabilizing the remaining waste by using 0.9 to 1.8 m (3-6 ft) of granite aggregate, 0.3 m (1 ft) of limestone and blast furnace slag to provide a load bearing capacity sufficient to support the cover system; and
- Placing a 2.7-hectare (6.8-acre) low permeability cover system consisting of a layer of backfill, a 0.6-m (2-ft) layer of low-permeability compacted kaolin clay (1.0E-07 cm/s), a 22.5-cm (9-in) drainage layer of sand, a geotextile fabric filter, topped with 0.6 m (2 ft) of topsoil to support a vegetative cover.

Figures E-3 and E-4 provides current photographs of the FHWMF OU. Figure E-5 presents the FHWMF OU RCRA Boundary.

Systems Operations/Operation and Maintenance

There are no system operational requirements associated with the cover system and land use controls (LUCs).

The following maintenance activities are ongoing:

- Post-closure groundwater monitoring is required as a condition of the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) to verify that no unacceptable exposure to potential hazards posed by conditions at the OU occur in the future.

- Quarterly site inspections to verify the integrity of the cover system, OU-specific perimeter fencing, signs, etc. Any necessary repairs will be made as part of the maintenance program.
- Institutional controls (i.e., LUCs) are being enforced to preclude unauthorized access or intrusive activities through the SRS Site Use/Site Clearance program and SRS site security.

Costs associated with the selected remedy for FHWMF include operation and maintenance (O&M) costs of the soil cover and institutional controls (i.e., LUCs). The actual O&M cost during fiscal year (FY) 2021 to FY2025 is $402,576 (Table E-2). RCRA documentation does not require estimated project costs to be prepared. Therefore, a cost data comparison is not provided in this remedy review.

V. PROGRESS SINCE LAST REVIEW

This is the seventh five-year remedy review for the FHWMF. The previous protectiveness statement from the last five-year review concluded that because the remedial actions at FHWMF are protective, the site is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are controlled through a maintained cover system and institutional controls (i.e., LUCs) in place while USDOE controls the OU.

Per recommendation from a previous five-year review, the field inspection frequency for the FHWMF OU was changed from monthly to quarterly (Q) in 2018.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed the implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment E-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls;

- Ensured that all actions required under the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) were implemented (i.e., routine inspections and maintenance to the soil covers and groundwater monitoring); and
- Reviewed changes in standards and to-be-considered guidance.

Summary of Inspections and Interviews

Scheduled quarterly site inspections were conducted from FY2021 through FY 2025 (Various). The field inspection checklists are approved as part of the closure/post-closure/permit application process and are governed by the RCRA Permit Renewal for SRS. They are available in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/). Tasks included on the field inspection checklists include:

- Verifying roads to waste units are accessible;
- Verifying waste unit signs are in acceptable condition, have correct information, and are legible from a distance of 7.6 m (25 ft);
- Checking the closure cover drainage system integrity and function;
- Inspecting closure cover for erosion, abnormal soil cracks, depressions or ponding indicating subsidence;
- Checking for signs of burrowing animals;
- Checking integrity of run on and run off control measures for excessive erosion and sediment build up or debris restricting water flow;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m (3 ft) by 0.9 m (3 ft). There should be no woody vegetation or shrubs growing within the perimeter fence. The height of the vegetative cover should not impair the visual inspection of the closure. This will be determined by the Post Closure Inspector;
- Visually checking subsidence monitors for damage;
- Checking for the survey benchmarks for damage and visibility;

- Checking the side slopes for signs of slumping and ditches for signs of excessive erosion;
- Verifying the annual elevation surveys of the subsidence monitors have been performed for the current year and that the results have been submitted to the Document Control Center; and
- Other.

The field inspections performed at the FHWMF OU identified the following issues: active ant mounds, overhanging limbs on road, small woody vegetation growing on soil cover, small animals burrowing under fencing, and buildup of thatch in drainage gates. These findings were documented on the field inspection checklists and resolved soon after discovery.

The FHWMF OU was inspected by SRNS Environmental Compliance and Area Completion Projects (EC&ACP) on September 2, 2025 and included taking current photographs of the FHWMF OU and reviewing the field inspection checklist. No issues were identified during this inspection. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the FHWMF OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the FHWMF OU that would affect the protectiveness of the remedy.

The FHWMF OU was inspected by SRNS EC&ACP and USDOE personnel on October 29, 2025. No issues were identified for the FHWMF during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection m with USDOE, USEPA and SCDES personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of FHWMF OU and were provided with an

opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection. The FHWMF OU was inspected by SCDES on September 4, 2025, as part of the RCRA annual comprehensive groundwater monitoring evaluation. The basins were observed to be in good condition and no issues were identified.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, in situ stabilization/solidification, RCRA soil cover with institutional controls (i.e., LUCs) is effective in preventing exposure to contaminant risk above 1E-06 risk levels and mitigating further migration of contaminants to groundwater and is functioning as intended.

Institutional controls (i.e., LUCs) have been effective in maintaining restricted (industrial) land use. Quarterly site inspections and site maintenance have been effective in maintaining integrity of the soil cover. Based on the site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The LUC requirements are discussed and approved as part of the closure/post-closure/ permit application process and are governed by the RCRA Permit Renewal for the SRS (SCDES 2025). The closure/post-closure requirements are discussed in the RCRA Permit Renewal Application for the F-Area Hazardous Waste Management Facility (F-Area HWMF) Postclosure (SRNS 2022). Therefore, a Land Use Control Implementation Plan is not required for this OU. The LUCs (i.e. RCRA closure/post-closure care requirements) that are in place include physical access controls to prevent unauthorized contact (i.e., OU-specific fencing with locked gates and warning signs posted on the fences), removal or excavation of subsurface soils, and restrictions to prevent disturbance of the FHWMF OU. Warning signs are in good condition, and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

Are the Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of final remedy selection are still valid. There have been no changes in the standards or physical conditions of the FHWMF OU that would affect the protectiveness of the remedy.

As the remedial work has been completed, the applicable standards set forth in the ROD (WSRC 1993) and the RCRA closure plan (WSRC 1991), associated with soils and basin sediments, have been met. Groundwater is being addressed by the F-Area Groundwater OU and will be discussed in the five-year remedy review reports for SRS OUs with operating equipment.

The USEPA standards and toxicity values have been updated since submittal of five-year remedy review as shown in Appendix B. The changes to the values for COCs at the FHWMF OU included some decreases in the regional screening levels (RSLs) due to updated input values used to calculate the RSLs. The residential soil screening level for lead decreased from 400 mg/kg to 200 mg/kg. If other sources of lead are present, the screening level is 100 mg/kg. However, these changes do not affect the protectiveness of the remedy and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchllorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants, except for PFOS and other PFAS, were identified as applicable to this OU based on the OU history of contamination.

Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this waste unit (Table E-3). However, the engineered cover system in place serves as an effective and protective remedy, mitigating potential exposures and releases associated with PFAS.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that prevent the remedy from being protective of this OU.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for the FHWMF OU under CERCLA.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the FHWMF OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by stabilization and placement of all contaminated materials under a low-permeability cap and institutional controls (i.e., LUCs) to prevent exposure to or ingestion of contaminated soil media and mitigating further migration of contaminants to groundwater. All threats to the FHWMF OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the FHWMF OU for industrial use only, and warning signs and use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2025. South Carolina Hazardous and Mixed Waste Permit, Permit Number SC1 890 008 989, 2025 RCRA Permit Renewal for the Savannah River Site, issued on October 27, 2025, Module III – Postclosure Care and Module IV - Groundwater Requirements, Section B, F-Area Hazardous Waste Management Facility, South Carolina Department of Environmental Services, Division of Waste Management, Bureau of Land and Waste Management, Columbia, SC

SRNS, 2022. *2013 RCRA Permit Renewal Application for the F-Area Hazardous Waste Management Facility (F-Area HWMF) Postclosure*, SRNS-IM-2012-00002, Volume IV, Revision 3, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1991. *Closure Plan for F Area Hazardous Waste Management Facility*, Volume IV, Revision 10, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1993. *Final Record of Decision Remedial Alternative Selection for F-Area Hazardous Waste Management Facility (U),* WSRC-RP-93-1042, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC Savannah River Site, Aiken, SC

Various - Post-Closure Inspection F-Area Hazardous Waste Management Facilities 904-41G, 904-42G, 904-43G, ER-IDS-019-019, Inspection period FY2021 through FY2025 (quarterly)

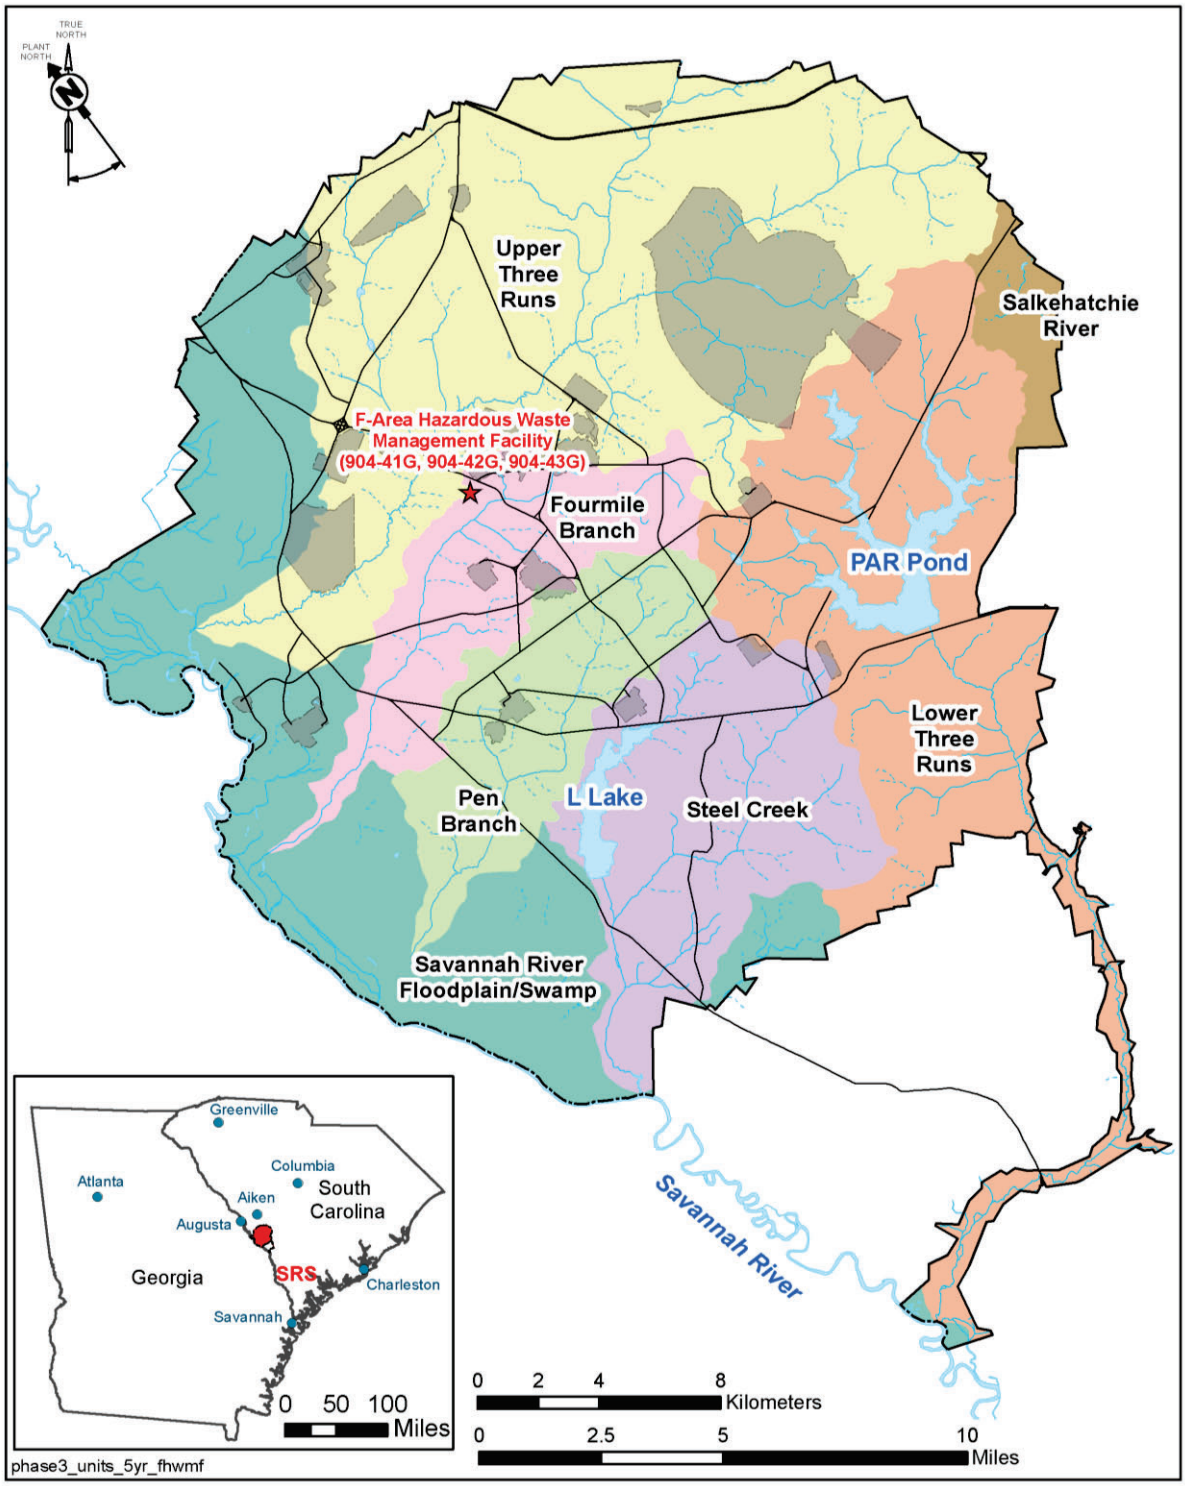


Figure E-1. Location of the FHWMF OU at SRS

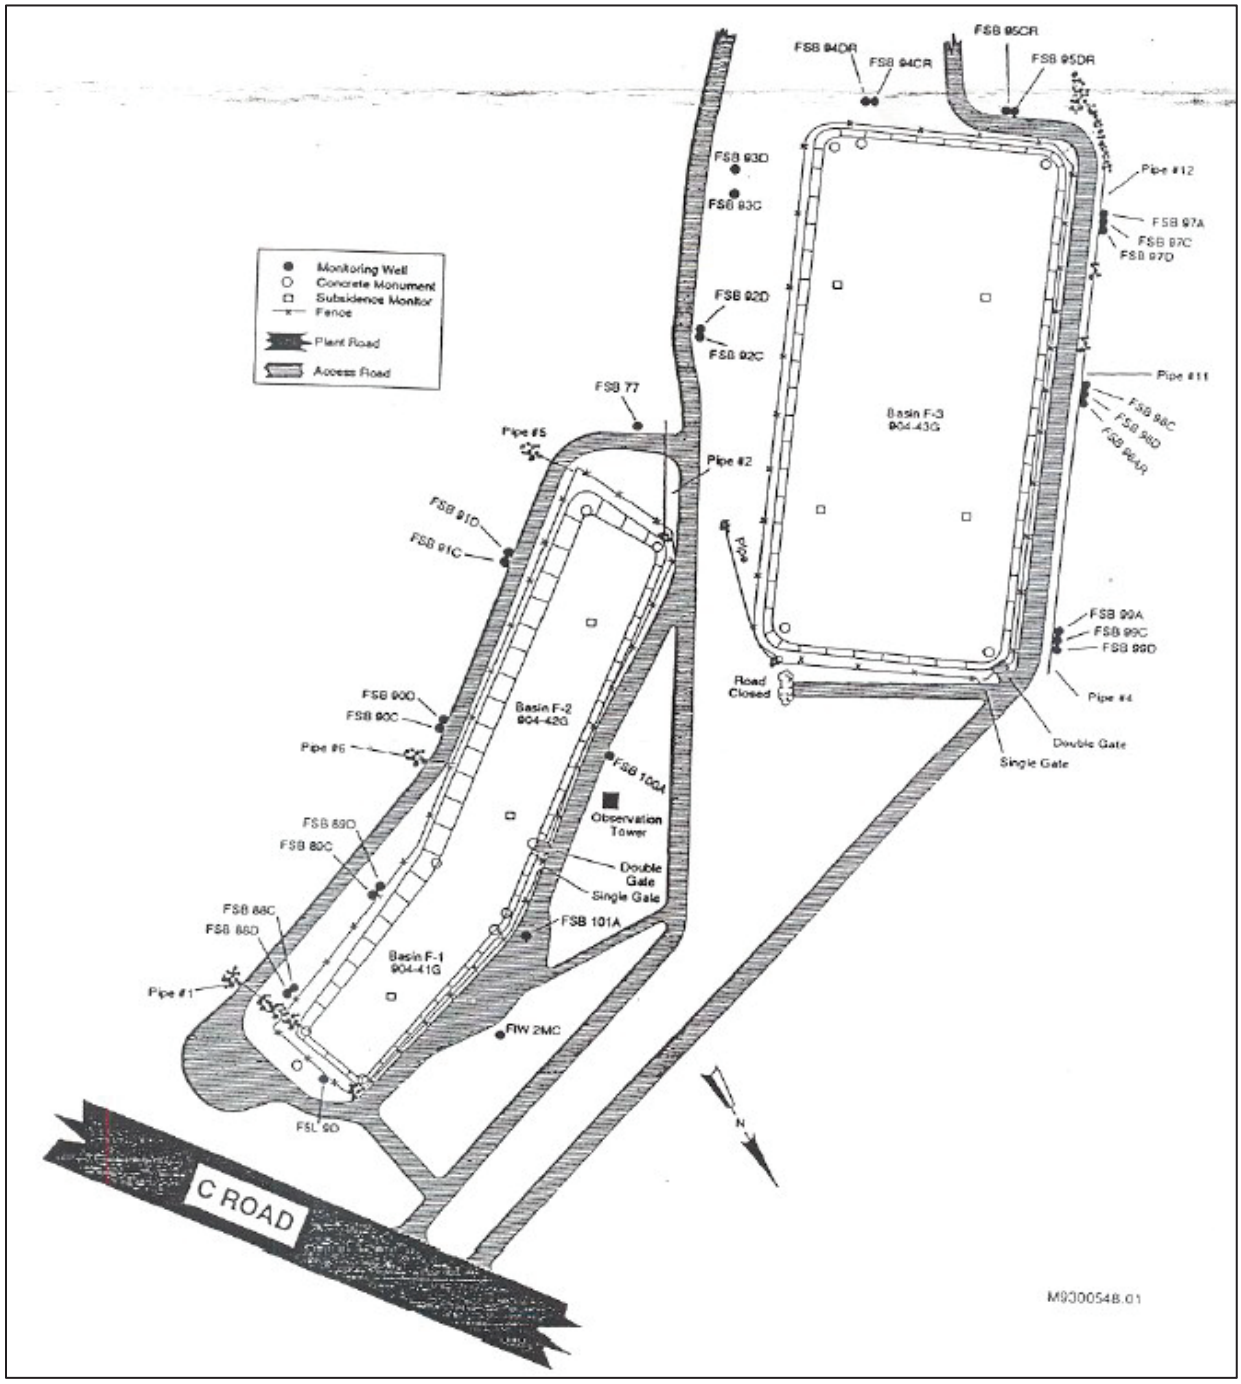


Figure E-2. Site Layout for FHWMF OU



Figure E-3. Current On-Unit Photograph of the Cover System of the FHWMF OU (2025)



Figure E-4. Current Aerial Photograph of the Cover System of the FHWMF OU (2025)



Figure E-5. FHWMF OU RCRA Boundary

This page is intentionally left blank.

Table E-1. Chronology of OU Events

Event	Date
RCRA Closure Plan Approved	June 1989
Corrective Action start	1989
RCRA Closure Certified	February 1991
Final ROD Issuance	October 1, 1993
Previous Five-Year Reviews Issuance	August 27, 1997 / February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table E-2. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	Five-Year Total
Total Actual O&M Costs ($)	65,840	74,815	77,944	82,899	101,078	402,576
Total ROD Estimated Direct O&M Costs ($)	N/A	N/A	N/A	N/A	N/A	0

RCRA documentation does not require estimated project costs to be prepared.
N/A = not applicable

Table E-3. PFOS/PFAS Screening Results for the FHWMF OU

Operable Unit Name:	**FHWMF**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	**Yes**	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Waste Unit Conclusion:	**Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this operable unit.**	

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU

I. SITE INFORMATION			
Site Name:	**F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU**	**Date of Inspection:**	**9/2/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #6**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Sunny 80°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☒ Other Stabilization
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. O&M Staff: Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949

Problems/Suggestions: ☐ Report Attached

2. O&M Staff: Eric Barron (Name) | EC&ACP Post-Closure Waste Site Inspector/Maintenance Coord. (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395

Problems/Suggestions: ☐ Report Attached

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. Local Regulatory Authorities and Response Agencies (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. Other Interviews *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. O&M Documents:

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019; Post Closure Inspection F-Area Hazardous Waste Management Facilities 904-41G, 904-42G, 904-43G (U)*, ER-IDS-019-019 (2021 through 2025)

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☒ Other Permits	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: RCRA Hazardous and Mixed Waste Permit Renewal

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

7. Groundwater Monitoring Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is discussed in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons:

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

2. Fencing Damage: ☐ Location shown on site map ☒ Gates secured ☐ N/A

Remarks: OU-specific perimeter fencing is required by the remedial action. Perimeter fencing is in good condition.

B. Signs

2. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Matt Baker (Name) | Acting FFA Remedial Project Manager (Title) | 10/29/2025 (Date) | 803-952-6211 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks:

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

VI. GENERAL SITE CONDITIONS	
E. Roads	☒ Applicable ☐ N/A
1. Roads damaged:	☐ Location shown on site map ☒ Roads adequate ☐ N/A
Remarks:	
F. Other Site Conditions	
Remarks: Inspections conducted from FY2021 through FY2025 identified active ant mounds, overhanging limbs on road, small woody vegetation growing on soil cover, small animals burrowing under fencing, and buildup of thatch in drainage grates. These findings were resolved soon after discovery.	

VII. LANDFILL COVER/CONTAINMENT	☒ Applicable ☐ N/A
A. Landfill Surface	
1. Settlement (Low spots)**:**	☐ Location shown on site map ☒ Settlement not evident
Areal extent _____ Depth _____	
Remarks:	
2. Cracks:	☐ Location shown on site map ☒ Cracking not evident
Lengths _____ Widths _____ Depths _____	
Remarks:	
3. Erosion:	☐ Location shown on site map ☒ Erosion not evident
Areal extent _____ Depth _____	
Remarks:	
4. Holes:	☐ Location shown on site map ☒ Holes not evident
Areal extent _____ Depth _____	
Remarks:	
5. Vegetative Cover:	☒ Grass ☒ Cover properly established ☐ No signs of stress
Areal extent _____ Depth _____	
Remarks: Vegetation is mowed routinely.	

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*
6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A Remarks:_____
7. Bulges: ☐ Location shown on site map ☒ Bulges not evident Areal extent_____ Depth_____ Remarks:_____
8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident ☐ Wet areas ☐ Location shown on site map Areal extent_____ ☐ Ponding ☐ Location shown on site map Areal extent_____ ☐ Seeps ☐ Location shown on site map Areal extent_____ ☐ Soft subgrade ☐ Location shown on site map Areal extent_____ Remarks:_____
9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability Areal extent_____ Remarks:_____
B. Benches ☐ Applicable ☒ N/A (Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)
C. Letdown Channels ☐ Applicable ☒ N/A (Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)
D. Cover Penetrations ☐ Applicable ☒ N/A
E. Gas Collection and Treatment ☐ Applicable ☒ N/A
F. Cover Drainage Layer ☐ Applicable ☒ N/A
G. Detention/Sedimentation Ponds ☐ Applicable ☒ N/A
H. Retaining Walls ☐ Applicable ☒ N/A

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

I. Perimeter Ditches/Offsite Discharge ☒ Applicable ☐ N/A

5. Siltation: ☐ Location shown on site map ☒ Siltation not evident
Areal extent_____ Depth_____
Remarks:_____

6. Vegetative Growth: ☐ Location shown on site map ☐ N/A
☒ Vegetation does not impede flow
Areal extent_____ Type_____
Remarks:_____

7. Erosion: ☐ Location shown on site map ☒ Erosion not evident
Areal extent_____ Depth_____
Remarks:_____

8. Discharge Structure: ☐ Location shown on site map ☒ N/A
Remarks:_____

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A

X. OTHER REMEDIES

If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.

A. Stabilization ☒ Applicable ☐ N/A
Stabilization was performed at FHWMF OU. The remedy is performing as designed.

Attachment E-1. Five-Year Review Site Inspection Checklist – F-Area Hazardous Waste Management Facility (904-41G, 904-42G, and 904-43G) OU *(continued/end)*

XI. OVERALL OBSERVATIONS

A. Implementation of the Remedy

Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.).

Closure of the three basins (904-41G, 904-42G, and 904-43G) by dewatering, physically and chemically stabilizing the remaining sludge, and placement of a protective multi-layer cover system met the remedial objectives of preventing physical exposure to contaminants and mitigating further migration of contaminants to the groundwater. Selected remedies for the FHWMF OU are functioning as intended. There are no issues requiring corrective actions for the cover system and LUCs.

B. Adequacy of O&M

Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy.

The O&M procedures consisting of site inspections and site maintenance (repair of erosion damage, cover system, fencing and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the waste unit) have been implemented. The O&M procedures are adequately maintaining the FHWMF OU and the condition of the warning signs is good. When maintenance activities are identified during inspections (e.g., treating ant mounds, vegetation and tree limb removal, clearing drain grates, filling burrowed holes under fencing), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the FHWMF OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.

C. Early Indicators of Potential Remedy Failure

Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future.

N/A

D. Opportunities for Optimization

Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy.

N/A

End of Checklist

This page is intentionally left blank.

APPENDIX F. FORD BUILDING SEEPAGE BASIN (904-91G) OPERABLE UNIT

I. INTRODUCTION

This is the fifth five-year remedy review for the Ford Building Seepage Basin (904-91G) (FBSB) Operable Unit (OU). This review was conducted from July 2025 through December 2025. Contaminants have been left in place at the FBSB OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the FBSB OU is protective of human health and the environment. This report documents the results of the review.

II. OU CHRONOLOGY

Table F-1 lists the chronology of site events for the FBSB OU.

III. BACKGROUND

The FBSB OU is listed as a Resource Conservation and Recovery Act (RCRA)/ Comprehensive Environmental Response, Compensation, and Liability Act unit in Appendix C of the Federal Facility Agreement (FFA) for Savannah River Site (SRS) (FFA 1993). The media associated with the FBSB OU include soil and groundwater beneath the OU. However, the results of the groundwater investigation contained in the RCRA Facility Investigation (RFI) / Remedial Investigation (RI) with Baseline Risk Assessment (BRA) for the FBSB OU (WSRC 2000), which included a collection of groundwater samples and analyses, revealed that the groundwater associated with FBSB OU is not contaminated.

Physical Characteristics

The FBSB OU is located approximately in the middle of the SRS within the Pen Branch Watershed (Figure F-1). The water table is approximately 15 m (50 ft) below land surface and flows southwest. The FBSB and its associated components were constructed in 1964. The FBSB OU includes the following components:

- Unlined Seepage Basin – 36 m by 24 m (120 ft by 80 ft) at ground level, 18 m by 7.5 m (60 ft by 25 ft) at the bottom of the basin, 3 m (10 ft) deep, 567,800-L (150,000-gal) capacity;

- Underground Retention Tank – 22,700-L (6,000-gal) capacity;
- Underground Process Sewer Line between Ford Building and Retention Tank – 5-cm (2-in), 18 m (60 ft) long;
- Underground Piping Process Sewer Line between Retention Tank and Seepage Basin – 5-cm (2-in), 32.4 m (108 ft) long;
- Pumping Station;
- A delisted National Pollutant Discharge Elimination System (NPDES) Outfall CS-008 and associated riprap-lined earthen drainage ditch;
- Underground abandoned fire hydrant 20-cm (8-in) line; and
- Groundwater associated with the unit.

Figure F-2 depicts the layout of the FBSB OU.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates FBSB OU as being within the site industrial support area. The future land use for FBSB OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

From 1964 until 1984, the FBSB received approximately 1.44 million L (380,400 gal) of wastewater generated in the Ford Building during the reconfiguration, repair, and scrapping of reactor heat exchangers and other process equipment. The dominant radionuclide received was tritium (470 curies) along with smaller amounts of cobalt-60, strontium-90, cesium-137, and unidentified alpha emitters. Trace amounts of nonradioactive surfactants, and organic and inorganic constituents may have been released into the basin. There is no record of the basin overflowing.

Initial Response

A removal action taken in 1998 removed the retention tank, pumping station, and underground piping process sewer lines to an off-unit disposal area. Approximately 2.1 m^3 (2.8 yd^3) of radiologically contaminated soil was containerized and stored at the FBSB OU until final disposition per the remedial decision in the Record of Decision (ROD) (WSRC 2001). Figure F-3 presents photographs of the FBSB OU before remediation and Figures F-4 and F-5 present photographs of the FBSB OU in the current condition.

Basis for Taking Action

The field investigations and the operational records identified four potential primary sources of contamination: FBSB, Tank/Process Sewer Line, NPDES Ditch, and the fire hydrant line. The RFI/RI/BRA report concluded that cesium-137, cobalt-60, and europium-154 present in the surface soil in the Seepage Basin Area pose human exposure health risks (greater than 1.0E-06) to future industrial workers. Aroclor-1254 represents an ecological risk to insectivorous mammals in the Seepage Basin Area. Arsenic, cesium-137, cobalt-60, and europium-154 are present in the subsurface soil beneath the Seepage Basin Area and present human health risks (greater than 1.0E-06) to future industrial workers exposed to subsurface soil. Cesium-137 and cobalt-60 are also present in surface and subsurface soils at the Tank/Process Sewer at levels that pose human exposure health risks (greater than 1.0E-06) to future industrial worker. Results of the RFI/RI/BRA concluded that there were no refined contaminants of concern (RCOCs) for the FBSB OU vadose zone, fire hydrant line, NPDES Ditch, and groundwater. There are no contaminant migration RCOCs and no principal threat source material at the FBSB OU.

The soil that required remedial action was located in the Seepage Basin Area (surface and subsurface) and Tank/Process Sewer Line Area (fully contained within a 1.2-m [4-ft] depth). Table F-2 provides the RCOCs and corresponding remedial goals (RGs) identified for the FBSB soils and Tank/Process Sewer Line soils.

IV. REMEDIAL ACTIONS

Remedy Selection

As stated in the ROD (WSRC 2001), the following are the remedial action objectives (RAOs) for the FBSB OU:

Seepage Basin Area Subunit

- Protect future industrial workers at the Seepage Basin Area from exposure to three RCOCs (cesium-137, cobalt-60, and europium-154) that exceed RGs in surface soils 0 to 0.3 m (0 to 1 ft) and four RCOCs (arsenic, cesium-137, cobalt-60, and europium-154) that exceed RGs in subsurface soils 0.3 to 1.2 m (1 to 4 ft deep) (Table F-2).
- Protect current terrestrial ecological receptors (insectivorous mammals) at the Seepage Basin Area from exposure to Aroclor 1254 at levels above the RG (0.0219 mg/kg) in surface soil.

Tank/Process Sewer Line Area Subunit

- Protect future industrial workers at the Tank/Process Line Area from exposure to cesium-137 and cobalt-60 that exceed RGs in surface and subsurface soils (Table F-2).

As stated in the ROD (WSRC 2001), the selected remedy for the FBSB OU was:

- Excavate all contaminated soil exceeding 1.0E-06 risk (for industrial worker) from the Tank/Process Sewer Line Area and disposition the soil into the seepage basin along with the vegetation existing in the basin;
- Remove the containerized soil (contaminated surface soil from the retention tank area) from two B-12 boxes and a 55-gallon drum and disposition the waste into the seepage basin;
- Backfill the remaining volume of the seepage basin and the excavated area of the Tank/Process Sewer Line Area with clean soil from an SRS borrow pit;
- Grade the clean soil to match the surrounding topography and cover the backfilled areas with vegetative cover to minimize erosion;
- Implement institutional controls (i.e., land use controls [LUCs]).

The following LUC objectives for the FBSB OU are necessary to ensure protectiveness of the remedy:

- Maintain the use of the OU for industrial activities only;
- Prevent unauthorized access to the closed FBSB OU as long as the waste remains a threat to human health and the environments; and
- Preserve the cover and prevent disturbance of the dispositioned soil.

Remedy Implementation

Implementation of the FBSB OU remedial action included the following activities:

- Consolidated approximately 183.6 m^3 (240 yd^3), 505.5 m^3 (1685 yd^3) and 2.14 m^3 (2.8 yd^3) of contaminated soil by excavating to a depth of 1.2 m (4 ft) in the Tank/Process Sewer Line Area and to a width of 0.6 m (2 ft) and a depth of 0.3 m (1 ft) at the bank of the basin, and removed containerized soil (one 55-gallon drum and two B-12 boxes) and transported the soil with the existing vegetation to the basin bottom, respectively;
- Installed soil covers over the seepage basin (0.09 hectare [0.22 acre]) and the excavated areas of the Tank/Process Sewer Area (0.09 hectare [0.21 acre]) consisting of a minimum of 1.2-m (4-ft) thick common fill layer covered by a 15-cm (6-in) thick vegetative layer for the seepage basin and a 15-cm (6-in) thick crusher run for the tank/process sewer area. The common fill and vegetative layers consisted of clean soil from an approved SRS borrow pit;
- Seeded the seepage basin soil cover for vegetation;
- Established LUCs for 0.11 hectares (0.28 acres) of the FBSB OU (Figure F-6), which include site inspections of the seepage basin cover and the installation of warning signs around the seepage basin. Site inspections of the tank/process sewer area cover are not required because all soils exceeding 1.0E-06 risk (industrial) were removed. Existing SRS access controls will be used to maintain the use of this site for industrial use only. Institutional controls (i.e., administrative measures) and use restrictions for on-site workers via the Site Use/Site Clearance Program. Other administrative controls to

ensure worker safety include work controls, worker training, and worker briefings of health and safety requirements.

System Operations/Operation and Maintenance

There are no system operational requirements.

The following maintenance activities are ongoing:

- Site inspections (semiannual through 2014; frequency reduced to annual thereafter [USDOE 2014]) and site maintenance (repair of erosion damage, cover maintenance, and warning signs) of the seepage basin cover; and
- Site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the waste unit).

Table F-3 compares the actual operation and maintenance (O&M) costs for the five-year remedy review period to the estimated direct O&M costs from the ROD (WSRC 2001). The estimated O&M cost for fiscal year (FY) 2021 to FY2025 was $50,000 for site inspections, maintenance of the cover, and LUCs. The actual O&M cost for FY2021 to FY2025 is $58,725. The actual O&M costs (Table F-3) are as expected.

V. PROGRESS SINCE LAST REVIEW

This is the seventh five-year remedy review for the FBSB OU. The previous protectiveness statement concluded that the remedial actions at FBSB OU are expected to be protective. The final remedial actions of excavation, consolidation, and backfilling of excavated areas along with LUCs have been functioning properly.

There were no recommendations or follow-up actions from the last five-year review.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed the implementation of the remedial action;

- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment F-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Reviewed changes in standards and to-be-considered guidance

Summary of Inspections and Interviews

Scheduled annual inspections were conducted at the FBSB OU from FY2021 through FY2025 (Various). Tasks included on the field inspection checklists (WSRC 2003) include:

- Verifying roads are accessible;
- Verifying waste unit signs (4) are in acceptable condition, have correct information and are legible from a distance of 7.6 m (25 ft);
- Verifying there is no excavating, digging, or construction activity on soil cover;
- Verifying no woody vegetation is growing on the soil cover. Remove or identify as needed;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m by 0.9 m (3 ft by 3 ft) in the area. The height of the vegetation should not impar visual inspection of the soil cover. This will be determined by the Inspector;
- Checking soil cover for signs of erosion or depressions (subsidence);
- Checking for signs of burrowing animals; and
- Other.

The field inspections identified the following issues: active ant mounds. These findings were documented on the field inspection checklists and resolved soon after discovery.

The FBSB OU was inspected by SRNS Environmental Compliance and Area Completion Projects (EC&ACP) on August 19, 2025 and included taking current photographs of the FBSB OU and reviewing the field inspection checklist. No issues were identified during this inspection. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025, at the O&M organization

offices. No issues were identified for the FBSB OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the FBSB OU that would affect the protectiveness of the remedy.

The FBSB OU was inspected by SRNS EC&ACP and USDOE personnel on October 29, 2025. No issues were identified for the FBSB OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, U.S. Environmental Protection Agency (USEPA) and South Carolina Department of Environmental Services (SCDES) personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of FBSB OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspections.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Documents?

The remedy, excavation, consolidation, common fill cover with LUCs, is effective in preventing exposure to contaminants above 1E-06 risk level and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Annual site inspections and site maintenance have been effective in maintaining the integrity of the soil cover. Based on the site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The Land Use Control Implementation Plan (LUCIP) for the FBSB OU, located in Appendix A of the Post-Construction Report/Corrective Measures Implementation Report/Final Remediation Report, governs LUC implementation, maintenance, monitoring, reporting, and enforcement of LUCs (WSRC 2003). The LUCs that are in

place include physical access controls to prevent unauthorized contact, removal or excavation or subsurface soils, and restrictions to prevent disturbance of the FBSB OU. Warning signs are in good condition, and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

The LUCIP is available on the SRS external webpage in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/) and the Land Use Control Assurance Plan webpage (https://public.srs.gov/ missions-and-programs/environmental-stewardship/lucap/).

Are Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of final remedy selection are still valid. There have been no changes in standard or physical conditions at the FBSB OU that would affect the protectiveness of the remedy.

The USEPA standards and toxicity values have been updated since submittal of the five-year remedy review as shown in Appendix B. The changes to the values for RCOCs at the FBSB OU were not significant, and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants were identified as applicable to this OU based on the OU history of contamination. Table F-4 provides the screening results of PFOS and PFAS for the FBSB OU.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that could call into question the protectiveness of the remedy.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for this OU.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the FBSB OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure or ingestion of contaminated soil media. All threats to the FBSB OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the FBSB OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC Savannah River Site, Aiken, SC

WSRC, 2000. *RCRA Facility Investigation/Remedial Investigation with Baseline Risk Assessment for the Ford Building Seepage Basin (904-91G) Operable Unit (U)*, WSRC-RP-98-4096, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2001. *Record of Decision Remedial Alternative Selection for the Ford Building Seepage Basin Operable Unit (904-91G) (U)*, WSRC-RP-2000-4156, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2003. *Post-Construction Report (PCR)/Corrective Measures Implementation Report (CMIR)/Final Remediation Report (FRR) for the Ford Building Seepage Basin (904-91G) Operable Unit (U)*, WSRC-RP-2003-4038, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

Various - *Inspection Data Sheets – Field Inspection Checklist, Ford Building Seepage Basin (904-91G) (U)*, ER-IDS-019-024, Inspection period 2021 through 2025 (annually)

This page is intentionally left blank.

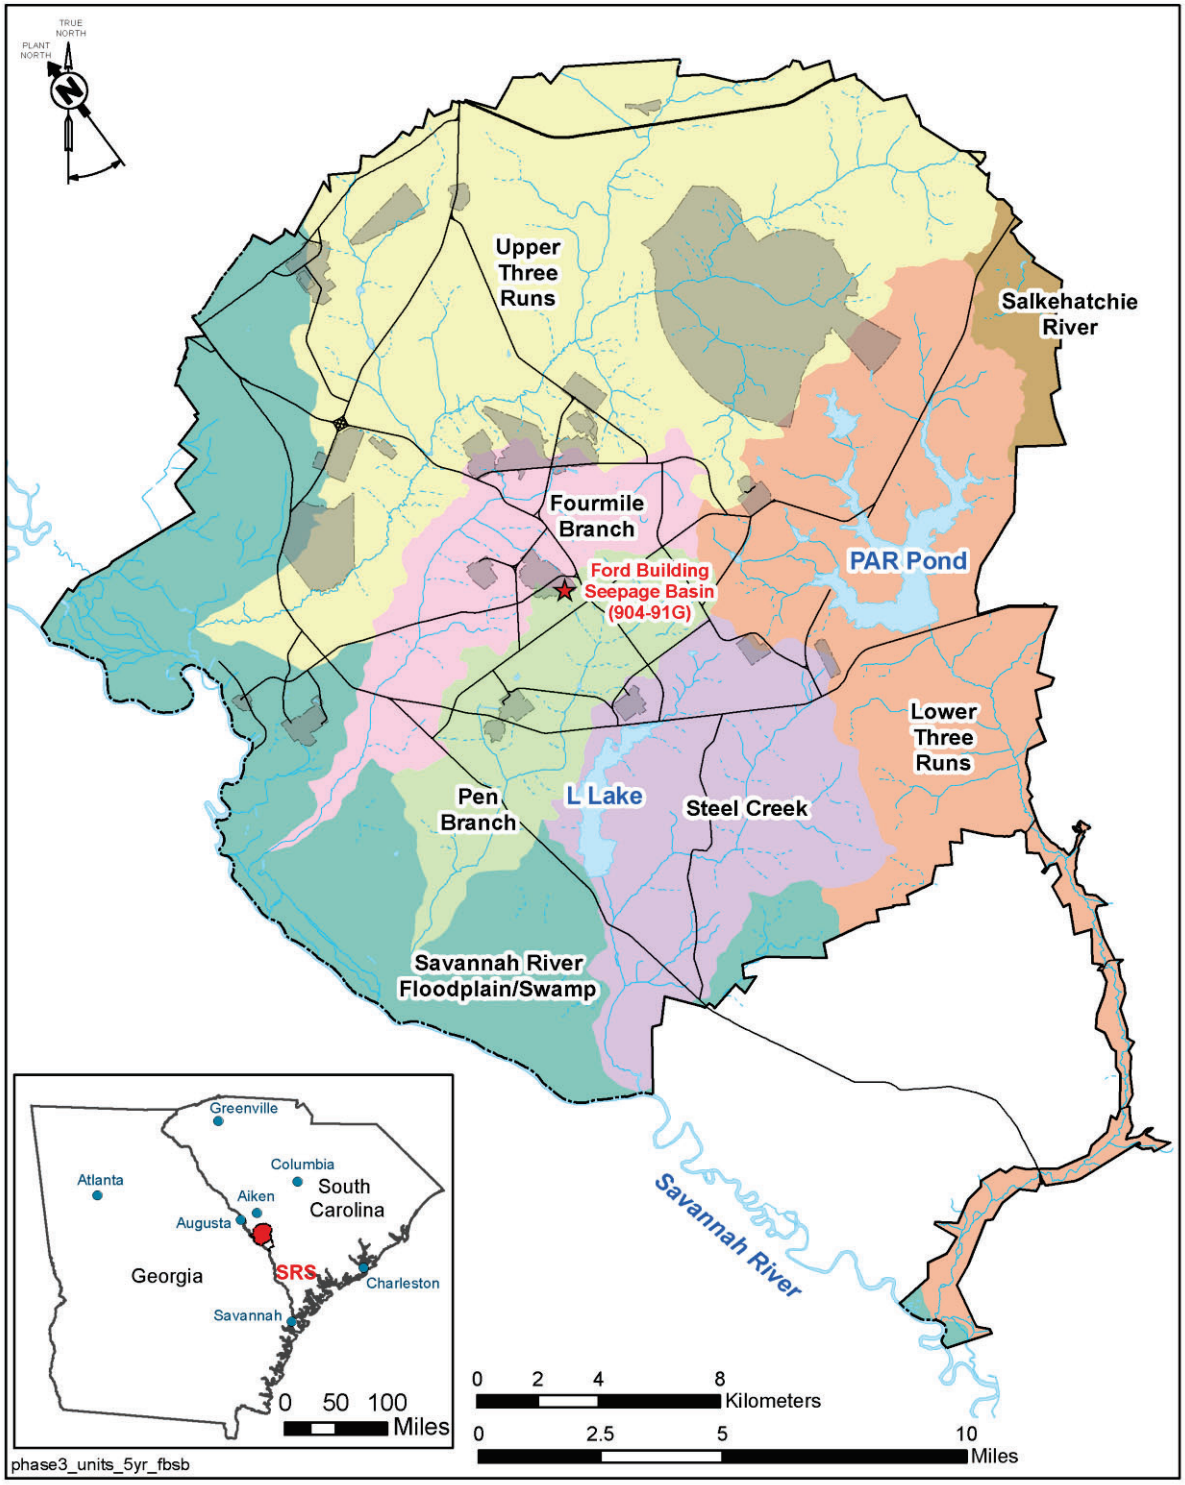


Figure F-1. Location of the FBSB OU at SRS

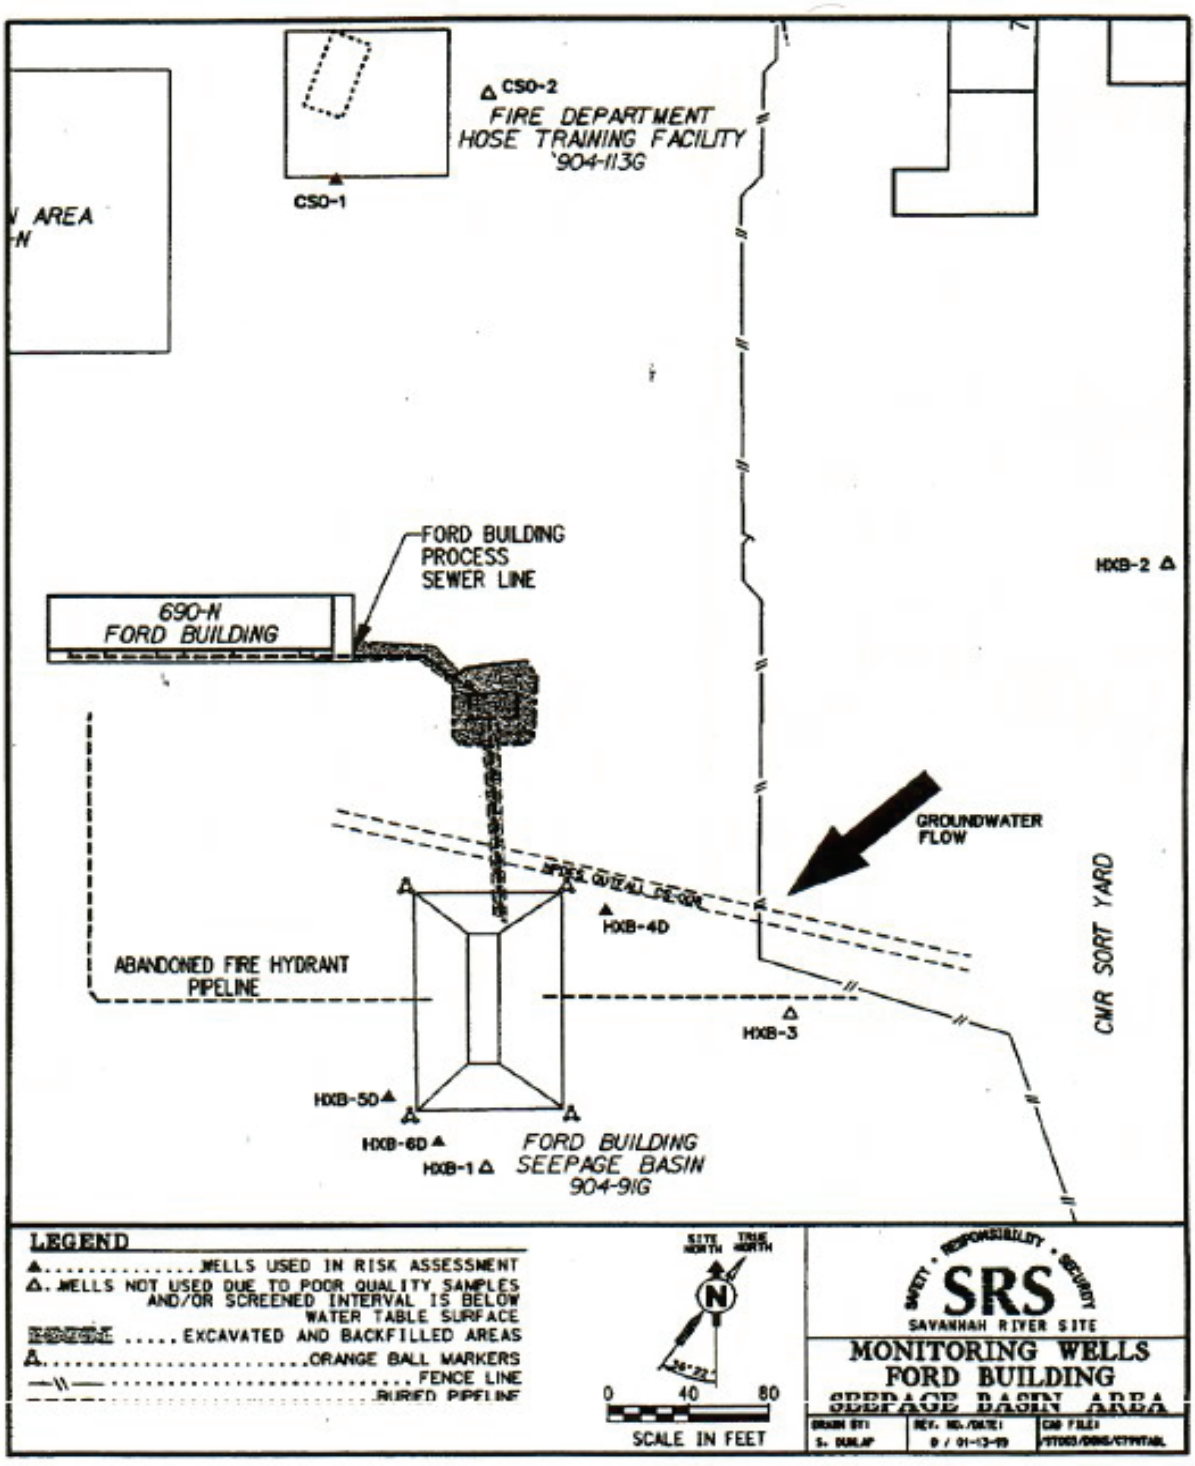


Figure F-2. Layout of the FBSB OU



Figure F-3. Oblique Aerial Photograph of the FBSB OU (1996)



Figure F-4. Current Photograph of the FBSB OU (2025)



Figure F-5. Aerial Photograph of the Ford Building Seepage Basin (904-91G)(2025)

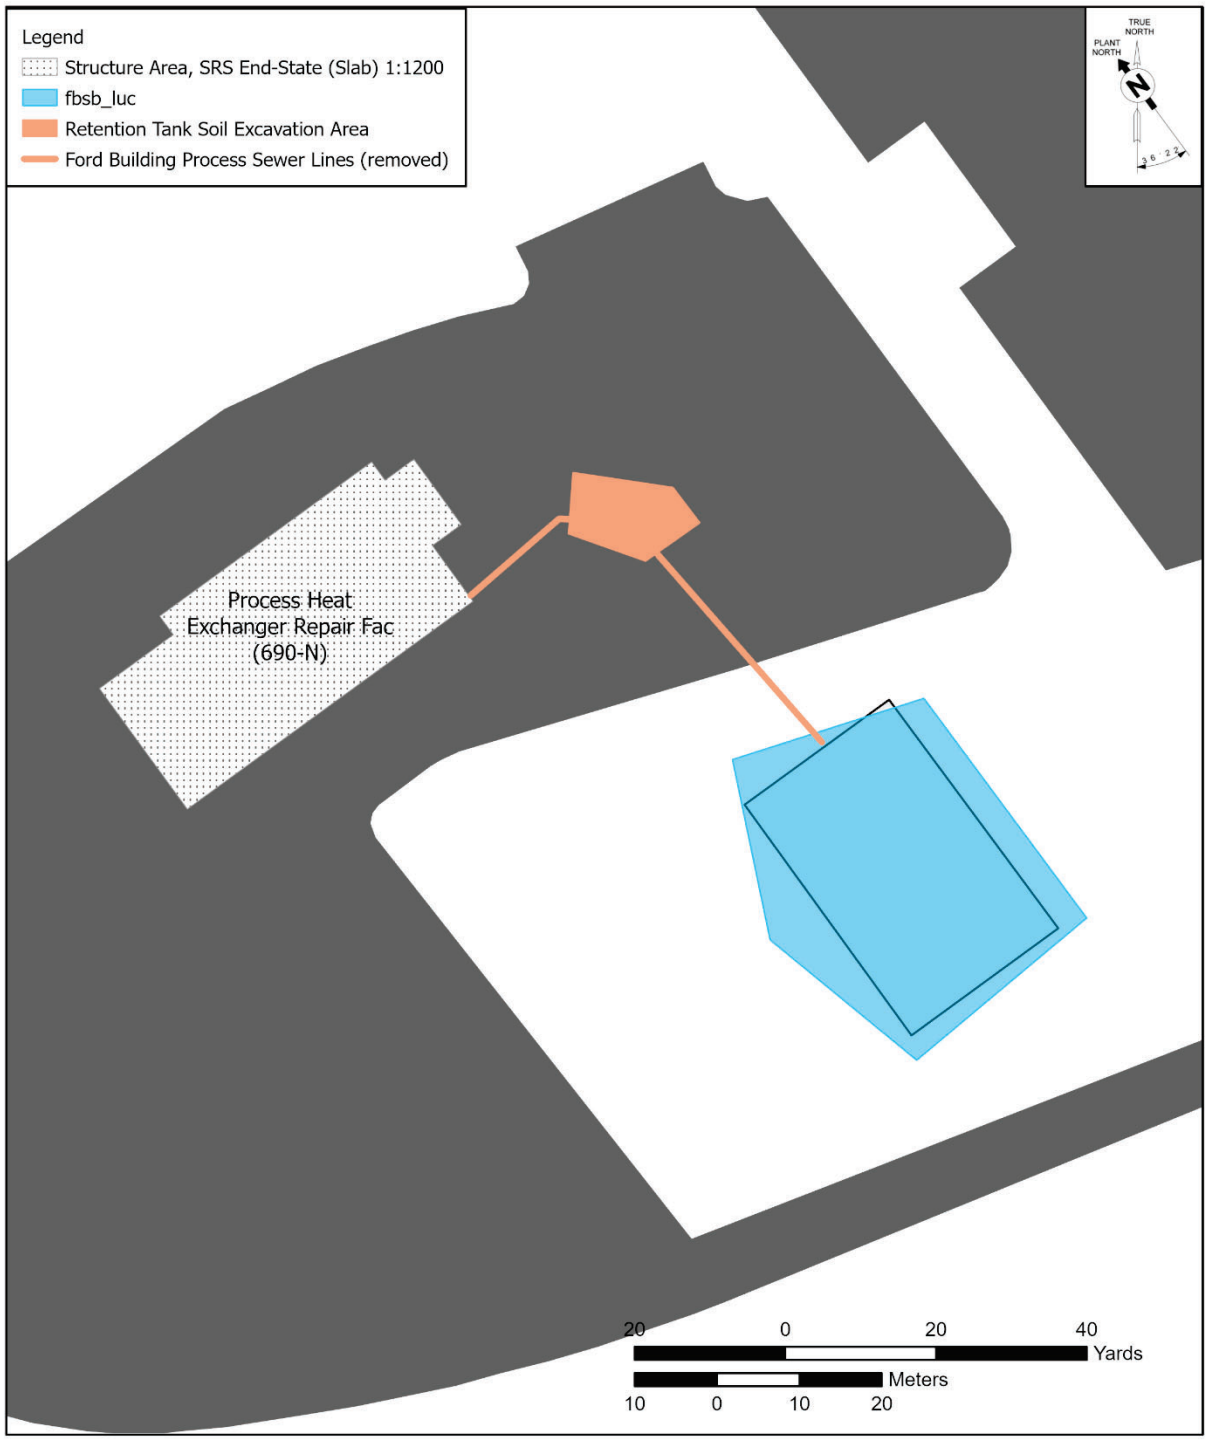


Figure F-6. FBSB OU LUC Boundary

Table F-1. Chronology of OU Events

Event	Date
RFI/RI Field Start / Complete	October 20, 1997 / April 18, 2000
Removal Action Start / Complete	January 1, 1998 / December 31, 1998
ROD issuance	April 5, 2002
Remedial Action start/complete	January 27, 2003 / April 22, 2003
Previous Five-Year Reviews Issuance	January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table F-2. RCOCs and RGs Associated with Contaminated Media at FBSB OU

Subunit	Media	RCOC	Type of RCOC	RGs	Basis
FBSB Basin	Surface Soil	Aroclor 1254	ECO	0.0219 mg/kg	Insectivorous Mammal
	Surface/ Subsurface Soil	Cesium-137	HH	0.105 ρCi/g	On-Unit Industrial Worker (External)
	Surface/ Subsurface Soil	Cobalt-60	HH	0.0224 ρCi/g	On-Unit Industrial Worker (External)
	Surface/ Subsurface Soil	Europium-154	HH	0.0473 ρCi/g	On-Unit Industrial Worker (External)
	Subsurface Soil	Arsenic	HH	3.53 mg/kg	On-Unit Industrial Worker (Ingestion)
Tank/ Process Sewer	Surface/ Subsurface Soil	Cesium-137	HH	0.105 ρCi/g	On-Unit Industrial Worker (External)
	Surface/ Subsurface Soil	Cobalt-60	HH	0.0224 ρCi/g	On-Unit Industrial Worker (External)

RCOC Refined contaminants of concern
ECO ecological
HHhuman health (industrial worker)

Table F-3. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY204	FY2025	5-Year Total
Total Actual O&M Costs ($)	16,801	7,269	8,712	9,699	16,244	58,725
Total ROD Estimated Direct O&M Costs* ($)	30,000	5,000	5,000	5,000	5,000	50,000

*Cost for preparation of the Sixth Five-Year Remedy Review were accounted for in FY2021.

Table F-4. PFOS/PFAS Screening Results for the FBSB OU

Operable Unit Name:	**FBSB**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and known uses, including a review of historical PFAS applications and categories, PFAS are not expected to be present at this operable unit.**	

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU

I. SITE INFORMATION			
Site Name:	**Ford Building Seepage Basin (904-91G) OU**	**Date of Inspection:**	**08/19/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #58**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Partly cloudy 85°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☒ Other Excavation and consolidation

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. O&M Staff: Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949

Problems/Suggestions: ☐ Report Attached

2. O&M Staff: Eric Barron (Name) | EC&ACP Post-Closure Waste Site EC&ACP Post Closure Lead (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395

Problems/Suggestions: ☐ Report Attached

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. Local Regulatory Authorities and Response Agencies (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. Other Interviews *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. O&M Documents:

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: Site inspections (semiannual through 2014; annual thereafter [USDOE 2014]) are performed per SRS procedure ER-SOP-019, *Waste Unit Inspection and Maintenance*, and ER-IDS-019-024, *Field Inspection Checklist for the FBSB OU.*

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routing O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is summarized in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons:

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☐ Gates secured ☒ N/A

Remarks: OU-specific perimeter fencing is not required by the remedial action.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Matt Baker (Name) | Acting FFA Remedial Project Manager (Title) | 10/29/2025 (Date) | 803-952-6211 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks: Survey monuments were located and in good condition.

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

VI. GENERAL SITE CONDITIONS
E. Roads ☒ Applicable ☐ N/A
1. Roads damaged: ☐ Location shown on site map ☒ Roads adequate ☐ N/A Remarks:
F. Other Site Conditions
Remarks: Inspections conducted from FY2021 through FY2025 identified active ant mounds. All issues were resolved soon after discovery.

VII. LANDFILL COVER/CONTAINMENT ☒ Applicable ☐ N/A
A. Landfill Surface
1. Settlement (Low spots)**:** ☐ Location shown on site map ☒ Settlement not evident Areal extent _____ Depth _____ Remarks:
2. Cracks: ☐ Location shown on site map ☒ Cracking not evident Lengths _____ Widths _____ Depths _____ Remarks:
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent _____ Depth _____ Remarks:
4. Holes: ☐ Location shown on site map ☒ Holes not evident Areal extent _____ Depth _____ Remarks:
5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☒ No signs of stress Areal extent 1 acre Depth _____ Remarks: One acre of grass is maintained over and around the perimeter of the cover system, which extends beyond the 0.113 hectares (0.28 acres) LUC area.

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A

Remarks:_____

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident

Areal extent_____ Depth_____

Remarks:_____

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident

☐ Wet areas	☐ Location shown on site map	Areal extent_____
☐ Ponding	☐ Location shown on site map	Areal extent_____
☐ Seeps	☐ Location shown on site map	Areal extent_____
☐ Soft subgrade	☐ Location shown on site map	Areal extent_____

Remarks:_____

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability

Areal extent_____

Remarks:_____

B. Benches ☐ Applicable ☒ N/A

(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒N/A

(Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

D. Cover Penetrations	☐ Applicable	☒ N/A
E. Gas Collection and Treatment	☐ Applicable	☒ N/A
F. Cover Drainage Layer	☐ Applicable	☒ N/A
G. Detention/Sedimentation Ponds	☐ Applicable	☒ N/A
H. Retaining Walls	☐ Applicable	☒ N/A

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

I. Perimeter Ditches/Offsite Discharge ☒ Applicable ☐ N/A

1. Siltation: ☐ Location shown on site map ☒ Siltation not evident
Areal extent_____ Depth_____
Remarks:_____

2. Vegetative Growth: ☐ Location shown on site map ☐ N/A
☒ Vegetation does not impede flow
Areal extent_____ Type_____
Remarks:_____

3. Erosion: ☐ Location shown on site map ☒ Erosion not evident
Areal extent_____ Depth_____
Remarks:_____

4. Discharge Structure: ☐ Location shown on site map ☒ N/A
Remarks:_____

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A

X. OTHER REMEDIES

If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.

A. Excavation and Consolidation ☒ Applicable ☐ N/A
Excavation and consolidation were performed at FBSB OU. The remedy is performing as designed.

Attachment F-1. Five-Year Review Site Inspection Checklist – Ford Building Seepage Basin (904-91G) OU *(continued/end)*

XI. OVERALL OBSERVATIONS

B. Implementation of the Remedy

Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.).

The selected remedy for the FBSB OU was excavation, consolidation, backfilling, common fill cover, and LUCs to protect future industrial workers and terrestrial ecological receptors from exposure. Selected remedy for the FBSB OU is functioning as intended. There are no issues requiring corrective actions.

C. Adequacy of O&M

Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy.

The O&M procedures consisting of semiannual/annual site inspections and site maintenance (repair of erosion damage, cover maintenance, and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the OU) have been implemented. The O&M procedures are adequately maintaining the FBSB OU and the condition of the warning signs is good. When maintenance activities are identified during inspections (e.g., active ant mounds), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the FBSB OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.

D. Early Indicators of Potential Remedy Failure

Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future.

N/A

E. Opportunities for Optimization

Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy.

N/A

End of Checklist

This page is intentionally left blank.

APPENDIX G. H-AREA HAZARDOUS WASTE MANAGEMENT FACILITY (904-44G, 904-45G, AND 904-56G) OPERABLE UNIT

I. INTRODUCTION

This report is the seventh five-year review for the H-Area Hazardous Waste Management Facility (904-44G, 904-45G, 904-46G, and 904-56G) (HHWMF) Operable Unit (OU). This review was conducted from July 2025 through December 2025. Contaminants have been left in place at the HHWMF OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the HHWMF OU is protective of human health and the environment. This report documents the results of the review.

The remedy for this unit is conducted under the Savannah River Site (SRS) Resource Conservation and Recovery Act (RCRA) program. The Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) remediation requirements are met by the RCRA program; therefore, a separate review of the RCRA Corrective Action is not duplicated in this document.

II. OU CHRONOLOGY

Table G-1 lists the chronology of site events for the HHWMF.

III. BACKGROUND

The HHWMF OU is listed as a RCRA Unit in Appendix C of the Federal Facility Agreement (FFA) for SRS (FFA 1993). The media associated with the HHWMF OU is soil.

The groundwater is being addressed by the H-Area Groundwater OU and will be discussed in the five-year remedy review reports for SRS OUs with operating equipment. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS.

Physical Characteristics

The HHWMF is located in the central portion of SRS, approximately 9.6 km (6 mi) from the nearest site boundary (Figure G-1). The HHWMF consists of four unlined basins, H-1 (904-44G), H-2 (904-45G), H-3 (904-46G) and H-4 (904-56G) and the associated H-Area Inactive Process Sewer Line (HIPSL) (Figure G-2).

The dimensions and volumetric capacity of the basins were as follows:

- Basin H-1 – 27 m x 72 m x 2.7 m (90 ft x 240 ft x 9 ft), 4.2 million L (1.1 million gal);
- Basin H-2 – 33 m x 138 m x 2.7 m (110 ft x 460 ft x 9 ft), 10.6 million L (2.8 million gal);
- Basin H-3 – 105 m x 144 m x 5.1 m (350 ft x 480 ft x 17 ft), 35.6 million L (9.4 million gal); and
- Basin H-4 – 39-129 m x 720 m x 2.4 m (130-430 ft x 2400 ft x 8 ft), 85.6 million L (22.6 million gal).

At the time of closure, the HHWMF (904-44G, 904-45G, and 904-56G) had a combined maximum operating capacity of 100.3 million L (26.5-million gal) of wastewater. Figure G-3 shows the basins prior to the start of closure.

The HIPSL that was used to convey wastewater to the HHWMF is outside the scope of the HHWMF Record of Decision (ROD). The HIPSL RCRA closure action was completed in conjunction with the General Separations Area Consolidated Unit OU remedial action.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates the HHWMF OU as being within an industrial area. The future land use for the HHWMF OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

The HHWMF operated from 1955 until November 1988. In 1962, Basin H-4 replaced Basin H-3. During the operating period, the HHWMF received waste effluents from H-Area chemical separation facilities such as the nitric acid recovery unit, waste storage system evaporator overheads, and general-purpose evaporator overheads.

Significant amounts of nitrate and caustic were received in the basins. Radioactive releases were greater than 99 percent tritium. A 1984 soil coring study showed that approximately 90 percent of the radionuclides and metals were concentrated within the top 0.3 m (1 ft) of basin soil (WSRC 2001).

Initial Response

Preventative actions at HHWMF OU were conducted pursuant to the requirements of RCRA per Settlement Agreement 87-27-SW.

Closure of the four basins began in 1989 and was completed in May 1991. The four basins were closed by dewatering; physically and chemically stabilizing the remaining sludge with a layer of granite, limestone, and blast furnace slag; and placing a protective multi-layer cover system over them to reduce rainwater contact with basin bottoms.

The HHWMF was certified closed in July 1991 and was accepted by the South Carolina Department of Environmental Services (SCDES) in October 1991 as being in compliance with RCRA requirements (SRNS 2022).

Basis for Taking Action

The HHWMF OU was subject to closure under South Carolina Hazardous Waste Management Regulations (SCHWMR) R.61-79-265 Interim Status Standards for Owners and Operators of Hazardous Waste Treatment, Storage, and Disposal Facilities (SRNS 2022). Per the approved 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025), post-closure care is regulated under SCHWMR R.61-79-264. In addition, an ongoing corrective action and monitoring program at the HHWMF is administered through the 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025). The monitoring program consists of monitoring for impacts to groundwater, seepline surface water, and surface water of Fourmile Branch.

Characterization efforts prior to the ROD (WSRC 1993) indicated contamination was present in basin surface water, basin soil, basin sludge and the Floridian Aquifer System soils/sediments (SRNS 2022). The constituents of concern (COCs) identified were arsenic, barium, cadmium, copper, lead, mercury, nickel, vanadium, zinc, tetrachloroethylene, gross alpha, gross beta, tritium, nitrate, carbon-14, cobalt-60, iodine-129, radium-226, radium-227, strontium-90, technetium-99, and uranium-233/234. No remedial goals were established in the ROD for soils (WSRC 1993).

IV. REMEDIAL ACTIONS

Remedy Selection

Preventative alternatives were developed for the HHWMF within the RCRA closure process in 1988. Closure of the HHWMF began in 1989 and was completed in July 1991. Preventative activities at the HHWMF became subject to CERCLA when SRS was placed on the National Priorities List in December 1989. As documented in the ROD, the RCRA closure was selected as the final action under CERCLA. Therefore, no further action under CERCLA was necessary for the HHWMF (WSRC 1993).

The remedial action objectives (RAOs) for the HHWMF OU were to prevent the physical exposure to contaminants and to mitigate further migration of contaminants to the groundwater by minimizing a liquid medium pathway (rainwater percolation) for transport. The HHWMF RCRA preventative action of stabilization and placement of all contaminated materials under a low-permeability cap satisfied both RAOs.

Post-closure requirements will be met by:

- Maintaining the integrity and effectiveness of the final cover, including making repairs to the RCRA cap as necessary to correct the effects of settling, subsidence, erosion, or other events;
- Maintaining and controlling the groundwater monitoring system and complying with all other applicable requirements;
- Taking measures to prevent run-on and runoff from eroding or otherwise damaging the final cover; and

- Repairing security control devices.

Remedy Implementation

Implementation of the selected final action remedy (i.e., the RCRA preventative action) included the following activities:

- Dewatering the basins to eliminate free liquids and to solidify the remaining waste and residues;
- Stabilizing the remaining waste using 0.9-1.8 m (3-6 ft) of granite aggregate, 0.3 m (1 ft) of limestone and blast furnace slag to provide a load bearing capacity sufficient to support the cover system; and
- Placing a 9-hectare (22.1-acre) low permeability cover system consisting of a layer of backfill, a 0.6-m (2-ft) layer of low-permeability compacted kaolin clay, a 22.5-cm (9-in) drainage layer of sand, a geotextile fabric filter, topped with 0.6 m (2 ft) of topsoil to support a vegetative cover.

Figures G-4 and G-5 provide current photographs of the HHWMF. Figure G-6 presents the HHWMF RCRA Boundary.

Systems Operations/Operation and Maintenance

There are no operational requirements for the cover system and land use controls (LUCs).

The following maintenance activities are ongoing:

- Post-closure groundwater monitoring is required as a condition of the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) to verify that no unacceptable exposure to potential hazards posed by conditions at the OU occur in the future.
- Quarterly site inspections will occur to verify the integrity of the cover system, OU-specific fencing, signs, etc. Any necessary repairs will be made as part of the maintenance program. Annual elevation surveys are conducted to monitor the long-term settlement of the cap.

- LUCs are being enforced to preclude unauthorized access or intrusive activities through the SRS Site Use/Site Clearance program and SRS site security.

Costs associated with the selected remedy for HHWMF include operation and maintenance (O&M) costs of the soil cover and LUCs. The actual O&M cost during fiscal year (FY) 2021 to FY2025 is $1,055,994. RCRA documentation does not require estimated project costs to be prepared. Therefore, a cost data comparison is not provided in this remedy review.

V. PROGRESS SINCE LAST REVIEW

This is the seventh five-year remedy review report for the HHWMF. The previous protectiveness statement from the last five-year review concluded that because the remedial actions at HHWMF are protective, the site is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are controlled through a maintained cover system and LUCs in place while USDOE controls the OU.

Per recommendation from a previous five-year review, the field inspection frequency for the HHWMF OU was changed from monthly to quarterly (Q) in 2018.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed the implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment G-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Ensured that all actions required under the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) were implemented (i.e., routine inspections, maintenance to the soil covers, groundwater monitoring).

Summary of Inspections and Interviews

Scheduled quarterly site inspections were conducted from FY2021 through FY2025 (Various). The field inspection checklists are approved as part of the closure/post-closure/permit application process and are governed by the RCRA Permit Renewal for SRS. They are available in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/). Tasks included on the field inspection checklists include:

- Verifying roads to waste unit are accessible;
- Verifying waste unit signs are in acceptable condition, have correct information, and are legible from a distance of 7.6 m (25 ft);
- Verifying fences, posts, gates, etc., are in good condition and unattended gates are locked;
- Checking for excessive vegetation growing over fences that may obstruct warning signs for visibility of the inspection area;
- Inspecting closure cover for erosion, abnormal soil cracks, depressions, or ponding indicating subsidence;
- Checking for signs of burrowing animals;
- Checking the integrity of drainage ditches inside and outside of the fence areas for excessive erosion and the presence of soil, sediment, or debris restricting water flow;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m (3 ft) by 0.9 m (3 ft). (There should be no woody vegetation or shrubs growing within the perimeter fence. The height of the vegetative cover should not impair the visual inspection of the closure. This will be determined by the Post Closure Inspector);
- Visually checking subsidence monitors for damage;
- Checking the survey benchmarks for damage and visibility;
- Checking the side slopes for signs of slumping and ditches for signs of excessive erosion;

- Verifying the annual elevation surveys of the subsidence monitors have been performed for the current year and that the results have been submitted to the Document Control Center; and
- Other.

The field inspections identified the following issues: active ant mounds, evidence of small animals burrowing under fencing, shallow rutting caused by mowing equipment, and buildup of sediment and debris on drainage channels. These findings were documented on the field inspection checklists and resolved soon after discovery.

The HHWMF OU was inspected by SRNS Environmental Compliance and Area Completion Projects (EC&ACP) on September 2, 2025 and included taking current photographs of the HHWMF OU and reviewing the field inspection checklist. No issues were identified during this inspection. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the HHWMF during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the HHWMF OU that would affect the protectiveness of the remedy.

The HHWMF OU was inspected by SRNS EC&ACP and USDOE personnel on October 29, 2025. No issues were identified for the HHWMF during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, USEPA and SCDES personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of HHWMF OU and were provided an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspections.

The HHWMF OU was inspected by SCDES on September 4, 2025, as part of the RCRA annual comprehensive groundwater monitoring evaluation. Overall, the basins were observed to be in good condition. There was a small amount of erosion observed on the edge of the H-Area Basin 4 cover along the northwest curve and in the vicinity opposite of monitoring well HSB 119D. On September 16, 2025, and September 23, 2025, SRS personnel conducted a visual inspection of the entire HHWMF OU cover system with emphasis on the areas noted during SCDES' inspection. SRS personnel also reviewed all design and as-built drawings of the closed HHWMF OU. The results of the evaluation, including recommendations, were documented in the HHWMF OU Perimeter Erosion Observation that was submitted to SCDES on October 24, 2025 (SRNS 2025). The cover system drainage is performing as designed and no repairs to the exposed drainage layer were required.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, in situ stabilization/solidification, RCRA soil cover with LUCs is effective in preventing exposure to contaminant risk above 1E-06 risk levels and mitigating further migration of contaminants to groundwater and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Quarterly site inspections and site maintenance have been effective in maintaining integrity of the soil cover. Based on the site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The LUC requirements are discussed and approved as part of the closure/post-closure/ permit application process and are governed by the RCRA Permit Renewal for the SRS (SCDES 2025). The closure/post-closure requirements are discussed in the RCRA Permit Renewal Application for the H-Area Hazardous Waste Management Facility (H-Area HWMF) Postclosure (SRNS 2022). Therefore, a Land Use Control Implementation Plan is not required for this OU. The LUCs (i.e., RCRA closure/post-closure care requirements) that are in place include physical access controls to prevent unauthorized contact (i.e., OU-specific fencing with locked gates and warning signs posted on the fences), removal or excavation of subsurface soils, and restrictions to prevent

disturbance of the HHWMF OU. Warning signs are in good condition, and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

Are the Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still Valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of final remedy selection are still valid. There have been no changes in the standards or physical conditions of the HHWMF OU that would affect the protectiveness of the remedy.

As the remedial work has been completed, the applicable standards set forth in the ROD (WSRC 1993) and RCRA closure plan (WSRC 2000) associated with soils and basin sediments have been met. Groundwater is being addressed by the H-Area Groundwater OU and will be discussed in the five-year remedy review reports for SRS OUs with operating equipment.

The USEPA standards and toxicity values have been updated since submittal of five-year remedy review as shown in Appendix B. The changes to the values for COCs at the HHWMF OU included some decreases in the RSLs due to updated input values used to calculate the RSLs. The residential soil screening level for lead decreased from 400 mg/kg to 200 mg/kg. If other sources of lead are present, the screening level is 100 mg/kg. However, these changes do not affect the protectiveness of the remedy and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants, except for

PFOS and other PFAS, were identified as applicable to this OU based on the OU history of contamination.

Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this waste unit (Table G-3). However, the engineered cover system in place serves as an effective and protective remedy, mitigating potential exposures and releases associated with PFAS.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that currently prevent the remedy from being protective.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations for follow-up actions for the HHWMF OU under CERCLA.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the HHWMF OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by stabilization and placement of all contaminated materials under a low-permeability cap and LUCs to prevent exposure to or ingestion of contaminated soil media and mitigating further migration of contaminants to groundwater. All threats to the HHWMF OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the HHWMF OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2025. *South Carolina Hazardous and Mixed Waste Permit, Permit Number SC1 890 008 989, 2025 RCRA Permit Renewal for the Savannah River Site, issued on October 27, 2025, Module III – Postclosure Care and Module IV - Groundwater Requirements, Section C, H-Area Hazardous Waste Management Facility*, South Carolina Department of Environmental Services, Division of Waste Management, Bureau of Land and Waste Management, Columbia, SC

SRNS, 2022. *2013 RCRA Part B Permit Renewal Application - H-Area Hazardous Waste Management Facility (H-Area HWMF) Postclosure*, SRNS-IM-2012-00002, Volume V, Revision 3, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2025. *Submittal of the H-Area Hazardous Waste Management Facility Erosion Evaluation and Recommendation*, SRNS-J2000-2025-00750, dated October 24, 2025, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1993. *Final Record of Decision Remedial Alternative Selection for H-Area Hazardous Waste Management Facility (U)*, WSRC-RP-93-1043, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

WSRC, 2000. *H-Area HWMF Closure Plan (U)*, WSRC-RP-98-4024, Revision 0, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2001. *H-Area Corrective Action Phase 1 Evaluation,* WSRC-RP-2001-4015, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

Various - *Post-Closure Inspection H-Area Hazardous Waste Management Facilities 904-45G, 904-46G, 904-56G*, ER-IDS-019-021, Inspection period FY2021 through FY2025 (quarterly)

This page is intentionally left blank.

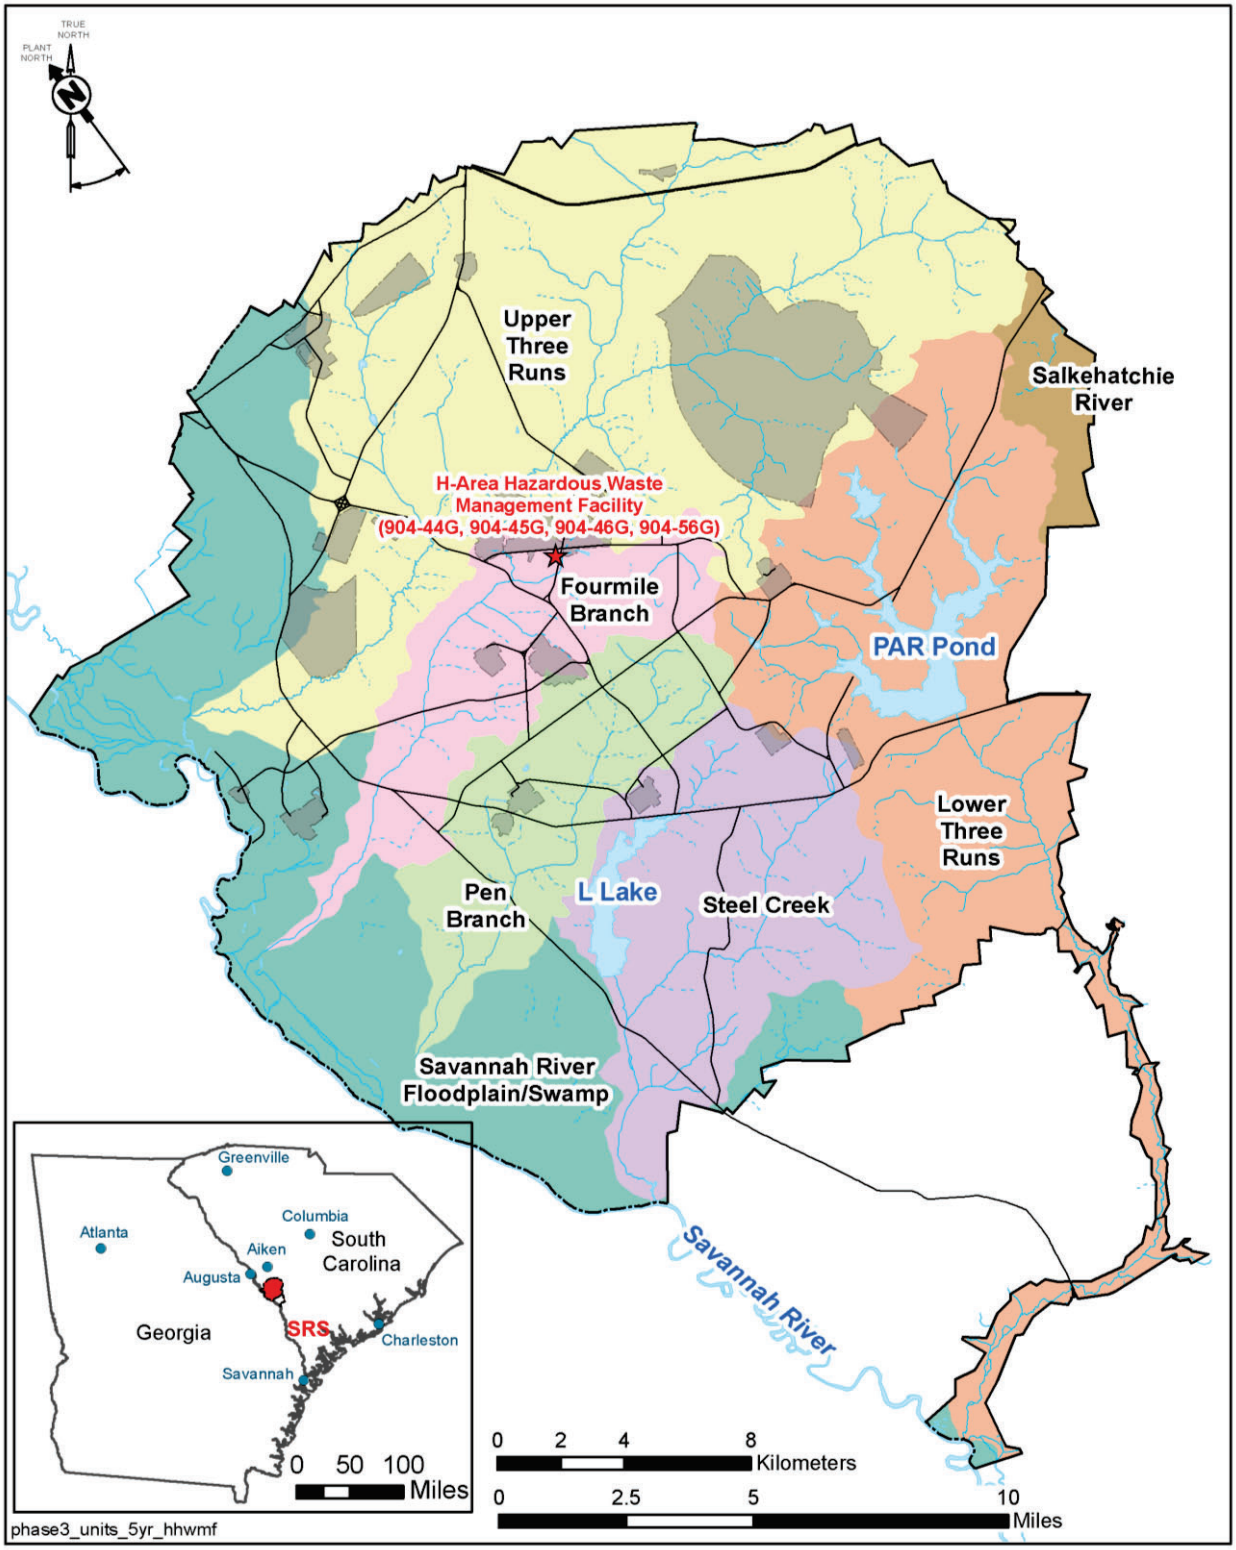


Figure G-1. Location of the HHWMF OU at SRS

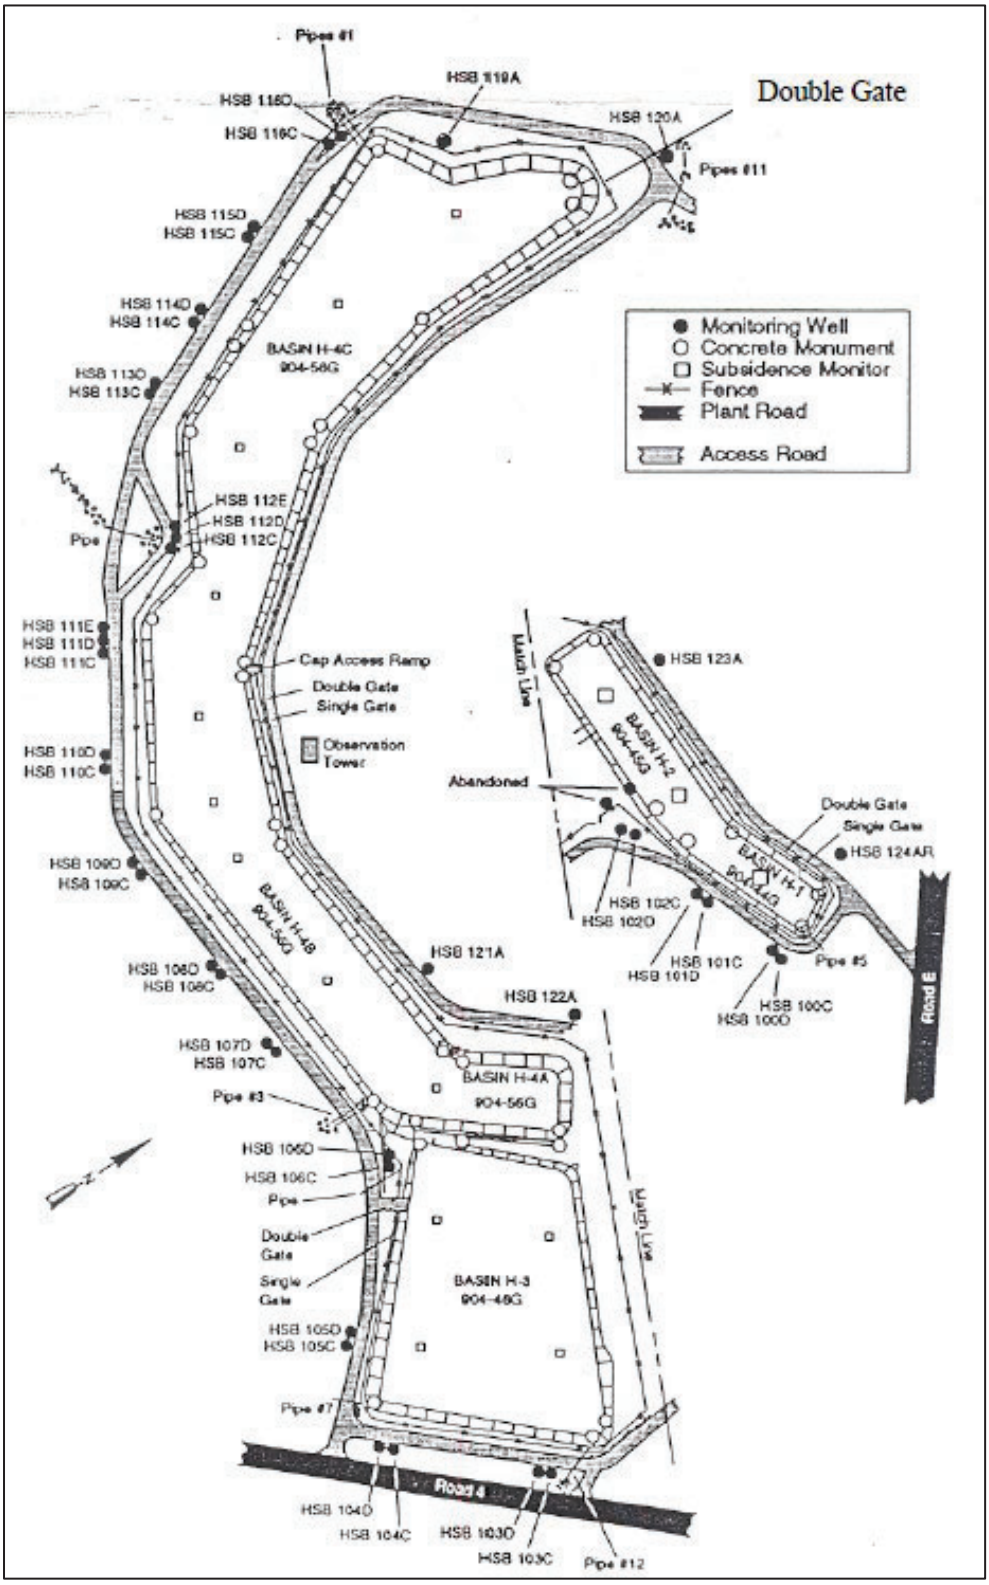


Figure G-2. Site Layout for HHWMF OU



Figure G-3. HHWMF OU Basins Prior to Closure (1989)



Figure G-4. Current On-Unit Photographs of the Cover System of the H-Area HWMF OU (2025)



Figure G-5. Current Aerial Photograph of the Cover System of the H-Area HWMF OU

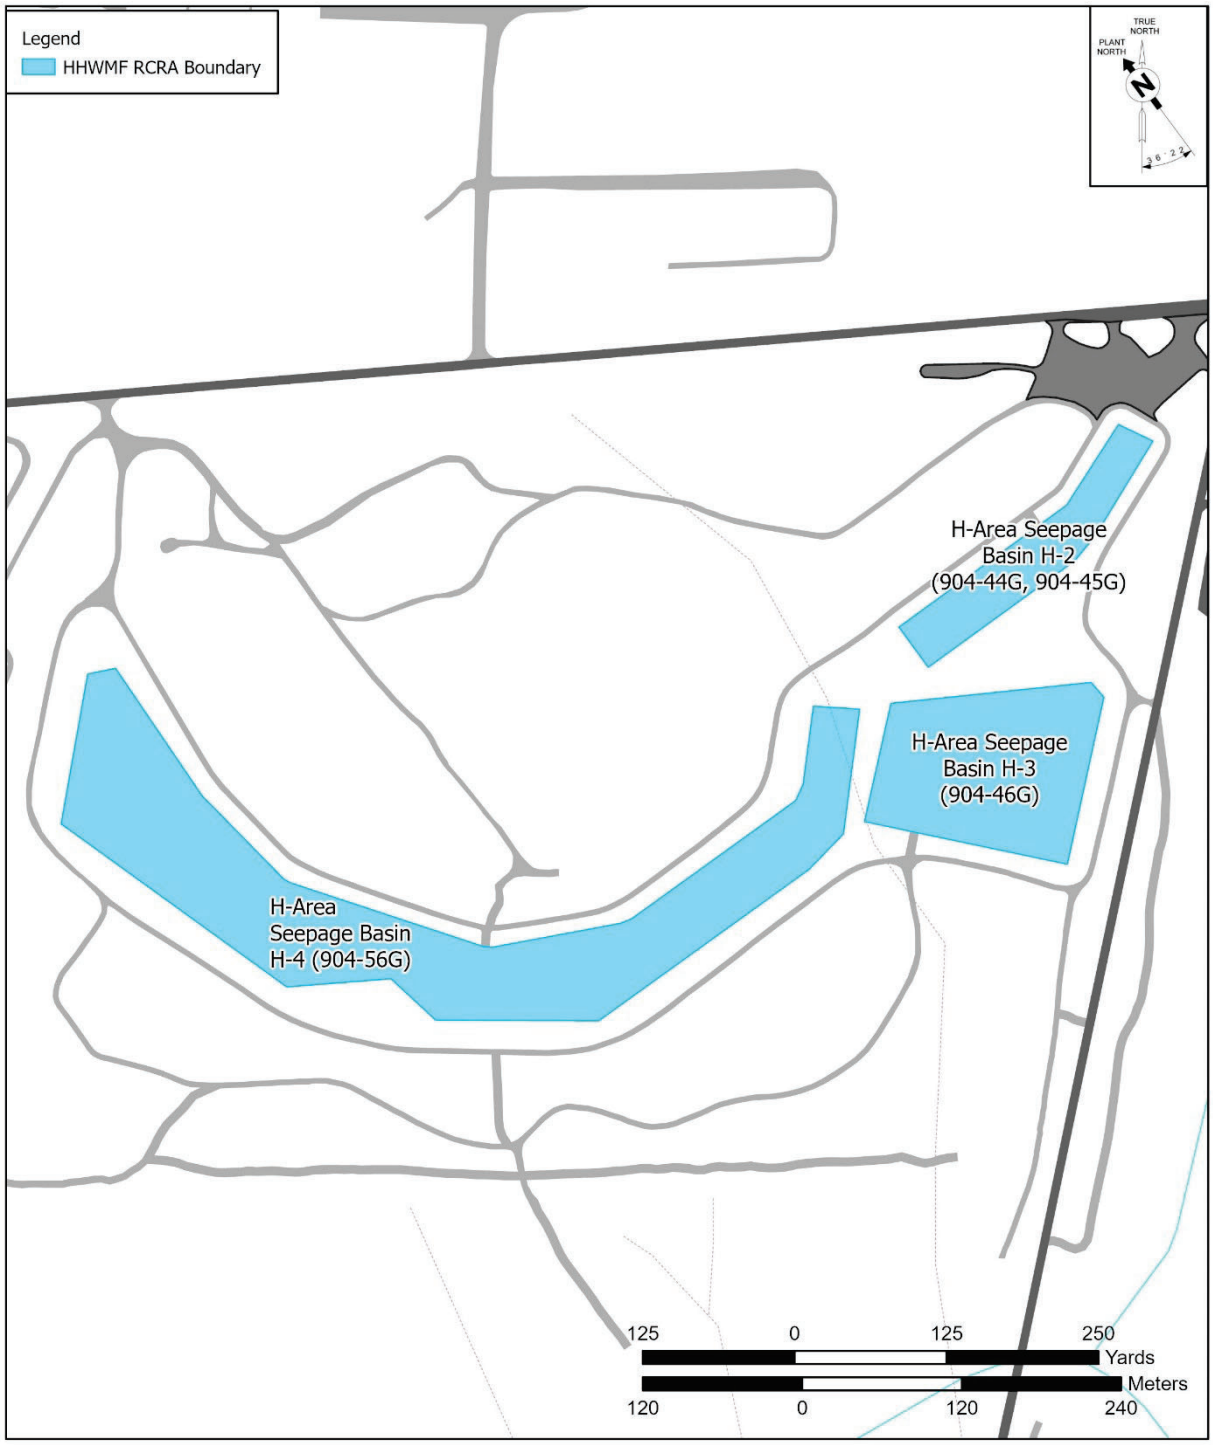


Figure G-6. HHWMF RCRA Boundary

Table G-1. Chronology of OU Events

Event	Date
RCRA Closure Plan Approved	1989
Corrective Action Start	1989
RCRA Closure Certified	October 1, 1991
Final ROD Issuance	September 10, 1993
Previous Five-Year Reviews Issuance	August 27, 1997 / February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table G-2. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	Five-Year Total
Total Actual O&M Costs ($)	113,508	194,374	210,241	233,653	304,217	1,055,994
Total ROD Estimated Direct O&M Costs ($)	N/A	N/A	N/A	N/A	N/A	0

RCRA documentation does not require estimated project costs to be prepared.
N/A = not applicable

Table G-3. PFOS/PFAS Screening Results for the HHWMF OU

Operable Unit Name:	**HHWMF**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	**Yes**	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this operable unit.**	

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU

1. SITE INFORMATION			
Site Name:	**H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU**	**Date of Inspection:**	**9/2/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #7**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Sunny 80°F,**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☒ Other Stabilization
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers

Attachments: ☐ Inspection team roster attached

2. INTERVIEWS *(Click all that apply)*

1. **O&M Staff:** Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949
   Problems/Suggestions: ☐ Report Attached

2. **O&M Staff:** Eric Barron (Name) | EC&ACP Post-Closure Waste Site Inspector/Maintenance Coord. (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395
   Problems/Suggestions: ☐ Report Attached

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

II. INTERVIEWS ***(Click all that apply)(Continued)***

3. **Local Regulatory Authorities and Response Agencies** (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

_____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

_____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

_____

4. **Other Interviews** *(Optional):* ☐ Report Attached _____

_____

_____

_____

3. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. **O&M Documents:**

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019; Post-Closure Inspection H-Area Hazardous Waste Management Facilities 904-45G, 904-46G, 904-56G (U),* ER-IDS-019-021 (2021 through 2025).

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☒ Other Permits	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: RCRA Hazardous and Mixed Waste Permit Renewal

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

7. Groundwater Monitoring Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

IV. O&M COSTS

1 O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2 O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☐ Other: Project cost data is discussed in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached

3 Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons:

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A Fencing

1. Fencing Damage: ☐ Location shown on site map ☒ Gates secured ☐ N/A

Remarks: OU-specific perimeter fencing is required by the remedial action. Perimeter fencing is in good condition.

B Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Matt Baker (Name) | Acting FFA Remedial Project Manager (Title) | 10/29/2025 (Date) | 803-952-6211 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks:

D General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

VI. GENERAL SITE CONDITIONS
A. Roads ☒ Applicable ☐ N/A
1. Roads damaged: ☐ Location shown on site map ☒ Roads adequate ☐ N/A Remarks:
B. Other Site Conditions
Remarks: Inspections conducted from FY2021 through FY2025 identified active ant mounds, evidence of small animals burrowing under fencing, shallow rutting caused by mowing equipment, and buildup of sediment and debris on drainage channels. These findings were resolved soon after discovery.
VII. LANDFILL COVER/CONTAINMENT ☒ Applicable ☐ N/A
A. Landfill Surface
1. Settlement (Low spots)**:** ☐ Location shown on site map ☒ Settlement not evident Areal extent Depth Remarks:
2. Cracks: ☐ Location shown on site map ☒ Cracking not evident Lengths Widths Depths Remarks:
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent Depth Remarks:
4. Holes: ☐ Location shown on site map ☒ Holes not evident Areal extent Depth Remarks:
5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☐ No signs of stress Areal extent Depth Remarks:

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A

Remarks:_____

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident

Areal extent_____ Depth_____

Remarks:_____

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident

☐ Wet areas	☐ Location shown on site map	Areal extent_____
☐ Ponding	☐ Location shown on site map	Areal extent_____
☐ Seeps	☐ Location shown on site map	Areal extent_____
☐ Soft subgrade	☐ Location shown on site map	Areal extent_____

Remarks:_____

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability

Areal extent_____

Remarks:_____

B. Benches ☐ Applicable ☒ N/A

(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A

(Channel lined with erosion control mates, riprap, grout bags, or gabions that descends down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

D. Cover Penetrations ☒ Applicable ☐ N/A

1. Gas Vents: ☐ Active ☐ Passive
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

2. Gas Monitoring Probes:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

3. Monitoring Wells:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

4. Leachate Extraction Wells:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

5. Settlement Monuments: ☒ Located ☒ Routinely Surveyed ☐ N/A
Remarks:

E. Gas Collection and Treatment ☐ Applicable ☒ N/A

F. Cover Drainage Layer ☒ Applicable ☐ N/A

1. Outlet Pipes Inspected: ☐ Functioning ☒ N/A
Remarks:

2. Outlet Rock Inspected: ☒ Functioning ☐ N/A
Remarks:

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

G. Detention/Sedimentation Ponds ☐ Applicable ☒ N/A

H. Retaining Walls ☐ Applicable ☒ N/A

I. Perimeter Ditches/Offsite Discharge ☒ Applicable ☐ N/A

1. Siltation: ☐ Location shown on site map ☒ Siltation not evident
Areal extent_____ Depth_____
Remarks:_____

2. Vegetative Growth: ☐ Location shown on site map ☒ N/A
☐ Vegetation does not impede flow
Areal extent_____ Type_____
Remarks:_____

3. Erosion: ☐ Location shown on site map ☒ Erosion not evident
Areal extent_____ Depth_____
Remarks:_____

4. Discharge Structure: ☐ Location shown on site map ☐ N/A
Remarks: The drainage ditches at Basin H4 (904-56G) have been relined with concrete.

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A

X. OTHER REMEDIES

If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.

A. Stabilization ☒ Applicable ☐ N/A
Stabilization was performed at HHWMF OU. The remedy is performing as designed.

Attachment G-1. Five-Year Review Site Inspection Checklist – H-Area HWMF (904-44G, 904-45G, 904-46G, and 904-56G OU *(continued/end)*

XI. OVERALL OBSERVATIONS

A. Implementation of the Remedy

Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.).

Closure of the four basins (904-44G, 904-45G, 904-46G, and 904-56G) by dewatering, physically and chemically stabilizing the remaining waste, and placement of a low permeability cap has met the remedial objectives of preventing physical exposure to contaminants and mitigating further migration of contaminants to the groundwater. Selected remedy for the HHWMF OU is functioning as intended. There are no issues requiring corrective actions for the cover system and LUCs.

B. Adequacy of O&M

Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy.

The O&M procedures consisting of site inspections and site maintenance (repair of erosion damage, cover system, fencing and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the waste unit) have been implemented. The O&M procedures are adequately maintaining the HHWMF OU and the condition of the warning signs is good. When maintenance activities are identified during inspections (e.g., treating ant mounds, filling holes burrowed under fencing, filling mowing ruts, and clearing drainage channels), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the HHWMF OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.

C. Early Indicators of Potential Remedy Failure

Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future.

N/A

D. Opportunities for Optimization

Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy.

N/A

End of Checklist

APPENDIX H. K-AREA BURNING/RUBBLE PIT (131-K) AND K-AREA RUBBLE PILE (631-20G) OPERABLE UNIT

I. INTRODUCTION

This report is the sixth five-year review for the K-Area Burning/Rubble Pit (131-K) (KBRP)/K-Area Rubble Pile (631-20G) (KRP) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants and waste have been left in place at the KBRP/KRP OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the KBRP/KRP OU is protective of human health and the environment. This report documents the results of the review.

II. OU CHRONOLOGY

Table H-1 lists the chronology of site events for the KBRP/KRP OU.

III. BACKGROUND

The KBRP/KRP OU is a Resource Conservation Recovery Act (RCRA)/Comprehensive Environmental Response, Compensation, and Liability Act unit in Appendix C of the Federal Facility Agreement (FFA) for Savannah River Site (SRS) (FFA 1993). The KBRP/KRP OU consists of two soil waste units and groundwater beneath the OU.

Physical Characteristics

The KBRP/KRP OU is located approximately 9.4 km (5.9 mi) east of the nearest site boundary and 0.6 km (0.4 mi) east of the K-Reactor Area (Figure H-1). Figure H-2 shows the site layout of the KBRP/KRP OU. The KBRP was constructed from 1955 to 1956 as a shallow, unlined excavation measuring approximately 9 m (30 ft) wide, 72 m (240 ft) long, and approximately 2.4 m (8 ft) deep for waste burning and burial.

The KRP, constructed sometime between 1956 and 1961, consists of a general disposal area, semicircular in shape, measuring approximately 90 m (300 ft) long and 15 to 40.5 m

(50 to 135 ft) wide. Individual rubble piles within the area were 1.2 to 1.8 m (4 to 6 ft) high. Total estimated waste volume is 2,142 m^3 (2,800 yd^3).

The aquifer of concern at KBRP/KRP is the Upper Three Runs Aquifer Unit (UTRAU). The UTRAU is locally divided into informal, yet distinct, "lower' and "upper" aquifer zones separated by the "tan clay" semi-confining zone. Depth to groundwater at the unit is approximately 9 m (30 ft) below ground surface. In the Upper Aquifer Zone (UAZ) of the UTRAU, groundwater flow is towards the southwest (Figure H-2). The four wells screened in the lower aquifer zone (LAZ) of the UTRAU are currently suspended, and no water elevations were collected. Table H-2 provides the most recent water table elevations.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999a) designates KBRP/KRP OU as being within an industrial area. The future land use for KBRP/KRP OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

KBRP was constructed for the disposal of combustible wastes. During operation, organic liquids of unknown use and origin, waste oils, paper, plastics, and rubber were disposed of in the pit and burned periodically. Disposal records, including composition, origin, and use of materials disposed, were not kept for this unit during its period of operation. The use of the KBRP for disposal of combustible wastes was discontinued in 1973. Only inert rubble was placed in the pit until it was backfilled with soil to grade level in 1981. The primary contaminants detected in soil were polyaromatic hydrocarbons (PAHs) formed by incomplete burning of organic materials.

The KRP was constructed as a general disposal area. KRP is composed primarily of soil matter, with some broken asphalt, broken concrete pieces, and gravel-sized coal. The coal and asphalt exist in a wide range of particle sizes and are dispersed in a highly heterogeneous manner throughout the individual rubble piles. Disposal records were not

kept for this unit during its period of operation. The primary contaminants detected in soil at the KRP were PAHs and metals.

A volatile organic carbon (VOC) groundwater plume originated beneath the KBRP/KRP OU and migrated southwestwardly from the KBRP/KRP OU. Tetrachloroethylene (PCE) and trichloroethylene (TCE) exceeded maximum contaminant levels (MCLs); however, the VOC plume is not located near a surface water discharge. No source material was identified in the KBRP/KRP OU soils. There are no contaminant migration constituents of concern (CMCOCs) for the KBRP/KRP OU soils that pose a risk to groundwater.

Figure H-3 presents a photograph of KBRP.KRP OU before remediation and Figures H-4 and H-5 present photographs of KBRP/KRP OU in the current condition.

Initial Response

The KBRP was backfilled with soil to grade level in 1981 when the disposal capacity was reached.

Basis for Taking Action

The potential exposure to or ingestion of contaminated soil and groundwater poses a potential increased risk of cancer to human receptors and is the basis for taking action at the KBRP/KRP OU.

The RCRA Facility Investigation (RFI) / Remedial Investigation (RI) collected soil samples within the KBRP and from soil within the KRP individual rubble piles and native soils beneath the piles (WSRC 1998). During unit screening, ground penetrating radar surveys were performed to define the pit and pile boundaries to locate any buried objects in order to avoid drilling into buried material. No restriction to drilling was encountered.

Final human health constituents of concern (COCs) were identified for the KBRP/KRP OU based on the results of the baseline risk assessment. PAHs are the predominant COCs in both KBRP and KRP soil. Arsenic was also identified as a COC for the KRP.

Groundwater immediately downgradient of KBRP was found to have PCE and TCE concentrations above MCLs. Groundwater and soil data indicate that the KBRP is no

longer a source for groundwater contamination. This is based on the historical trends of analytical data in the adjacent monitoring wells and the results of the soil investigation. No CMCOCs were identified for the surface units. The soil and groundwater COCs are listed in Table H-3.

IV. REMEDIAL ACTIONS

Remedy Selection

As stated in the Record of Decision (ROD) (WSRC 2000), the remedial action objectives (RAOs) for the unit are as follows:

- Protect future industrial workers from unacceptable exposures to PAHs in soil at the KBRP/KRP OU and arsenic in soil at the KRP;
- Protect future industrial workers from unacceptable exposures to PCE and TCE in groundwater; and
- Prevent further degradation of groundwater and return it to levels below MCL to allow beneficial uses.

As stated in the ROD, the selected remedial actions for the unit are as follows:

- Soil cover over the KBRP/KRP OU;
- Institutional controls (i.e., land use controls [LUCs]); and
- Monitored natural attenuation (MNA) for the water table aquifer groundwater.

Because the source of groundwater contamination is depleted and no CMCOCs were identified in the surface units, no source control actions were required for the unit. The following LUC objectives are necessary to ensure protectiveness of the remedy:

- Prevent contact, removal, or excavation of buried waste in the OU areas designated in the Land Use Control Implementation Plan (LUCIP) and preclude future residential or agricultural use of the area; and
- Prevent unauthorized access to groundwater.

Remedy Implementation

The implementation of the selected remedy included the following activities:

- Consolidated 7,650 m^3 (10,000 yd^3) of contaminated soil (KRP soil from individual rubble piles), which was outside the planned cover area, into the KBRP. The soil removal area was expanded to include other rubble piles composed of gravel-size coal, rocks, and dirt that were discovered near the soil removal area. Confirmatory sampling verified no COCs remained in the soil removal area (WSRC 2002).

- Installed a 0.6 m (2-ft) thick minimum common fill soil cover over KBRP/KRP OU per South Carolina Regulation 61-107, 11, Part IV, Subtitle G using conventional and commercially available earth-moving equipment. The soil cover system covers 0.3 hectares (0.8 acres) per the Post Construction Report (PCR) (WSRC 2002).

- Implemented LUCs for 0.47 hectares (1.15 acres) (Figure H-6) and posted warning signs at the perimeter of KBRP/KRP OU (WSRC 2002). Existing SRS access controls will be used to maintain the use of this site for industrial use only. Institutional controls (i.e., administrative measures) and use restrictions for on-site workers via the Site Use/Site Clearance Program. Other administrative controls to ensure worker safety include work controls, worker training, and worker briefings of health and safety requirements.

- Installed groundwater monitoring wells and established a long-term groundwater monitoring program for MNA to ensure maximum groundwater mixing zone (GMZ) concentration limits are not exceeded per the groundwater mixing zone application (GMZA) (WSRC 1999b). The following changes listed below have been made to the monitoring network and sampling since the development of the GMZA. Changes have been documented within the various annual groundwater reports.

- Additional cone penetrometer technology data collected in 2002 indicated that the compliance boundary well KRP 7 would likely exceed the MCLs for PCE and TCE and was not suitable as a compliance boundary well. The KRP cluster (KRP 14D and

KRP 14C) was proposed and accepted as new compliance boundary wells installed further downgradient of KRP 7 (WSRC 2002).

- Later in 2002, PCE and TCE exceeded MCLs in one well (KRP 14D), a compliance boundary well. Since the number of exceedances was small; the USDOE, U.S. Environmental Protection Agency (USEPA), and South Carolina Department of Environmental Services (SCDES) directed SRS to do a moderate corrective action plan. The plan included continued quarterly sampling in the GMZ network and the installation of the KRP 15 well cluster (WSRC 2003).

- In 2004, it was again reported that well KRP 14D exceeded the MCL for TCE. The USDOE, USEPA, and SCDES agreed that it would not be feasible to pursue the contamination beyond KRP 14 because the plume was migrating toward the congested subsurface of the K-Reactor facility and could merge with the additional uncharacterized plumes associated with K Area. Per USEPA, SCDES and USDOE agreement, the KRP 14 cluster (KRP 14D and KRP 14C) was removed from the monitoring network. It was further agreed that the GMZA would not be modified, no additional modeling was needed, and no additional monitoring wells needed to be installed. Well KRP 7 was designated as the new compliance boundary well (WSRC 2005).

- In 2006, the USEPA, SCDES and USDOE agreed to reduce the sampling frequency from quarterly to semiannual due to steady or declining concentration trends, and compliance boundary wells being considerably below MCLs. USEPA, SCDES, and USDOE also approved the reduction of the analytical list from all of the Method 8260 analytes to only PCE, TCE, and their daughter products (vinyl chloride, 1,1-dichloroethene, cis-1,2-dichloroethene, and trans-1,2-dichloroethene) (WSRC 2007).

- In 2012, the USEPA, SCDES, and USDOE agreed to reduce the sampling frequency at KBRP/KRP OU from semiannually to annually due to steady or declining concentration trends and compliance boundary wells being considerably below MCLs. Sampling of the four Lower Aquifer Zone (LAZ) wells and three Transmissive Zone

(TZ) wells was also suspended due to contamination remaining in one or two upper aquifer zone (UAZ) wells. It was also agreed that water levels will continue to be collected from the three suspended TZ wells to provide data for mapping the potentiometric surface of the TZ. Sampling of water levels in the LAZ wells will remain suspended (SRNS 2012).

- In 2021, with agreement from USEPA and SCDES on a comment response on the 2020 Combined Groundwater Monitoring Report (Sampling Summary), the project team initiated an increase in sampling frequency at well KRP 9, based on PCE and TCE exceeding the MCLs in 2018 (SRNS 2020). Sampling frequency at well KRP 9 was increased from annually to semiannually starting in the second quarter of 2021, to facilitate the team's understanding of the need for continued monitoring at this unit.

System Operations/Operation and Maintenance

There are no operational requirements.

The following maintenance activities are ongoing:

- Annual site inspections and site maintenance (repair of erosion damage, cover maintenance, and warning signs);
- Site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the waste unit); and
- Sampling of the GMZA monitoring wells. The MNA monitoring program verifies the natural decrease of contaminant concentrations in the groundwater to levels below MCLs for PCE and TCE. Sampling will continue until MCLs have been attained, the MNA has achieved its RAOs, and the remedial action is complete. The results were reported via annual effectiveness monitoring reports since 2003. Starting in 2008, the monitoring results for KBRP/KRP OU were combined with the L-Area Burning Rubble Pit (131-L) (LBRP) OU and P-Area Burning/Rubble Pit (131-P) (PBRP) OU monitoring reports into a single abbreviated annual groundwater data summary, with full detailed reports every five years (USDOE 2008). For KBRP/KRP OU, the MNA remedy was expected to reduce groundwater concentrations to below MCLs by 2005

due to the processes of advection and dispersion (WSRC 1999c). However, contaminant concentrations did not decrease below MCLs until 2016 and have since fluctuated above and below the MCL at one well (KRP 9). Groundwater monitoring is still ongoing at KBRP/KRP OU to ensure concentrations remain below the MCLs.

Table H-4 compares the actual operation and maintenance (O&M) costs for the five-year remedy review period to the estimated direct O&M costs from the ROD (WSRC 2000). The estimated O&M cost for fiscal year (FY) 2021 to FY2025 was $27,812 for inspections, maintenance, GMZA monitoring, and LUCs. The actual O&M cost for FY2021 until FY2025 is $187,695. The actual O&M costs are higher than expected because groundwater monitoring and reporting have continued longer than expected.

V. PROGRESS SINCE LAST REVIEW

This is the sixth five-year remedy review for the KBRP/KRP OU. The previous protectiveness statement concluded that the remedy of a soil cover over the KBRP/KRP OU with LUCs and MNA with GMZ for the groundwater at the KBRP/KRP OU is protective of human health and the environment. Since the last five-year remedy review for the KBRP/KRP OU, groundwater contaminants continue to remain below their respective MCLs except in one well, KRP 9. PCE concentrations in well KRP 9 increased above the MCL in 2023, however concentrations diminished below the MCL again in 2024 (Figure H-7). In 2024, concentrations in all wells were below their respective MCLs (SRNS 2025). Groundwater monitoring remains in place until it is agreed that the RGs have been met, and that groundwater is no longer a threat to human health and the environment. The soil cover with LUCs also remains in place. The current remedy is functioning as intended.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Reviewed the groundwater monitoring data (Table H-5);

- Confirmed implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment H-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Reviewed changes in standards and to-be-considered guidance.

Data Review

Annual groundwater reports or data summaries have been submitted for the KBRP/KRP OU since 2003 and were thoroughly reviewed for this Five-Year Remedy Review. An agreement with the USEPA, SCDES, and USDOE was reached in 2008 to combine the reports for KBRP/KRP OU, LBRP OU, and PBRP OU into an annual groundwater monitoring data summary letter with a detailed groundwater report every fifth year beginning June 30, 2012 (USDOE 2008). LBRP OU was removed from the reports starting in 2018 due to achieving its RGs (SCDES 2018, USEPA 2018). The last detailed report was submitted in June 2022 (SRNS 2022). The report included time-series plots of PCE and TCE at each station, a plume map, and a comprehensive review of the monitoring activities and monitoring results from 2021. Contaminant concentrations in all KBRP/KRP OU wells were observed below MCLs as discussed in the last detailed report. Data summary letters submitted since the last five-year remedy review (SRNS 2023, SRNS 2024, SRNS 2025) show that concentrations continue to remain below the MCLs in all wells except for a small increase in PCE at one well, KRP 9, in 2023 (Figure H-7). PCE concentrations in well KRP 9 were below MCLs in 2024.

Summary of Inspections and Interviews

Scheduled annual inspections were conducted from FY2021 through FY2025 (Various). Tasks included on the field inspection checklists (WSRC 2002) are as follows:

- Verifying roads to waste units are accessible;
- Verifying that the waste unit signs (4) are in acceptable condition, have correct information, and are legible from a distance of 7.6 m (25 ft);

- Verifying that there is no excavating, digging, or construction activity on the soil cover;
- Checking the integrity of drainage ditches for presence of excessive erosion, sediment buildup, and any debris restricting water flow;
- Verifying that no woody vegetation is growing on the soil cover, and remove or identify as needed;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m by 0.9 m (3 ft by 3 ft) in area (The heigh of the vegetation should not impair the visual inspection of the soil cover. This will be determined by the Inspector.);
- Checking the soil cover for signs of erosion or depressions (subsidence);
- Checking for signs of burrowing animals; and
- Other.

The field inspections identified the following issues: active ant mounds. These findings were documented on the field inspection checklists and resolved soon after discovery.

The KBRP/KRP OU was inspected by Savannah River Nuclear Solutions, LLC (SRNS) Environmental Compliance and Area Completion Projects (EC&ACP) on August 19, 2025 and included taking current photographs of the KBRP/KRP OU and reviewing the field inspection checklist. During this inspection, overgrown vegetation and one missing monument cap were identified. Repairs were promptly scheduled and performed. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the KBRP/KRP OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the KBRP/KRP OU that would affect the protectiveness of the remedy.

The KBRP/KRP OU was inspected by SRNS EC&ACP and USDOE personnel on October 30, 2025. No issues were identified for the KBRP/KRP OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, USEPA and SCDES personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of KBRP/KRP OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The soil cover, groundwater mixing zone, and LUC remedy, is effective in preventing exposure to contaminants above 1E-06 risk level and is functioning as intended as demonstrated below:

- The soil cover continues to protect present and future industrial workers from unacceptable exposures to PAHs in soil at the KBRP/KRP OU, and arsenic in soil at the KRP;
- LUCs are continuing to prevent human exposure to contaminated soils and groundwater; and
- The MNA program and monitoring well network provides sufficient data to assess the progress of natural attenuation within the groundwater. MNA is preventing further degradation of groundwater and has returned it to levels below MCLs as of 2024. Core plume contaminant levels (PCE and TCE), as seen in well KRP 9, have remained below or just above the respective MCLs over the last several years, (Figures H-7 and H-8). Groundwater contamination persisted longer than originally expected due to reductions in dispersion and groundwater recharge, as well as possible increases in the sorption of contaminants. The VOC plume has not increased in areal size or migrated below the

uppermost aquifer zone. Based on the annual monitoring reporting, the requirements of the GMZ are being satisfied. All groundwater monitoring results are below mixing zone contaminant levels (MZCLs) and MCLs as shown in Table H-5.

LUCs have been effective in maintaining industrial land use. Annual site inspections and site maintenance have been effective in maintaining the integrity of the soil cover. Based on the site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The LUCIP for KBRP/KRP OU is located in Appendix D of the PCR and governs LUC implementation, maintenance, monitoring, reporting, and enforcement of LUCs (WSRC 2002). The LUCs that are in place include physical access controls to prevent unauthorized contact, removal or excavation of subsurface soils, and restrictions to prevent disturbance of the KBRP/KRP OU. Warning signs are in good condition, and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

The LUCIP is available on the SRS external webpage in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/) and the Land Use Control Assurance Plan webpage (https://public.srs.gov/ missions-and-programs/environmental-stewardship/lucap/).

Are Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of final remedy selection are still valid. The MCLs for PCE and TCE have remained the same since the remedies were implemented (Appendix B). There have been no changes in standards or physical conditions of the KBRP/KRP OU that would affect the protectiveness of the remedy.

The USEPA standards and toxicity values have been updated since submittal of the five-year remedy review as shown in Appendix B. The changes to the values for the COCs at the KBRP/KRP OU were not significant, and the RAOs continue to be met by the remedial

action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants were identified as applicable to this OU based on the OU history of contamination. Table H-6 provides the screening results of PFOS and PFAS for the KBRP/KRP OU.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other new information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that prevent the remedy from being protective for this OU.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for this OU.

X. PROTECTIVENESS STATEMENT(S)

The remedy at KBRP/KRP OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to, or ingestion of, contaminated groundwater and soil media. All threats to the KBRP/KRP OU are being addressed through physical access controls to prevent

unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the KBRP/KRP OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site*, Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2018. Letter, S. B. Fulmer (SCDES) to B. T. Hennessey, *Savannah River Sites Responses to the Regulatory Comments on the on the K-Area Burning/Rubble Pits and Rubble Pile (131-1K and 631-20G) (KBRP), L-Area Burning/ Rubble Pit and Rubble Pile (131-1L, 131-3L, and 131-2L) (LBRP), and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units (OUs) Detailed Combined Groundwater Monitoring Report, CERCLIS Numbers: 40, 56, and 59 (SRNS-RP-2017-00356), Revision 0, June 2017) and Request to Designate LBRP OU as a No Action OU, received January 12, 2018*, dated February 8, 2018, South Carolina Department of Environmental Services, Columbia, SC (ARF-021385)

SRNS, 2012. *K-Area Burning/Rubble Pit and Rubble Pile (131-K and 631-20G) (KBRP), L-Area Burning/Rubble Pit and Rubble Pile (131-L, 131-3L, and 131-2L) (LBRP), and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units (OUs) Detailed Combined Groundwater Monitoring Report (U),* SRNS-RP-2012-00200, Revision 1, December 2012, Savannah River Site, Aiken, SC

SRNS, 2020. Letter, B. T. Hennessey (USDOE) to S. B. Fulmer (SCDES) and J. Richards (USEPA), *Savannah River Site's Responses to the Regulatory Comments on the 2020 K-Area Burning/Rubble Pit and Rubble Pile (131-K and 631-20G) (KBRP) and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units Combined Groundwater Monitoring*

Report (Sampling Summary) SEMS Numbers: 40 and 59, IACD-22-120, dated January 24, 2022, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken SC

SRNS, 2022. *K-Area Burning/Rubble Pit and Rubble Pile (131-K and 631-20G) (KBRP) and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units (OUs) Detailed Combined Groundwater Monitoring Report (U)*, SRNS-RP-2022-00253, Revision 0, June 2022, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken SC

SRNS, 2023. Letter, B. T. Hennessey (USDOE) to S. B. Fulmer (SCDES) and J. Richards (USEPA), *2022 K-Area Burning/Rubble Pit and Rubble Pile (131-K and 631-20G) (KBRP) and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units Combined Groundwater Monitoring Report (Sampling Summary), SEMS Numbers: 40 and 59*, RDDD-23-017, dated June 19, 2023, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2024. Letter, B. T. Hennessey (USDOE) to S. B. Fulmer (SCDES) and J. Richards (USEPA), *2023 K-Area Burning/Rubble Pit and Rubble Pile (131-K and 631-20G) (KBRP) and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units Combined Groundwater Monitoring Report (Sampling Summary), SEMS Numbers: 40 and 59*, RDDD-24-142 , dated June 24, 2024, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2025. Letter, B. T. Hennessey (USDOE) to S. B. Fulmer (SCDES) and J. Richards (USEPA), *2024 K-Area Burning/Rubble Pit and Rubble Pile (131-K and 631-20G) (KBRP) and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units Combined Groundwater Monitoring Report (Sampling Summary), SEMS Numbers: 40 and 59*, RDDD-25-145, dated June 24, 2025, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

USDOE, 2008. Letter, B. T. Hennessey (USDOE) to D. Siron (SCDES) and R. H. Pope (USEPA), *Submittal of the Proposal to Standardize Sampling and Reporting Requirements*

of Groundwater Data for P, L, and K Area Burning/Rubble Pit Operable Units, CERCLIS Numbers 59, 56, 40, ACP-08-133, dated January 15, 2008, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

USEPA, 2018. Letter, J. Tufts (USEPA) to B. T. Hennessey, *EPA Approval of the K-Area Burning/Rubble Pit and Rubble Pile (131-1K and 631-20G) (KBRP), L-Area Burning/ Rubble Pit and Rubble Pile (131-1L, 131-3L, and 131-2L) (LBRP), and P-Area Burning/Rubble Pit (131-P) (PBRP) Operable Units (OUs) Detailed Combined Groundwater Monitoring Report, CERCLIS Numbers: 40, 56, 59, SRNS-RP-2017-00356, Revision 0, June 2017, and Request to Designate LBRP OU as a No Action OU, Savannah River Site NPL Site, South Carolina*, dated February 16, 2018, United States Environmental Protection Agency – Region 4, Atlanta, GA (ARF-021416)

WSRC, 1998. *RCRA Facility Investigation/Remedial Investigation Report with the Baseline Risk Assessment for the K-Area Burning/Rubble Pit (131-K) and Rubble Pile (631-20G) Operable Unit (U)*, WSRC-RP-97-442, Revision 1.2, Westinghouse Savannah River Company, Savannah River Site, Aiken SC

WSRC, 1999a. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

WSRC, 1999b. *Groundwater Mixing Zone Application for the K-Area Burning/Rubble Pit and Rubble Pile*, WSRC-RP-98-4084, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999c. *Groundwater Flow and Solute Transport Modeling Report for the K-Area Burning/Rubble Pit and Rubble Pile*, WSRC-RP-98-5052, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2000. *Record of Decision Remedial Alternative Selection for the K-Area Burning/Rubble Pit (131-K) and Rubble Pile (631-20G) Operable Unit (U)*, WSRC-RP-97-862, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken SC

WSRC, 2002. *Post-Construction Report (PCR) for the K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) Operable Unit (U)*, WSRC-RP-2002-4095, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2003. *Comparison of Groundwater Monitoring Data with Modeling Predictions for the K-Area Burning/Rubble Pit and Rubble Pile Groundwater Contamination and Plan for Corrective Action (U)*, WSRC-RP-2002-4185, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2005. Memorandum to file of a minor change to the groundwater mixing zone application for the K-Area Burning/Rubble Pit and Rubble Pile (KRBP), CERCLIS No. 40, SGP-05-224, U.S. Department of Energy, Savannah River Operations Office, Aiken SC 29808.

WSRC, 2007. *2006 Annual Mixing Zone Monitoring Report for the K-Area Burning/Rubble Pit and Rubble Pile (KBRP) (U)*, WSRC-RP-2007-4030, Revision 0, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

Various - *Inspection Data Sheets – Field Inspection Checklist K-Area Burning Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) (U)*, ER-IDS-019-015, Inspection period FY2021 through FY2025 (annually)

This page is intentionally left blank.

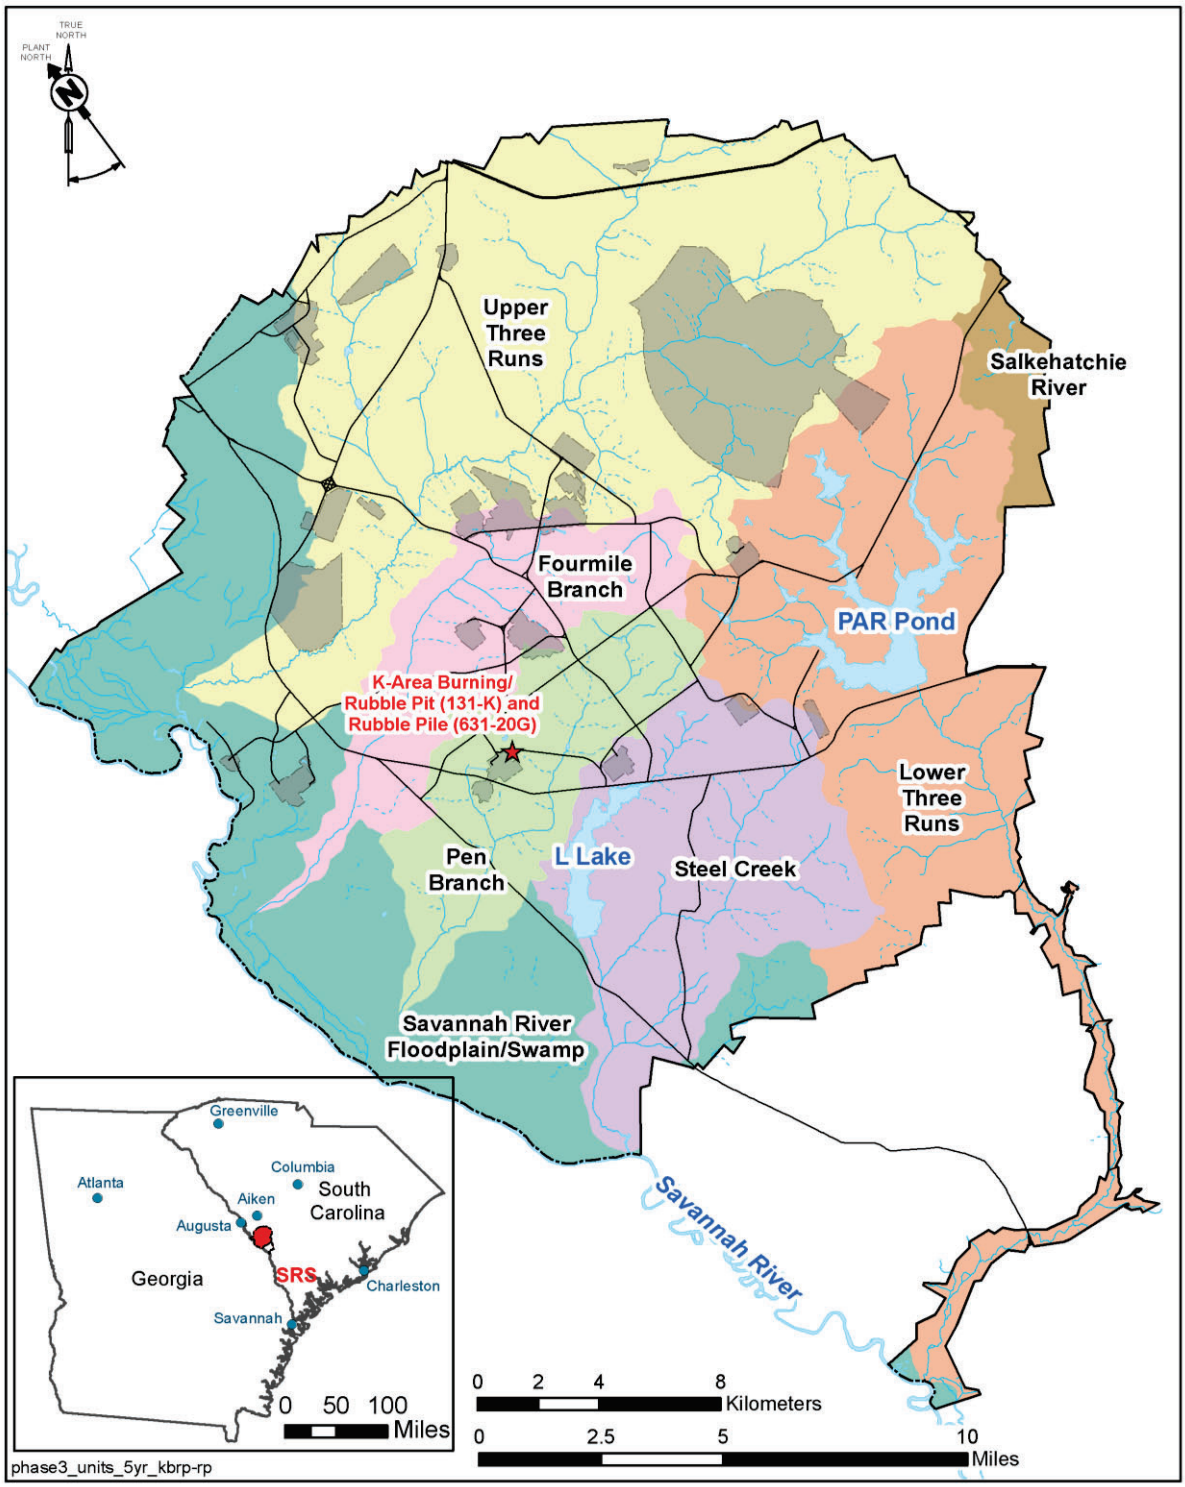


Figure H-1. Location of the KBRP/KRP OU at SRS

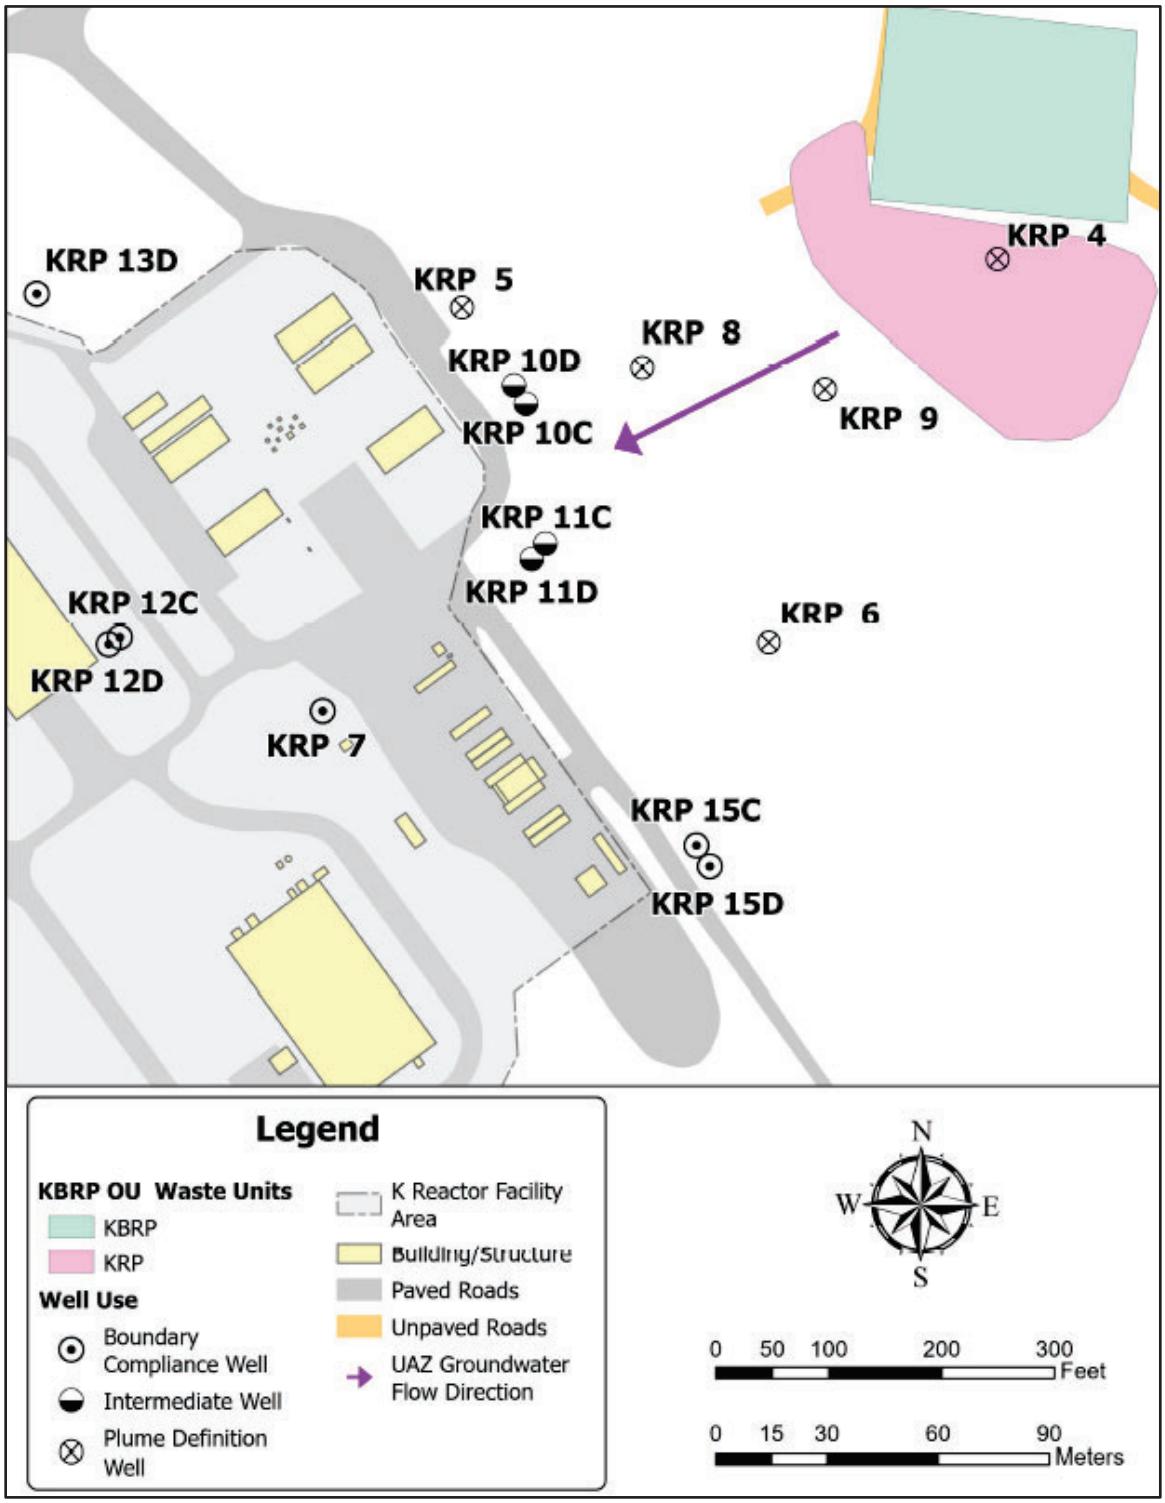


Figure H-2. Site Layout of KBRP/KRP and Well Locations



Figure H-3. Photograph of KBRP/KRP OU Before Remediation Activities (1974)



Figure H-4. Current Photograph of the KBRP/KRP OU (2025)



Figure H-5. Current Aerial Photograph of the KBRP/KRP OU (2025).

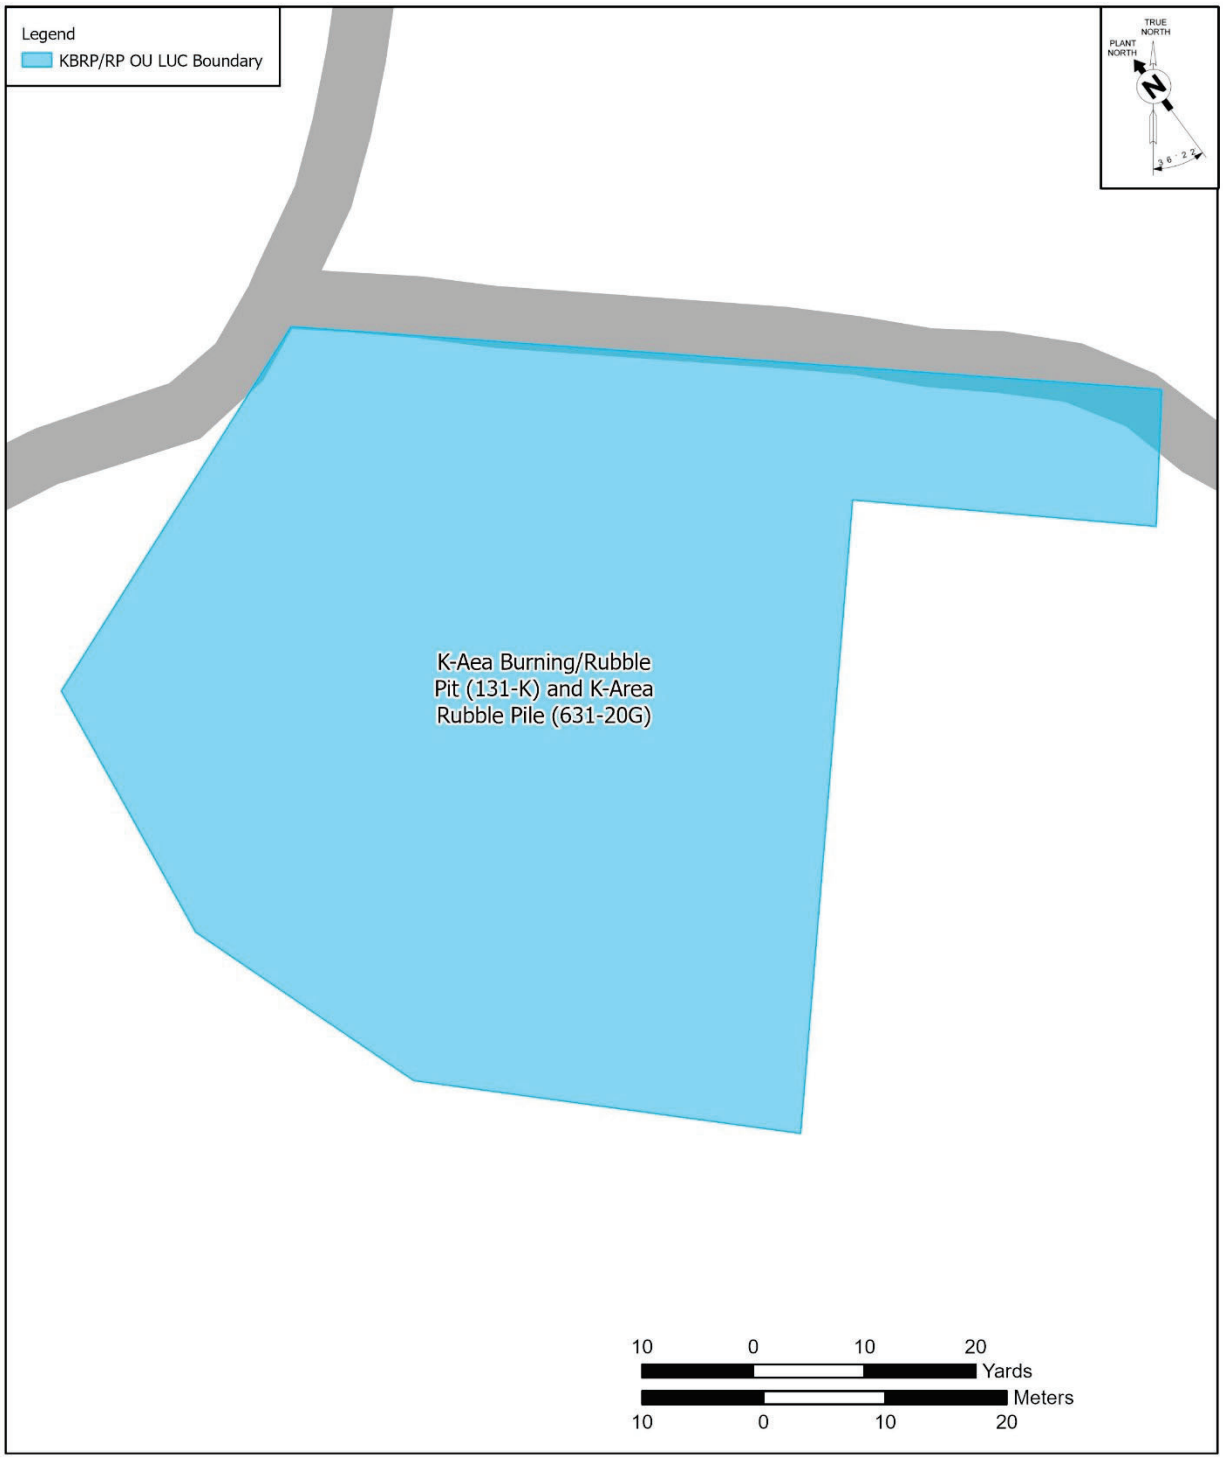


Figure H-6. KBRP/KRP OU LUC Boundary

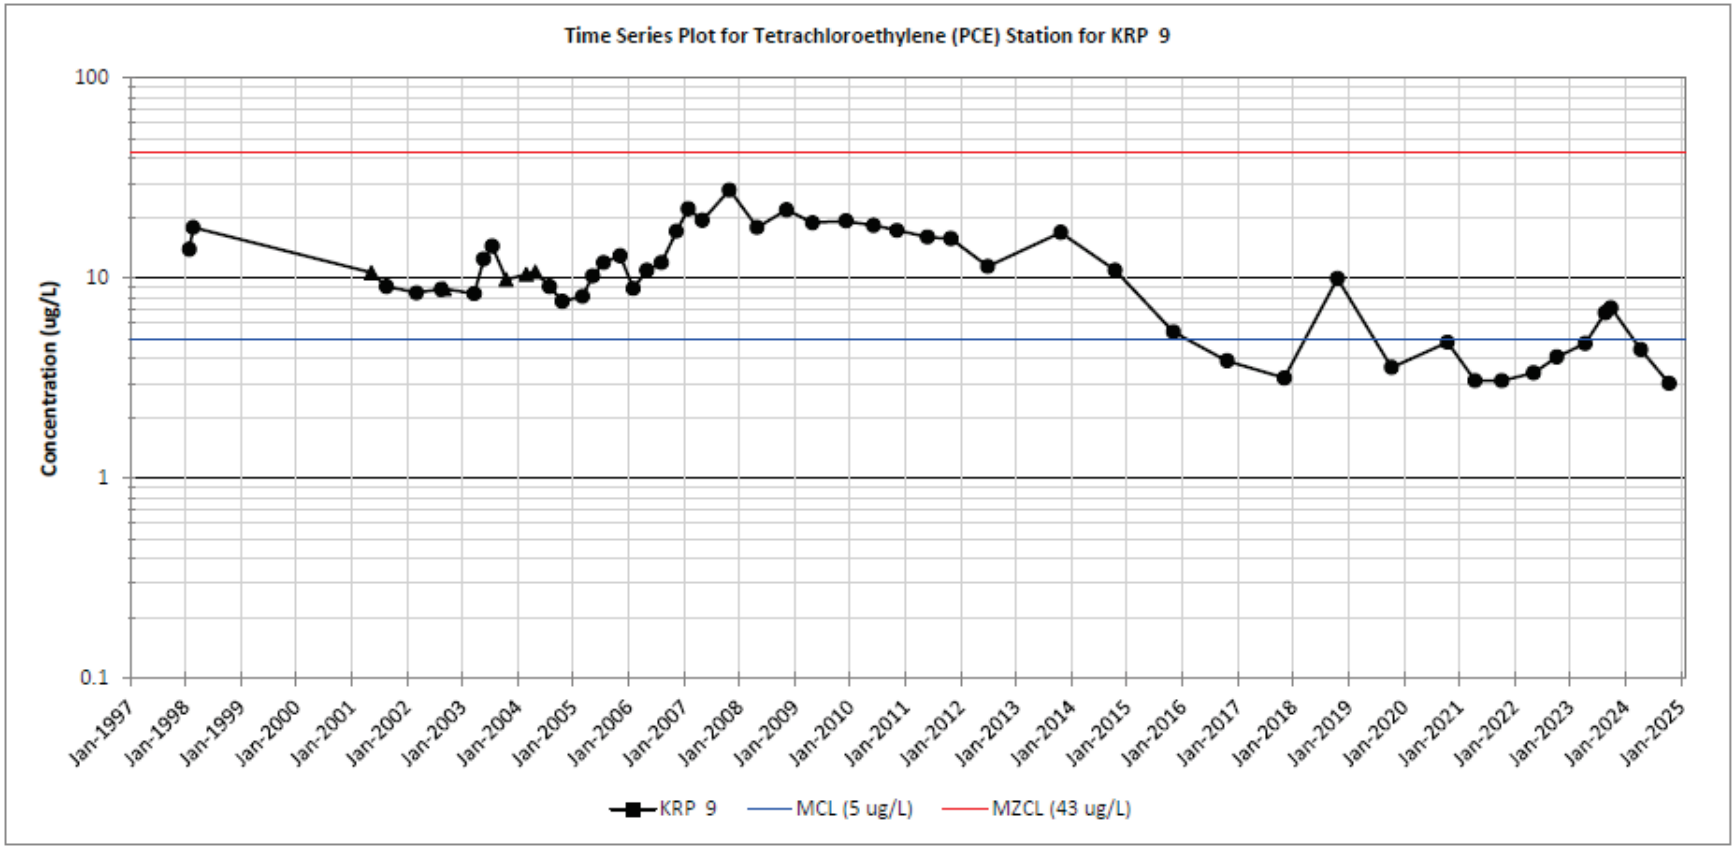


Figure H-7. PCE Time-Trend Plot at Well KRP 9

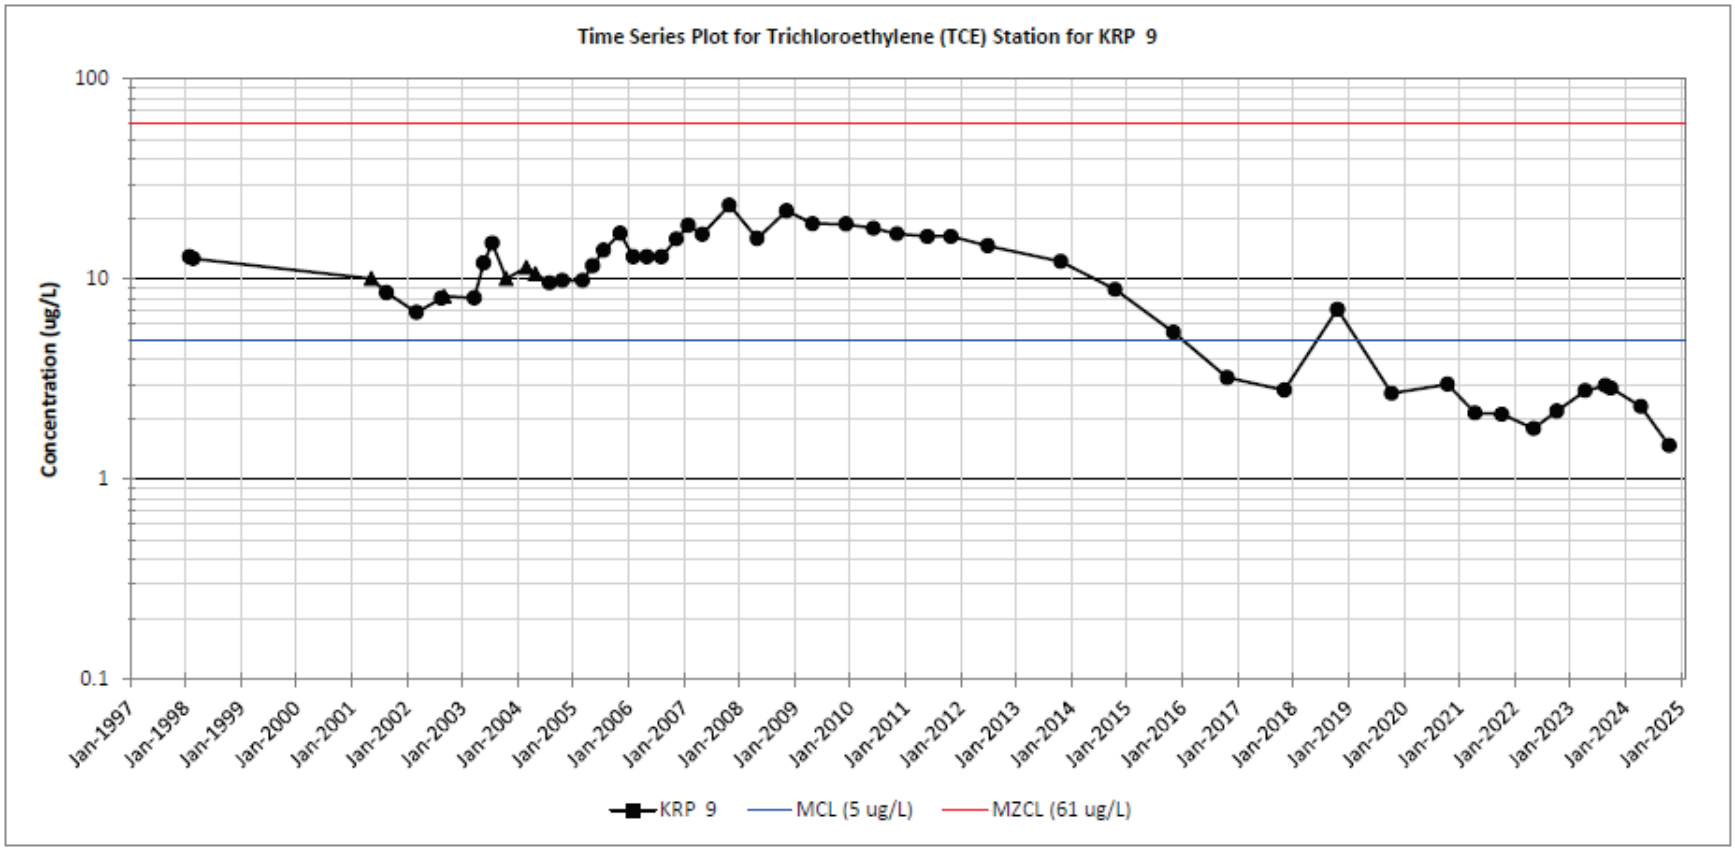


Figure H-8 TCE Time-Trend Plot at Well KRP 9

Table H-1. Chronology of Events

Event	Date
RFI/RI start/complete	1996 / December 1998
ROD issuance	August 20, 2001
Remedial Action start/complete	October 8, 2001 / March 27, 2002
Previous Five-Year Reviews Issuance	February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table H-2. 2025 Groundwater Elevation Data for the KBRP/KRP

Station ID	Aquifer Zone	Groundwater Elevation (ft AMSL)
KRP 4	UAZ	214.53
KRP 5	UAZ	210.17
KRP 6	UAZ	214.03
KRP 7	UAZ	213.32
KRP 8	UAZ	214.91
KRP 9	UAZ	210.79
KRP 10C	LAZ	SS
KRP 10D	UAZ	211.19
KRP 11C	LAZ	SS
KRP 11D	UAZ	211.19
KRP 12C	LAZ	SS
KRP 12D	UAZ	210.46
KRP 13D	UAZ	210.92
KRP 15C	LAZ	SS
KRP 15D	UAZ	210.81

ft AMSL = feet above mean sea level
LAZ = Lower Aquifer Zone
SS = Suspended Sampling
UAZ = Upper Aquifer Zone

Table H-3. Remedial Goals for KBRP and KRP OU

Subunit	Media	COC	Type of COC	Remedial Goals	Basis
K-Area Burning/ Rubble Pit (131-K)	Soil	Benzo[a]anthracene	HH	6.24 mg/kg[a]	Future Industrial Worker
		Benzo[a]pyrene		0.624 mg/kg[a]	
		Benzo[b]fluoranthene		6.24 mg/kg[a]	
		Benzo[k]fluoranthene		62.4 mg/kg[a]	
		Dibenzo[a,h]anthracene		0.624 mg/kg[a]	
		Indeno[1,2,3-c,d]pyrene		6.24 mg/kg[a]	
K-Area Rubble Pile (631-20G)	Soil	Benzo[a]anthracene	HH	6.24 mg/kg[a]	Future Industrial Worker
		Benzo[a]pyrene		0.624 mg/kg[a]	
		Benzo[b]fluoranthene		6.24 mg/kg[a]	
		Indeno[1,2,3-c,d]pyrene		6.24 mg/kg[a]	
		Arsenic		7.96 mg/kg[c]	
K-Area Burning/ Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)	Groundwater	Tetrachloroethylene (PCE)	HH	5.0 µg/L[b]	Future Industrial Worker and Exceedance of MCL
		Trichloroethylene (TCE)		5.0 µg/L[b]	

Chrysene, fluoranthene, and pyrene are residential COCs that exist at the KBRP/KRP OU at concentrations less than future industrial worker exposure concentrations.

a The remedial goal is based on the 1.0E-06 target cancer risk to the hypothetical, future, industrial worker.

b The remedial goal is based on the Water Quality Protection of Human Health as established by South Carolina Regulation 61-68 of the Pollution Control Act.

c The remedial goal is based on two times the mean concentration of arsenic in background soil at the KBRP and KRP.

mg/kg = milligrams per kilogram

µg/L = micrograms per liter

Table H-4. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	5-Year Total
Total Actual O&M Costs ($)	45,716	38,546	41,874	24,537	37,022	187,695
Total ROD Estimated Direct O&M Costs * ($)	16,212	2,900	2,900	2,900	2,900	27,812

* Costs for preparation of the Sixth Five-Year Remedy Review were accounted for in FY2021. The actual O&M costs are higher than expected because groundwater monitoring and reporting have continued longer than expected

Table H-5. Groundwater Monitoring Results Compared to MZCLs and MCLs

STATION ID	PCE (µg/L)		TCE(µg/L)	
	2024 Result	MZCL*/MCL	2024 Result	MZCL*/MCL
KRP 4	0.502 J	43*/5	ND	61*/5
KRP 5	ND	43*/5	ND	61*/5
KRP 6	ND	43*/5	ND	61*/5
KRP 7	ND	5	ND	5
KRP 8	1.62	43*/5	0.405 J	61*/5
KRP 9[a]	4.41	43*/5	2.32	61*/5
KRP 10C	SS	5	SS	5
KRP 10D	ND	5	ND	5
KRP 11C	SS	5	SS	5
KRP 11D	ND	5	ND	5
KRP 12C	SS	5	SS	5
KRP 12D	SS	5	SS	5
KRP 13D	SS	5	SS	5
KRP 15C	SS	5	SS	5
KRP 15D	SS	5	SS	5

a KRP 9 is sampled semi-annually. The posted result is the max result for the 2024 sampling events.
MZCL*=Mixing Zone Contaminant Level
MCL= Maximum Contaminant Level
ND= Non-detect
J= Estimated Value
SS= Sampling of well suspended under optimized sampling network

Table H-6. PFOS/PFAS Screening Results for the KBRP/KRP OU

Operable Unit Name:	**KBRP/KRP**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and known uses, including a review of historical PFAS applications and categories, PFAS are not expected to be present at this operable unit.**	

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)

I. SITE INFORMATION			
Site Name:	**K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G)**	**Date of Inspection:**	**08/19/2025**
Location and Region	**SRS, USEPA Region 4**	**SEMS #:**	**#40**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Partly Cloudy 85°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☒ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☐ Other _____

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. O&M Staff: Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949

Problems/Suggestions: ☐ Report Attached _____

2. O&M Staff: Eric Barron (Name) | EC&ACP Post-Closure Waste Site O&M Staff Member (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395

Problems/Suggestions: ☐ Report Attached _____

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

II. INTERVIEWS ***(Click all that apply)(Continued)***

3. **Local Regulatory Authorities and Response Agencies** (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. **Other Interviews** *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. **O&M Documents:**

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Field Inspection Checklist for K-Area Burning Rubble Pit (131-K) and Rubble Pile (631-20G)*, ER-IDS-019-015.

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is summarized in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached
From: _____ (Date) To: _____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons: _____

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☐ Gates secured ☒ N/A

Remarks: OU-specific perimeter fencing is not required by the remedial action.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs and monuments are in good condition.

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: April Coffman (Name) DOE Project Manager (Title) 10/30/2025 (Date) 803-508-0490 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks:

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

VI. GENERAL SITE CONDITIONS
A. Roads ☒ Applicable ☐ N/A
1. Roads damaged: ☐ Location shown on site map ☒ Roads adequate ☐ N/A Remarks:
B. Other Site Conditions
Remarks: Inspections for KBRP/KRP OU performed between FY2021 and FY2025 identified active ant mounds, rutting from mowing activities, and hog damage on soil covers. These findings were resolved soon after discovery.
VII. LANDFILL COVER/CONTAINMENT ☒ Applicable ☐ N/A
A. Landfill Surface
1. Settlement (Low spots)**:** ☐ Location shown on site map ☒ Settlement not evident Areal extent Depth Remarks:
2. Cracks: ☐ Location shown on site map ☒ Cracking not evident Lengths Widths Depths Remarks:
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent Depth Remarks:
4. Holes: ☐ Location shown on site map ☒ Holes not evident Areal extent Depth Remarks:
5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☐ No signs of stress Areal extent Depth Remarks: Vegetation is expected to be mowed routinely. At the time of this inspection, vegetation was overgrown.

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A

Remarks:_____

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident

Areal extent_____ Depth_____

Remarks:_____

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident

☐ Wet areas ☐ Location shown on site map Areal extent_____

☐ Ponding ☐ Location shown on site map Areal extent_____

☐ Seeps ☐ Location shown on site map Areal extent_____

☐ Soft subgrade ☐ Location shown on site map Areal extent_____

Remarks:_____

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability

Areal extent_____

Remarks:_____

B. Benches ☐ Applicable ☒ N/A

(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A

(Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

D. Cover Penetrations ☒ Applicable ☐ N/A

1. Gas Vents: ☐ Active ☐ Passive
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

2. Gas Monitoring Probes:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

3. Monitoring Wells:
☒ Properly secured/locked ☒ Functioning ☒ Routinely sampled ☒ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☐ N/A
Remarks:

4. Leachate Extraction Wells:
☐ Properly secured/locked ☐ Functioning ☐ Routinely sampled ☐ Good Condition
☐ Evidence of leakage at penetration ☐ Needs maintenance ☒ N/A
Remarks:

5. Settlement Monuments: ☐ Located ☐ Routinely Surveyed ☒ N/A
Remarks:

E. Gas Collection and Treatment ☐ Applicable ☒ N/A

F. Cover Drainage Layer ☐ Applicable ☒ N/A

G. Detention/Sedimentation Ponds ☐ Applicable ☒ N/A

H. Retaining Walls ☐ Applicable ☒ N/A

I. Perimeter Ditches/Offsite Discharge ☐ Applicable ☒ N/A

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued)*

IX. GROUNDWATER/SURFACE WATER REMEDIES ☒ Applicable ☐ N/A	
A. Groundwater Extraction Wells, Pumps, and Pipelines	☐ Applicable ☒ N/A
B. Surface Water Collection Structures, Pumps, and Pipelines	☐ Applicable ☒ N/A
C. Monitoring Data	☒ Applicable ☐ N/A
1. Monitoring Data: ☒ Is routinely submitted on time ☒ Is of acceptable quality	
2. Monitoring Data: ☒ Groundwater plume is effectively contained ☒ Contaminant concentrations are declining	
D. Monitored Natural Attenuation	☒ Applicable ☐ N/A
1. Monitoring Wells *(natural attenuation remedy)***:** ☒ Properly secured/locked ☒ Functioning ☒ Routinely sampled ☒ Good condition ☒ All required wells located ☐ Needs maintenance ☐ N/A Remarks:	
X. OTHER REMEDIES	
If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.	
A. Monitored Natural Attenuation	☒ Applicable ☐ N/A
The MNA program and monitoring well network provides sufficient data to assess the progress of natural attenuation within the groundwater. The remedy is performing as designed.	

Attachment H-1. Five-Year Review Site Inspection Checklist – K-Area Burning/Rubble Pit (131-K) and K-Area Rubble Pile (631-20G) *(continued/end)*

XI. OVERALL OBSERVATIONS
A. Implementation of the Remedy
Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.). The selected remedy for KBRP/KRP OU was installation of a soil cover with LUCs and Monitored Natural Attenuation for the water table aquifer groundwater to protect future industrial workers from exposure. Selected remedy for the KBRP/KRP OU is functioning as intended. There are no issues requiring corrective action.
B. Adequacy of O&M
Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy. The O&M procedures consisting of annual site inspection and site maintenance (cover maintenance, and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the OU) have been implemented. The O&M procedures are adequately maintaining the KBRP/KRP OU and the condition of the warning signs is good. When maintenance activities are identified during inspections, (e.g., active ant mounds, ruts from mowing, and hog damage), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the KBRP/KRP OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.
C. Early Indicators of Potential Remedy Failure
Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future. N/A
D. Opportunities for Optimization
Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy. N/A

End of Checklist

APPENDIX I. M-AREA HAZARDOUS WASTE MANAGEMENT FACILITY (904-51G AND 904-112G) OPERABLE UNIT

I. INTRODUCTION

This report is the sixth five-year review for the M-Area Hazardous Waste Management Facility (904-51G and 904-112G) (MHWMF) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants have been left in place at the MHWMF OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the MHWMF OU is protective of human health and the environment. This report documents the results of the review.

The remedy for this unit is conducted under the Savannah River Site (SRS) Resource Conservation and Recovery Act (RCRA) program. The Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) remediation requirements are met by the RCRA program; therefore, a separate review of the RCRA Corrective Action is not duplicated in this document.

II. OU CHRONOLOGY

Table I-1 lists the chronology of site events for the MHWMF OU.

III. BACKGROUND

MHWMF OU is listed as a RCRA Unit in Appendix C of the Federal Facility Agreement (FFA) for Savannah River Site (SRS) (FFA 1993). The media associated with the MHWMF OU is soil. Groundwater is not addressed under this OU. Per the Interim Action Record of Decision (IROD) (WSRC 1992), the MHWMF groundwater is addressed under the A/M Area Groundwater OU and will be discussed in the five-year remedy review reports for SRS OUs with operating equipment. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS (SCDES 2025).

Physical Characteristics

The MHWMF is located in M Area near the northwest edge of SRS (Figure I-1). The nearest site boundary is approximately 1,740 m (5,800 ft) northwest of this OU. The MHWMF has been designated as a source-specific OU within the A/M Area Fundamental Study Area. The MHWMF consists of an unlined surface impoundment known as the M-Area Settling Basin (904-51G) (MASB), a portion of an inactive process sewer line, drainage and seepage areas, and a Carolina Bay known as the Lost Lake (904-112G) (Figure I-2).

The MASB dimensions were approximately 99 m (325 ft) by 84 m (276 ft) (surface dimensions) by 5.1 m (17 ft) deep with a volumetric capacity of approximately 30.3 million liters (8 million gal). Overflow from the settling basin was directed to a natural seepage area and ultimately to the Lost Lake.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of the SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates the MHWMF OU as being within an industrial area. The future land use for the MHWMF OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

The MASB was constructed in 1958 to settle out metals (primarily uranium, nickel, lead, and aluminum) discharged from M-Area manufacturing facilities for nuclear fuel components and research facilities. The manufacturing processes consisted of aluminum-forming and metal-finishing processes used to produce fuel and targets for the SRS reactors. Waste effluents were discharged from three production buildings and two support laboratories to the MASB through an underground process sewer line. Cracks in the sewer line allowed some of the effluent to leak into the ground, contaminating underlying soils. The pipeline was slip-lined in 1983 after the cracks were discovered. In July 1985, a

permitted wastewater treatment facility was placed in operation and discharges to the MASB were discontinued.

The volume of waste within the MASB was estimated to be 28,920 m^3 (37,800 yd^3). The volume of contaminated soils and dried sludge in the overflow ditch, seepage area, process sewer line, and Lost Lake was estimated to be 30,370 m^3 (39,700 yd^3).

Initial Response

Contamination was detected in groundwater, surface water, soil, sediments, and air and evaluated in a 1985 risk analysis, which was used to develop closure alternatives. Closure of the MHWMF OU was initiated in 1988. The MHWMF OU was closed by removal and treatment of any standing water remaining in the basin; discharge of effluent to the National Pollutant Discharge Elimination System permitted M-04 Outfall; excavation, dewatering, and stabilization of the basin sludge with Portland cement; placement, consolidation, and compaction of stabilized sludge in the basin; excavation of a portion of the process sewer line and the contaminated soils associated with the sewer line, drainage ditch, seepage area, and Lost Lake; placement and compaction of contaminated materials in the basin; construction of a low permeability cap over the MASB and restoration of the area. The drainage ditch soils were excavated and stabilized with cement in the basin during closure activities.

The MHWMF was closed in accordance with the Closure Plan for M-Area Settling Basin and Vicinity at the Savannah River Plant (DPSPU-84-11-11, July 1990) and was certified closed in 1990 and was accepted by the South Carolina Department of Environmental Services (SCDES) in 1991 as being in compliance with RCRA requirements.

Basis for Taking Action

The MHWMF was subject to closure under South Carolina Hazardous Waste Management Regulations (SCHWMR) R.61-79-265 Interim Status Standards for Owners and Operators of Hazardous Waste Treatment, Storage, and Disposal Facilities (SRNS 2020). Per the approved 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025), post-closure care is regulated under SCHWMR R.61-79-264. In addition, an ongoing program

of corrective action and groundwater monitoring at the MHWMF is administered through the 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025).

Characterization efforts prior to the IROD (WSRC 1992) indicated contamination was present in basin surface water, basin soil, basin sludge, overflow ditch soils/sediments, seepage area soils/sediments, and Lost Lake soils/sediments. The major contaminants identified were nitrate as nitrogen, phosphate, sulfate, chloride, sodium, aluminum, nickel, uranium, lead, trichloroethylene, tetrachloroethylene, and 1,1,1-trichloroethane (SRNS 2020).

IV. REMEDIAL ACTIONS

Remedy Selection

As stated in the IROD (WSRC 1992), the remedial action objectives (RAOs) are to prevent the physical exposure to contaminants and mitigate further migration of contaminants to the groundwater by minimizing a liquid medium pathway (rainwater percolation) for transport. The MHWMF RCRA preventative action of stabilization and placement of all contaminated material under a low-permeability cap satisfied both RAOs.

As stated in the IROD, the selected interim action remedy is the previous MHWMF RCRA preventative action of stabilization and placement of all contaminated materials under a low-permeability cap. Since the preventative action is protective of human health and the environment and satisfies CERCLA requirements, no further action under CERCLA is necessary for this source control OU.

Post-closure requirements will be met by:

- Maintaining the integrity and effectiveness of the final cover, including making repairs to the RCRA cap as necessary to correct the effects of settling, subsidence, erosion, or other events;
- Maintaining and controlling the groundwater monitoring system and complying with all other applicable requirements;

- Taking measures to prevent run-on and runoff from eroding or otherwise damaging the final cover; and
- Repairing security control devices.

Remedy Implementation

Implementation of the selected RCRA preventative action remedy (i.e., the RCRA preventative action) included the following activities:

- Dewatering of the basin;
- Treating and discharging the basin liquid to a permitted outfall;
- Stabilizing 28,820 m^3 (37,800 yd^3) of the dewatered basin sludge with Portland cement;
- Consolidating 30,370 m^3 (39,700 yd^3) contaminated materials by excavating a portion of the process sewer line and associated soils (842 m^3 [1,100 yd^3]) and contaminated soils from the overflow ditch (5,126 m^3 [6,700 yd^3]), the seepage area (7,497 m^3 [9,800 yd^3]) and areas of Lost Lake (16,907 m^3 [22,100 yd^3]) and transporting to the top of the stabilized sludge within the basin; and
- Installing a 0.97-hectare (2.4-acre) low permeability cover system over the MASB consisting of a layer of backfill, a 0.6-m (2-ft) layer of low permeability compacted kaolin clay with a permeability of 1E-07 cm/s or less, a 0.3-m (1-ft) drainage layer, geotextile filter fabric, topped with 0.6 m (2 ft) of vegetative cover (15-cm [6-in] of topsoil over 45-cm [18-in] of common fill), 15-cm (6-in) perforated drainage collection pipe, and stormwater conveyance system.

Figure I-3 presents a historical photograph of the MHWMF OU. Current photographs of the MHWMF OU are presented in Figures I-4 and I-5. Figure I-6 shows the MHWMF OU RCRA Boundary.

Systems Operations/Operation and Maintenance

There are no system operational requirements.

The following maintenance activities are ongoing:

- Post-closure groundwater monitoring to verify that no unacceptable exposure to potential hazards posed by conditions at the OU occur in the future as required per the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025).
- Quarterly site inspections and site maintenance for a minimum of 30 years to maintain the integrity of the cover system, OU-specific perimeter fencing, signs, etc. Any necessary repairs will be made as part of the maintenance program.
- Institutional controls (i.e., land use controls [LUCs]) to restrict access to authorized personnel with appropriate training on applicable requirements and to preclude unauthorized access or intrusive activities through the SRS Site Use/Site Clearance program and SRS site security.

Costs associated with the selected remedy for MHWMF include operation and maintenance (O&M) costs of the soil cover and LUCs. The actual O&M cost during fiscal year (FY) 2021 to FY2025 is $186,800. RCRA documentation does not require estimated project costs to be prepared. However, for the MHWMF, a cost estimate of $100,000 over the five years is provided in the IROD (WSRC 1992) (Table I-2).

V. PROGRESS SINCE LAST REVIEW

This is the sixth five-year remedy review for the MHWMF. The previous protectiveness statement from the last five-year review concluded that because the remedial actions at MHWMF are protective, the site is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are controlled through a maintained cover system and LUCs.

Under the RCRA Hazardous and Mixed Waste Permit Renewal, additional corrective action was taken adjacent to and beneath the MASB. Dynamic Underground Stripping (DUS) injected steam into a 1.2-hectare (3-acre) footprint with target depths of 13.5 to 49.5 m (45 to 165 ft) and an estimated 339,802 m^3 (12 million ft^3) of soil to remediate. Heated solvent vapors were removed by soil vapor extraction. During operation between 2005 and 2012, the DUS system, now known as the Western Sector Treatment System, removed 207,485 kg (457,426 lbs) of volatile organic compounds (VOC) contamination in the target

area. In July 2013, post remediation soil samples were collected, and the VOC soil results indicated that > 99% of the solvent mass (including dense non-aqueous phase liquids [DNAPL]) was removed from the target zone. Elevated VOC concentrations are persistent in the vadose zone and groundwater outside of the target zone near the MASB. To address the vadose zone contamination, eight MicroBlowers™ and two BaroBalls™ were installed along the M-Area Abandoned Process Sewer Line in 2020 and passive soil vapor extraction continues at the Western Sector Treatment System. Additional characterization of the vadose zone to the east of the MASB was conducted in 2023 to determine the full extent of contamination. A new recovery well was installed southeast of the MASB to capture a high concentration VOC groundwater plume which became operational in 2020. In 2022, emulsified zero valent iron was injected into the groundwater northwest of the MASB to target and remediate the potential path of DNAPL migration from the MASB to Western Sector of A/M-Area Groundwater OU. An existing recovery well north of the MASB was replaced in 2025 based on diminishing pumping rates. These corrective actions were taken under the direction of the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025). These corrective actions are discussed as part of the A/M-Area Groundwater OU in the five-year remedy review reports for the SRS OUs with operating equipment.

There were no recommendations or follow-up actions from the last five-year review.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment I-1; and
- Ensured that all actions required under the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) were implemented (i.e., quarterly inspections and maintenance to the soil covers and groundwater monitoring).

Summary of Inspections and Interviews

Scheduled quarterly site inspections were conducted from FY2021 through FY2025 (Various). The field inspection checklists are approved as part of the closure/post-closure/permit application process and are governed by the RCRA Permit Renewal for SRS. They are available in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/).

Tasks included on the field inspection checklists include:

- Verifying roads to waste units are accessible;
- Verifying fence, posts, and gates that surround M-Area Settling Basin are intact, in good condition, and unattended gates are locked;
- Verifying M-Area Settling Basin signs (10) and postings are in acceptable condition, have correct information, and are legible from a distance of 7.6 m (25 ft);
- Checking integrity of drainage ditches, drainpipes, and general area (including the drainage ditch to Lost Lake) for presence of excessive erosion, vegetation, standing water, sediment buildups, or any debris restricting water flow;
- Checking the soil cover for signs of erosion, abnormal soil cracks, depressions (subsidence), or physical impacts;
- Visually checking vegetative cover of M-Area Settling Basin for grass density, with no bare spots more than 0.9 m by 0.9 m (3 ft by 3 ft)in area and large weeds or woody vegetation on capped area. (The height of the vegetative cover should not impair the visual inspection of the soil cover. This will be determined by the Inspector.);
- Checking for excessive vegetation growing over fences which obstruct warning signs or visibility of inspected area;
- Checking M-Area Settling Basin cover for signs of burrowing animals;
- Checking side slopes for slumping and any observable signs of subsidence/depressions;

- Verifying annual Topographic/Subsidence Survey has been completed for current calendar year;
- Verifying copies of survey results are in EC&ACP Document Control Center;
- Checking around Lost Lake for evidence of any unauthorized activity in immediate area;
- Ensuring benchmark is visible and not damaged; and
- Other.

The field inspections identified the following issues: active ant mounds, evidence of small animals burrowing, broken barbed wire at gate, and overgrown vegetation in drainage ditch and pipes. These findings were documented on the field inspection checklists and resolved soon after discovery.

The MHWMF OU was inspected by Savannah River Nuclear Solutions, LLC (SRNS) Environmental Compliance and Area Completion Projects (EC&ACP) on August 27, 2025 and included taking current photographs of the MHWMF OU and reviewing the field inspection checklist. During this inspection, overgrown vegetation was identified. The issue was addressed soon after discovery. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the MHWMF during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the MHWMF OU that would affect the protectiveness of the remedy.

The MHWMF OU was inspected by SRNS EC&ACP and USDOE personnel on October 28, 2025. No issues were identified for the MHWMF OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, U.S. Environmental Protection Agency (USEPA) and SCDES personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of MHWMF OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection.

The MHWMF OU was inspected by SCDES on September 4, 2025, as part of the RCRA annual comprehensive groundwater monitoring evaluation. The M-Area Settling Basin was observed to be in good condition and no issues were identified.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, in situ stabilization/solidification, RCRA soil cover with LUCs, is effective in preventing exposure to contaminant risk above 1E-06 risk levels and mitigating further migration of contaminants to groundwater and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Quarterly site inspections and site maintenance have been effective in maintaining integrity of the soil cover. Based on site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The LUC requirements are discussed and approved as part of the closure/post-closure/ permit application process and are governed by the RCRA Permit Renewal for the SRS (SCDES 2025). The closure/post-closure requirements are discussed in the RCRA Permit Renewal Application for the M-Area and Metallurgical Laboratory Hazardous Waste Management Facilities (M-Area and Met Lab HWMF) Postclosure (SRNS 2020). Therefore, a Land Use Control Implementation Plan is not required for this OU.

The LUCs (i.e., RCRA closure/post-closure care requirements) that are in place include physical access controls to prevent unauthorized contact (i.e., OU-specific fencing with locked gates and warning signs posted on the fences), removal or excavation of subsurface

soils, and restrictions to prevent disturbance of the MHWMF OU. Warning signs are in good condition, and no activities were observed that would have violated LUCs. All LUC objectives are being met.

Are the Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still Valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of remedy selection are still valid. There have been no changes in the standards or physical conditions of the MHWMF OU that would affect the protectiveness of the remedy.

The applicable or relevant and appropriate requirements (ARARs) discussed in the IROD (WSRC 1992) for this limited action focus on the design and construction of the remedial action which was completed in 1990. Based on the review of this OU, the requirements of the ARAR that set forth the performance standards for the cover system (i.e., long-term minimization of migration of contaminants, function with minimum maintenance) continue to be met.

The USEPA standards and toxicity values have been updated since submittal of the last five-year remedy review as shown in Appendix B. The changes to the values for COCs at the MHWMF OU included some decreases in the regional screening levels (RSLs) due to updated input values used to calculate the RSLs. The residential soil screening level for lead decreased from 400 mg/kg to 200 mg/kg. If other sources of lead are present, the screening level is 100 mg/kg. However, these changes do not affect the protectiveness of the remedy and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-

dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. 1,4-Dioxane has been identified at the A/M-Area Groundwater OU and is being monitored under the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025). Future corrective action of 1,4-dioxane is discussed as part of the A/M-Area Groundwater OU in the five-year remedy review reports for the SRS OUs with operating equipment.

Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this waste unit (Table I-3). However, the engineered cover system in place serves as an effective and protective remedy, mitigating potential exposures and releases associated with PFAS.

The remaining emerging contaminants were not identified as applicable to this OU based on the OU history of contamination.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that currently prevent the remedy from being protective.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for the MHWMF OU under CERCLA.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the MHWMF OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by stabilization and placement of all contaminated materials under a low-permeability cap and LUCs to prevent exposure to or ingestion of contaminated soil media and mitigating further migration of contaminants to groundwater. All threats to the MHWMF OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the MHWMF OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

Du Pont, 1990. *Closure Plan for the M-Area Settling Basin and Vicinity at the Savannah River Plan*, DPSPU 94-11-11, E.I. du Pont de Nemours & Company, Savannah River Plant, Aiken, SC

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2025. *South Carolina Department of Health and Environmental Control Hazardous and Mixed Waste Permit, Permit Number SC1 898 008 989, 2025 RCRA Permit Renewal for the Savannah River Site, issued on October 27, 2025, Module III - Postclosure Care and Module IV – Groundwater Requirements, Section A, M-Area and Metallurgical Laboratory Hazardous Waste Management Facilities*, South Carolina Department of Environmental Services, Division of Waste Management, Bureau of Land and Waste Management, Columbia, SC

SRNS, 2020. *2013 RCRA Permit Renewal Application (U), Volume III, M-Area Metallurgical Laboratory Hazardous Waste Management Facilities (M-Area and Met Lab*

HWMFs) Postclosure, SRNS-IM-2012-00002, Revision 4, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1992. *Interim Action Record of Decision Remedial Alternative Selection M-Area Hazardous Waste Management Facility Operable Unit*, WSRC-RP-92-743, Revision 0, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

Various - *Inspection Data Sheets – Field Inspection Checklist, M-Area HWMF Post Closure Inspection (U)*, ER-IDS-019-022, Inspection period FY2021 through FY2025 (quarterly)

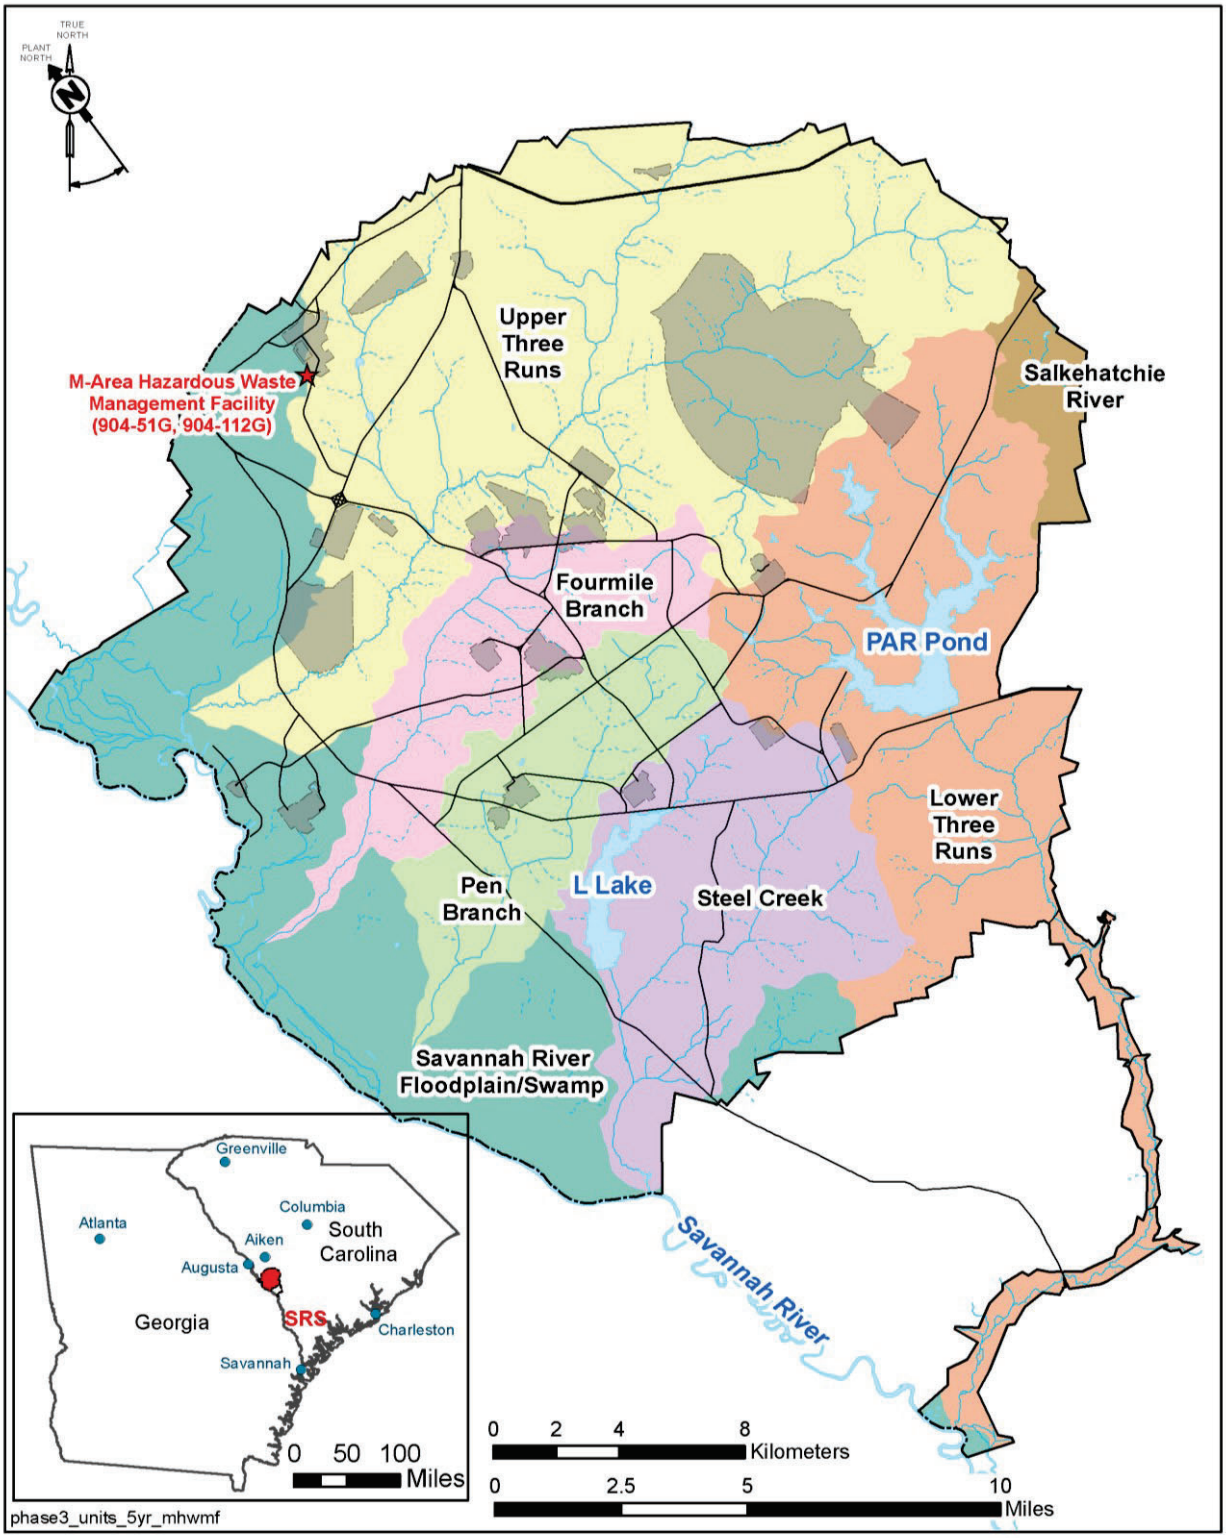


Figure I-1. Location of M-Area HWMF at SRS

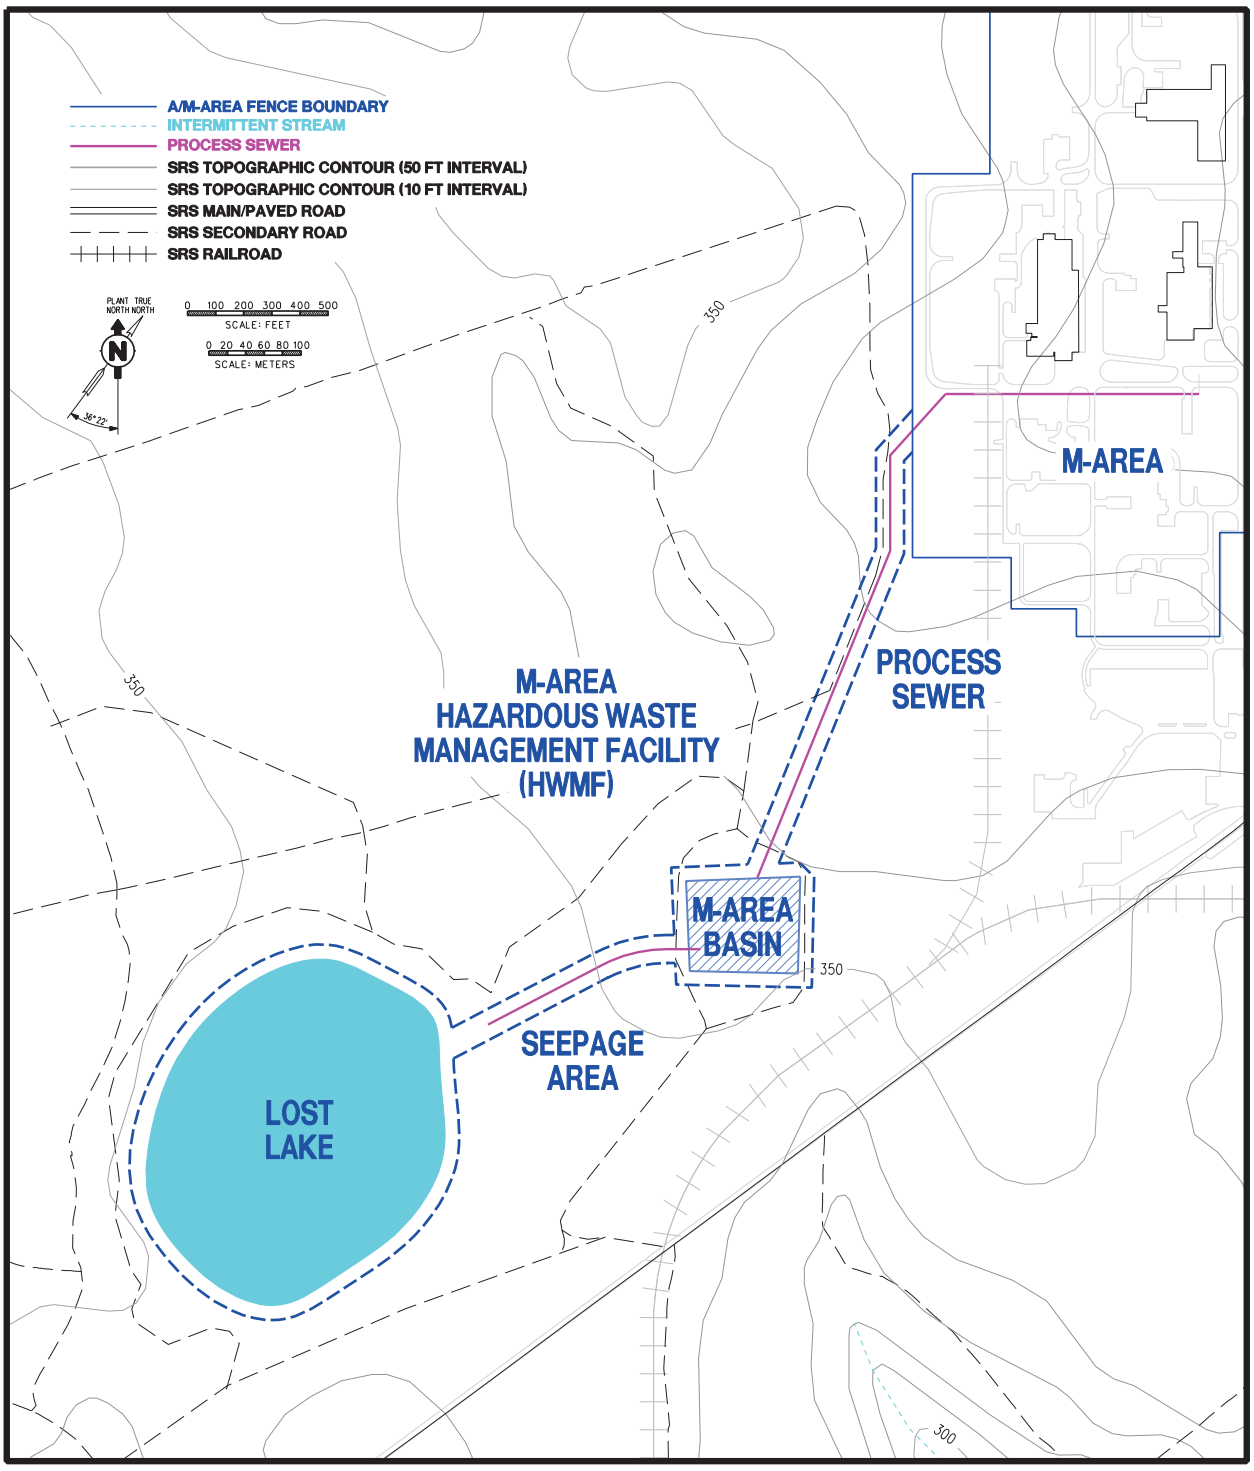


Figure I-2. Site Layout for M-Area HWMF



Figure I-3. Historical Photograph of the M-Area HWMF



Figure I-4. Photograph of the M-Area HWMF at the SRS (2025)



Figure I-5. Aerial Photograph of the M-Area HWMF at the SRS (2025)

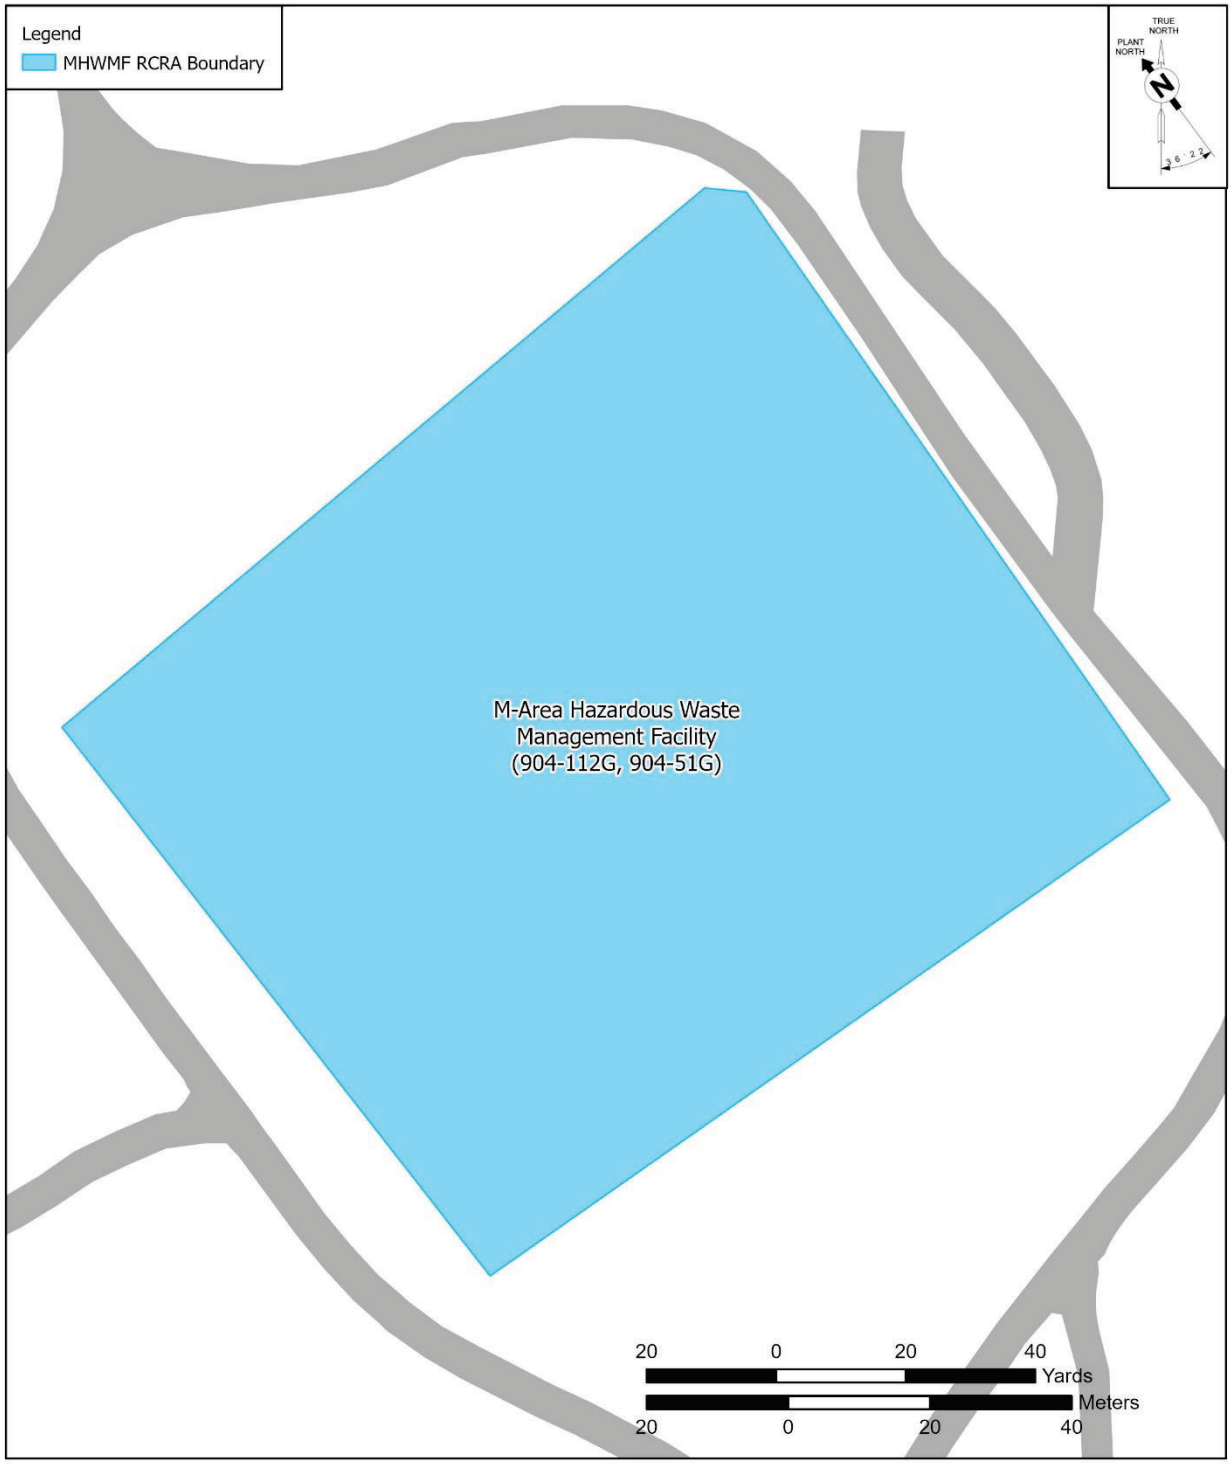


Figure I-6. MHWMF OU RCRA Boundary

Table I-1. Chronology of OU Events

Event	Date
RCRA Closure Plan Approved	1987
Corrective Action Start	1988
RCRA Closure Completed	1990
IROD Issuance	September 6, 1992
Previous Five-Year Reviews Issuance	June 30, 1997 / * / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

*No review was conducted in 2004 due to an administrative oversight.

Table I-2. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	Five-Year Total
Total Actual O&M Costs ($)	54,004	27,035	28,166	29,956	47,640	186,800
Total ROD Estimated Direct O&M Costs ($)	20,000	20,000	20,000	20,000	20,000	100,000

RCRA documentation does not require estimated project costs to be prepared. However, an estimated cost was provided in the M-Area HWMF IROD (WSRC 1992).

Table I-3. PFOS/PFAS Screening Results for the MHWMF OU

Operable Unit Name:	**MHWMF**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	**Yes**	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this operable unit.**	

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU

I. SITE INFORMATION			
Site Name:	**M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU**	**Date of Inspection:**	**08/27/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #1**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Sunny 77°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☒ Other Consolidation, Waste Stabilization, Excavation, Disposal

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. O&M Staff: Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949

Problems/Suggestions: ☐ Report Attached

2. O&M Staff: Eric Barron (Name) | EC&ACP Post-Closure Waste Site O&M Staff Member (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395

Problems/Suggestions: ☐ Report Attached

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. **Local Regulatory Authorities and Response Agencies** (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. **Other Interviews** *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. **O&M Documents:**

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Field Inspection Checklist for M-Area Hazardous Waste Management Facility, 904-51G,* ER-IDS-019-022 (FY2021 through FY2025 [quarterly]).

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☒ Other Permits	☐ Readily Available	☐ Up to Date	☐ N/A

Remarks: RCRA Hazardous and Mixed Waste Permit Renewal

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is discussed in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons: _____

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☒ Gates secured ☐ N/A

Remarks: OU-specific perimeter fencing is required by the remedial action. The perimeter fence is in good condition.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Charles Bryan (Name) | DOE Program Manager (Title) | 10/28/2025 (Date) | 803-952-7505 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks:

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

VI. GENERAL SITE CONDITIONS
A. Roads ☒ Applicable ☐ N/A
1. Roads damaged: ☒ Location shown on site map ☒ Roads adequate ☐ N/A Remarks:
B. Other Site Conditions
Remarks: Site inspections conducted during FY2021 through FY2025 identified active ant mounds, evidence of small animals burrowing, broken barbed wire at gate, and overgrown vegetation in drainage ditch and pipes. These issues were resolved soon after discovery.
VII. LANDFILL COVER/CONTAINMENT ☒ Applicable ☐ N/A
A. Landfill Surface
1. Settlement (Low spots)**:** ☐ Location shown on site map ☒ Settlement not evident Areal extent _____ Depth _____ Remarks:
2. Cracks: ☐ Location shown on site map ☒ Cracking not evident Lengths _____ Widths _____ Depths _____ Remarks:
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent _____ Depth _____ Remarks:
4. Holes: ☐ Location shown on site map ☒ Holes not evident Areal extent _____ Depth _____ Remarks:
5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☐ No signs of stress Areal extent _____ Depth _____ Remarks: Vegetation is expected to be mowed routinely.

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A
Remarks:

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident
Areal extent Depth
Remarks:

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident
☐ Wet areas ☐ Location shown on site map Areal extent
☐ Ponding ☐ Location shown on site map Areal extent
☐ Seeps ☐ Location shown on site map Areal extent
☐ Soft subgrade ☐ Location shown on site map Areal extent
Remarks:

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability
Areal extent
Remarks:

B. Benches ☐ Applicable ☒ N/A
(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A
(Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

D. Cover Penetrations ☐ Applicable ☒ N/A

E. Gas Collection and Treatment ☐ Applicable ☒ N/A

F. Cover Drainage Layer ☒ **Applicable** ☐ **N/A**

1. Outlet Pipes Inspected: ☒ **Functioning** ☐ **N/A**
Remarks:

2. Outlet Rock Inspected: ☐ **Functioning** ☒ **N/A**
Remarks:

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*	
G. Detention/Sedimentation Ponds	☐ Applicable ☒ N/A
H. Retaining Walls	☐ Applicable ☒ N/A
I. Perimeter Ditches/Offsite Discharge	☒ Applicable ☐ N/A
1. Siltation: ☐ Location shown on site map ☒ Siltation not evident Areal extent_____ Depth_____ Remarks:_____	
2. Vegetative Growth: ☐ Location shown on site map ☐ N/A ☒ Vegetation does not impede flow Areal extent_____ Type_____ Remarks:_____	
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent_____ Depth_____ Remarks:_____	
4. Discharge Structure: ☐ Location shown on site map ☒ N/A Remarks:_____	
VIII. VERTICAL BARRIER WALLS	☐ Applicable ☒ N/A
IX. GROUNDWATER/SURFACE WATER REMEDIES	☐ Applicable ☒ N/A
X. OTHER REMEDIES	
If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.	
A. Consolidation, Stabilization, Excavation, Disposal	☒ Applicable ☐ N/A
Consolidation, stabilization, excavation, and disposal were performed at MHWMF. The remedy is performing as designed.	

Attachment I-1. Five-Year Review Site Inspection Checklist – M-Area Hazardous Waste Management Facility (904-51G and 904-112G) OU *(continued/ end)*

XI. OVERALL OBSERVATIONS

A. Implementation of the Remedy

Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.).

The remedy of stabilizing the basin contents, consolidating contaminated materials in the basin, and installing and maintaining a low permeability cap was designed and implemented to prevent physical exposure to contaminants and to mitigate further migration of contaminants to the groundwater. The cover system is intact, long term grasses have been fully established. Soil cover system remedy is functioning as designed. Drainage channels are functioning adequately.

B. Adequacy of O&M

Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy.

The O&M procedures consisting of quarterly site inspections and site maintenance (repair of erosion damage, cover system, fencing, and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the OU) have been implemented. The O&M procedures are adequately maintaining the MHWMF OU and the condition of the warning signs and fencing is good. When maintenance activities are identified during inspections (e.g., treating ant mounds, vegetation removal from drainage, filling burrowed holes, and repairing fencing), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the MHWMF OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.

C. Early Indicators of Potential Remedy Failure

Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future.

N/A

D. Opportunities for Optimization

Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy.

N/A

End of checklist

This page is intentionally left blank.

APPENDIX J. METALLURGICAL LABORATORY HAZARDOUS WASTE MANAGEMENT FACILITY (904-110G) OPERABLE UNIT

I. INTRODUCTION

This report is the seventh five-year review for the Metallurgical Laboratory (904-110G) (Met Lab) Hazardous Waste Management Facility (HWMF) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants have been left in place at the Met Lab HWMF OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the Met Lab HWMF OU is protective of human health and the environment. This report documents the results of the review.

The remedy for the Met Lab HWMF is conducted under the Savannah River Site (SRS) Resource Conservation and Recovery Act (RCRA) program. The Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) remediation requirements are met by the RCRA program; therefore, a separate review of the RCRA Corrective Action is not duplicated in this document.

II. OU CHRONOLOGY

Table J-1 lists the chronology of site events for the Met Lab HWMF OU.

III. BACKGROUND

The Met Lab HWMF OU is listed as a RCRA Unit in Appendix C of the Federal Facility Agreement (FFA) for SRS (FFA 1993). The media associated with the Met Lab HWMF OU is soil. Groundwater is not addressed under this OU. Per the Interim Action Record of Decision (IROD) (WSRC 1992), the Met Lab HWMF groundwater is being addressed under the A/M Area Groundwater OU and will be discussed in the five-year remedy review reports for SRS OUs with operating equipment. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS (SCDES 2025).

Physical Characteristics

The Met Lab HWMF OU is located in M Area of the SRS near the northwest edge of SRS (Figure J-1). The nearest site boundary is located approximately 1.2 km (0.75 mi) northwest of this OU. The Met Lab HWMF has been designated as a source-specific OU within the Upper Three Runs Watershed.

The Met Lab HWMF OU is located in the eastern portion of the A/M-Area Central Sector (Figure J-2). The OU includes the unlined Met Lab Basin, the abandoned portion of the influent process sewer line, an associated Carolina Bay, and the A-08 drainage outfall to the bay (Figure J-3). The Met Lab Basin dimensions are approximately 27 m (90 ft) by 36 m (120 ft) by 1.5 m (5 ft) deep. The Carolina Bay is a marshy, oval-shaped natural depression that covers approximately 2.4 hectares (6 acres).

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999) designates the Met Lab HWMF OU as being within an industrial area. The future land use for the Met Lab HWMF OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

The Met Lab Basin began receiving effluent from the Savannah River Laboratory Equipment Engineering Division Metallurgical Laboratory in 1956. The effluent consisted primarily of noncontact cooling water (water that did not contact process operations) and small quantities of laboratory rinse water containing hazardous substances. The historic wastewater discharge rate to the Met Lab Basin was estimated to be 3.8 m^3/day (5 yd^3/day). Discharges to the basin during the period from 1983 to November 8, 1985, consisted of nonhazardous effluent. All flow to the Met Lab Basin was terminated on November 8, 1985, when the process sewer line was plugged.

The Carolina Bay received wastes from three sources: (1) wastewater and surface water runoff overflow from the Met Lab Basin A-08 Outfall, (2) surface water runoff and cooling water from the A-Area coal-fired power plant and (3) A/M Area stormwater through the A-09 Outfall.

Initial Response

Contamination was detected in groundwater, basin surface water, soil, and basin sediments and evaluated in a risk assessment in 1985. The Met Lab HWMF OU was closed by removal and treatment of any standing water remaining in the basin, discharge of the effluent to the National Pollutant Discharge Elimination System (NPDES) permitted outfall, excavation, dewatering, placement, consolidation and compaction of stabilized sludge in the basin, and excavation of a portion of the process sewer line and contaminated soils associated with the sewer line. The Met Lab HWMF closure plan was submitted and approved by South Carolina Department of Environmental Services (SCDES) in June 1991. The Met Lab Basin closure was certified on July 17, 1992.

Characterization of the Met Lab Carolina Bay for human health risks was completed in 1991 and for ecological risks in 1993. Surface sediments and soil to a depth of 0.6 m (2 ft) were contaminated with metals and organics. Risks were found to be acceptable, and no further remedial action was required.

The Met Lab HWMF underlying groundwater is being addressed under the A/M Area Groundwater OU and is not included in this review. A/M-Area Groundwater OU will be discussed in the five-year remedy review reports for SRS OUs with operating equipment. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS (SCDES 2025).

Basis for Taking Action

On September 24, 1985, the Natural Resources Defense Council and others filed a complaint against USDOE concerning the Met Lab Basin and neighboring Carolina Bay. The associated lawsuit resulted in a Consent Decree in June 1988 which mandated that the Met Lab HWMF and associated Carolina Bay were subject to RCRA (WSRC 1992). The

Met Lab HWMF OU was subject to closure under South Carolina Hazardous Waste Management Regulations (SCHWMR) R.61-79.265. Closure of the basin was conducted as a landfill without excavation of soil from the basin (WSRC 1991).

At the time of the IROD, no contaminants of concern (COCs) were identified, though previous characterization efforts indicated contamination was present in groundwater, basin surface water, soil, and basin sediments. Detected contaminants in the basin and/or process sewer line sediments included sulfate, nitrate, cyanide, and metals (though all were substantially below the U.S. Environmental Protection Agency [USEPA] toxicity concentration criteria). Chlorinated solvents, specifically trichloroethylene and tetrachloroethylene, were detected in both upgradient and downgradient wells (WSRC 1992)

IV. REMEDIAL ACTIONS

Remedy Selection

Preventative alternatives were developed for the Met Lab HWMF within the RCRA closure process. Preventative activities at the Met Lab HWMF became subject to CERCLA when SRS was placed on the National Priorities List in December 1989.

The remedial action objectives (RAOs), as documented in the IROD (WSRC 1992), are to prevent the physical exposure to contaminants and to mitigate further migration of contaminants to the groundwater by minimizing a liquid medium pathway (rainwater percolation) for transport. The selected interim action remedy is the previous Met Lab HWMF RCRA preventative action of no waste removal, excavation of the process sewer line and associated contaminated sediments, placement of all contaminated materials under a low-permeability cap and no action for the Carolina Bay. The Met Lab HWMF RCRA preventative action of stabilization and placement of all contaminated materials under a low-permeability cap satisfies both RAOs. Since preventative action is protective to human health and the environment and satisfies CERCLA requirements, no further action under CERCLA is necessary for this source control OU (WSRC 1992).

Post-closure requirements will be met by:

Maintaining the integrity and effectiveness of the final cover, including making repairs to the RCRA cap as necessary to correct the effects of settling, subsidence, erosion, or other events;

Maintaining and controlling the groundwater monitoring system and complying with all other applicable requirements;

Taking measures to prevent run-on and runoff from eroding or otherwise damaging the final cover; and

Repairing security control devices.

Remedy Implementation

Implementation of the selected interim action remedy (i.e., the RCRA preventative action) included the following activities:

- Sampling the accumulated rainwater in the basin;
- Treating and discharging excess water to a NPDES permitted outfall;
- Consolidating 344 m^3 (450 yd^3) of contaminated materials by excavating the process sewer line and associated soils and transporting to the top of the contaminated sediments in the basin; and
- Installing a 0.08-hectare (0.2-acre) low permeability cover system over the settling basin consisting of a layer of backfill, a 0.6-m (2-ft) layer of low-permeability compacted kaolin clay with a permeability of 1.0E-07 cm/s or less, a 0.3-m (1-ft) drainage layer, geotextile filter fabric, topped with 0.6 m (2 ft) of vegetative cover (15 cm [6 in] of topsoil over 45 cm [18 in] of common fill), and stormwater conveyance system.

Figure J-4 presents a historical photo of the Met Lab HWMF. Current photographs of the unit are presented in Figures J-5 and J-6. Figure J-7 shows the Met Lab HWMF RCRA Boundary.

Systems Operations/Operation and Maintenance

There are no system operational requirements.

The following maintenance activities are ongoing:

- Post-closure groundwater monitoring to verify that no unacceptable exposure to potential hazards posed by conditions at the OU occur in the future as required per the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025).
- Quarterly site inspections for a minimum of 30 years to verify the integrity of the cover system, OU-specific perimeter fencing, signs, etc. Any necessary repairs will be made as part of the maintenance program.
- Institutional controls (i.e., land use controls [LUCs]) to restrict access to authorized personnel with appropriate training on applicable requirements and to preclude unauthorized access or intrusive activities through the SRS Site Use/Site Clearance program and SRS site security.

Costs associated with the selected remedy for Met Lab HWMF include operation and maintenance (O&M) costs of the soil cover and LUCs. The actual O&M cost during fiscal year (FY) 2021 to FY2025 is $169,083. RCRA documentation does not require estimated project costs to be prepared. However, for the Met Lab HWMF, a cost estimate of $100,000 over the five years is provided in the IROD (WSRC 1992) (Table J-2).

V. PROGRESS SINCE LAST REVIEW

This is the seventh five-year remedy review for the Met Lab HWMF. The previous protectiveness statement from the last five-year review concluded that because the remedial actions at Met Lab HWMF are protective, the site is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are controlled through a maintained cover system and LUCs.

There were no recommendations or follow-up actions from the last five-year review.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed the implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel and documented the results on the Inspection Checklist provided in Attachment J-1; and
- Ensured that all actions required under the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) were implemented (i.e., quarterly inspections, annual subsidence survey reports and maintenance to the soil covers).

Summary of Inspections and Interviews

Scheduled quarterly site inspections were conducted from FY2021 through FY2025 (Various). The field inspection checklists are approved as part of the closure/post-closure/permit application process and are governed by the RCRA Permit Renewal for SRS.. They are available in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/).

Tasks included on the field inspection checklists include:

- Verifying roads to waste units are accessible;
- Verifying signs on the fence are in acceptable condition and are legible from a distance of 7.6 m (25 ft). Signs must include “Danger Unauthorized Personnel Keep Out” and include Post Closure Manager and Savannah River Site Operations Center contact information;
- Verifying fence is in good condition (e.g., shows no signs of serious wear);
- Checking the soil cover and side slopes for signs of erosion, depression (subsidence) and evidence of burrowing animals;
- Checking the integrity of drainage ditches for the presence of excessive erosion, sediment buildup, and any debris restricting water flow;

- Verifying that no woody vegetation is growing on the soil cover, and remove or identify as needed;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m by 0.9 m (3 ft by 3ft) in area. The height of the vegetation should not impair visual inspection of the soil cover. This will be determined by the Inspector;
- Visually performing a condition check of the survey benchmarks for damage and visibility;
- Verifying annual topographic/subsidence survey has been performed by end of June for current year, and verify copies of survey results are in EC&ACP Document Control Center;
- Inspecting A-08 Outfall Diversion Ditch for the presence and debris restricting water flow; and
- Other.

The field inspections identified the following issues: overgrown vegetation, active ant mounds, signs needed to be replaced, minor fencing repairs needed. These findings were documented on the field inspection checklists and resolved soon after discovery.

The Met Lab HWMF OU was inspected by Savannah River Nuclear Solutions, LLC (SRNS) Environmental Compliance and Area Completion Projects (EC&ACP) on August 27, 2025 and included taking current photographs of the Met Lab OU and reviewing the field inspection checklist. No issues were identified during this inspection. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the Met Lab OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the Met Lab HWMF OU that would affect the protectiveness of the remedy.

The Met Lab OU was inspected by SRNS EC&ACP and USDOE personnel on October 28, 2025. No issues were identified for the Met Lab HWMF OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, USEPA and SCDES personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of Met Lab OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection.

The Met Lab HWMF OU was inspected by SCDES on September 4, 2025, as part of the RCRA annual comprehensive groundwater monitoring evaluation. The Met Lab Settling Basin was observed to be in good condition and no issues were identified.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, in situ stabilization/solidification, RCRA soil cover with LUCs, is effective in preventing exposure to contaminant risk above 1E-06 risk levels and mitigating further migration of contaminants to groundwater and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Quarterly site inspections and site maintenance have been effective in maintaining integrity of the soil cover. Based on site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The LUC requirements are discussed and approved as part of the closure/post-closure/ permit application process and are governed by the RCRA Hazardous and Mixed Waste Permit Renewal for the SRS (SCDES 2025). The closure/post-closure requirements are discussed in the RCRA Permit Renewal Application for the M-Area and Metallurgical Laboratory Hazardous Waste Management Facilities (M-Area and Met Lab HWMF)

Postclosure (SRNS 2020). Therefore, a Land Use Control Implementation Plan is not required for this OU.

The LUCs (i.e., RCRA closure/post-closure care requirements) that are in place include physical access controls to prevent unauthorized contact (i.e., OU-specific fencing with locked gates and warning signs posted on the fences), removal or excavation of subsurface soils, and restrictions to prevent disturbance of the Met Lab HWMF OU. Warning signs are in good condition, and no activities were observed that would have violated LUCs. All LUC objectives are being met.

Are the Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still Valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of remedy selection are still valid. There have been no changes in the standards or physical conditions of the Met Lab HWMF OU that would affect the protectiveness of the remedy.

Two applicable or relevant and appropriate requirements (ARARs) were identified in the IROD (WSRC 1992). The first ARAR, a NPDES permit modification for discharge of basin rainwater to an outfall to surface water, has been met as the construction of the cover system is completed. The second ARAR includes SCHWMR R.61-79.265 for RCRA equivalent performance standards for the cap design. The cap was designed to meet the ARAR. Based on the review of this OU, the requirements of the ARAR (i.e. long-term minimization of migration of contaminants, function with minimum maintenance) continue to be met. There have been no changes in standards or to-be-considered guidance identified in the IROD that call into question the protectiveness of the remedy.

The USEPA standards and toxicity values have been updated since submittal of the last five-year remedy review as shown in Appendix B. The changes to the values for COCs at the Met Lab HWMF OU were not significant, and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants, except for PFOS and other PFAS, were identified as applicable to this OU based on the OU history of contamination.

Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this waste unit (Table J-3). However, the engineered cover system in place serves as an effective and protective remedy, mitigating potential exposures and releases associated with PFAS.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues that prevent the remedy for the Met Lab HWMF OU from being protective.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for the Met Lab HWMF OU under CERCLA.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the Met Lab HWMF OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by stabilization and placement of all contaminated materials under a lower permeability cap and LUCs to prevent exposure to or ingestion of contaminated soil media and mitigating further migration of contaminants to groundwater. All threats to the Met Lab HWMF OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the Met Lab HWMF OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2025. *South Carolina Department of Health and Environmental Control Hazardous and Mixed Waste Permit, Permit Number SC1 898 008 989, 2025 RCRA Permit Renewal for the Savannah River Site, issued on October 27, 2025, Module III - Postclosure Care and Module IV – Groundwater Requirements, Section A, M-Area and Metallurgical Laboratory Hazardous Waste Management Facilities*, South Carolina Department of Environmental Services, Division of Waste Management, Bureau of Land and Waste Management, Columbia, SC

SRNS, 2020. *2013 RCRA Permit Renewal Application (U), Volume III, M-Area and Metallurgical Laboratory Hazardous Waste Management Facilities (M-Area and Met Lab HWMFs) Postclosure*, SRNS-IM-2012-00002, Revision 4, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1991. *Metallurgical Laboratory Hazardous Waste Management Facility Closure Plan* WSRC-RP-92-423, Revision 5, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1992. *Interim Action Record of Decision Remedial Alternative Selection, Metallurgical Laboratory Hazardous Waste Management Facility Operable Unit (U),* WSRC-RP-92-745, Revision 0, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

Various - Inspection Data Sheets – *Field Inspection Checklist, Metallurgical Laboratory HWMF Post Closure Inspection (U)*, ER-IDS-019-020, Inspection Period FY2021 to FY2025 (quarterly)

This page is intentionally left blank.

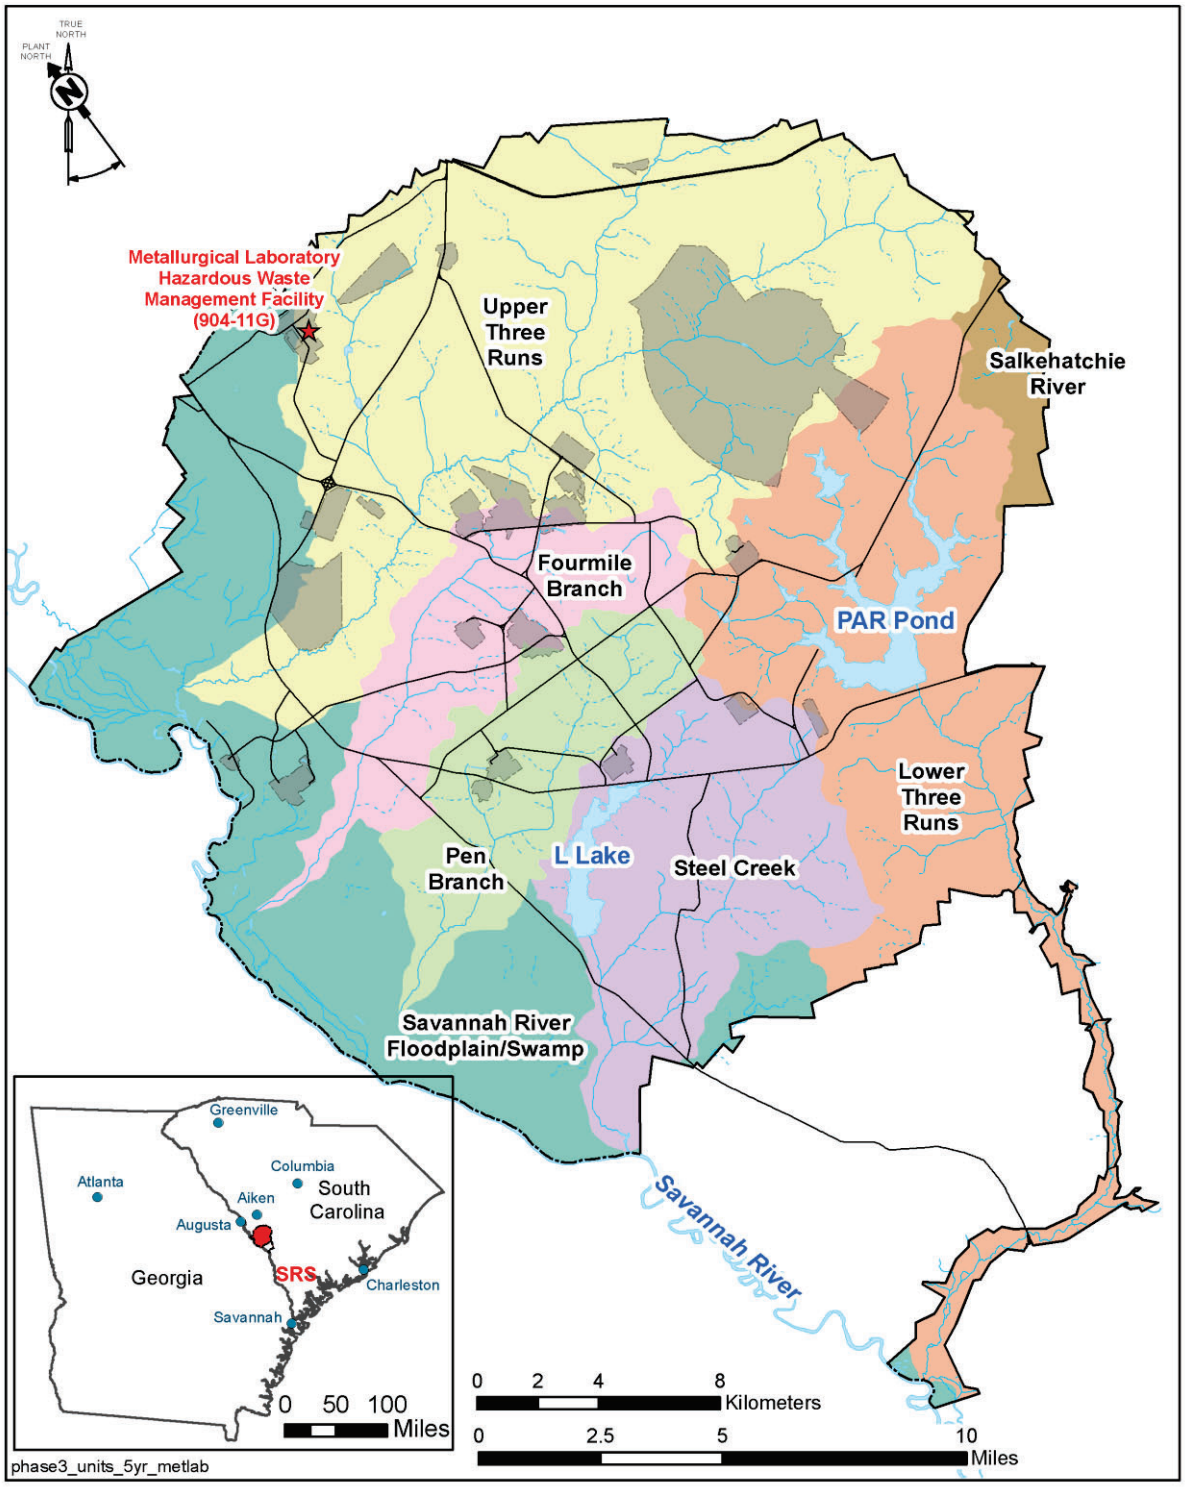


Figure J-1. Location of the Met Lab HWMF OU at SRS

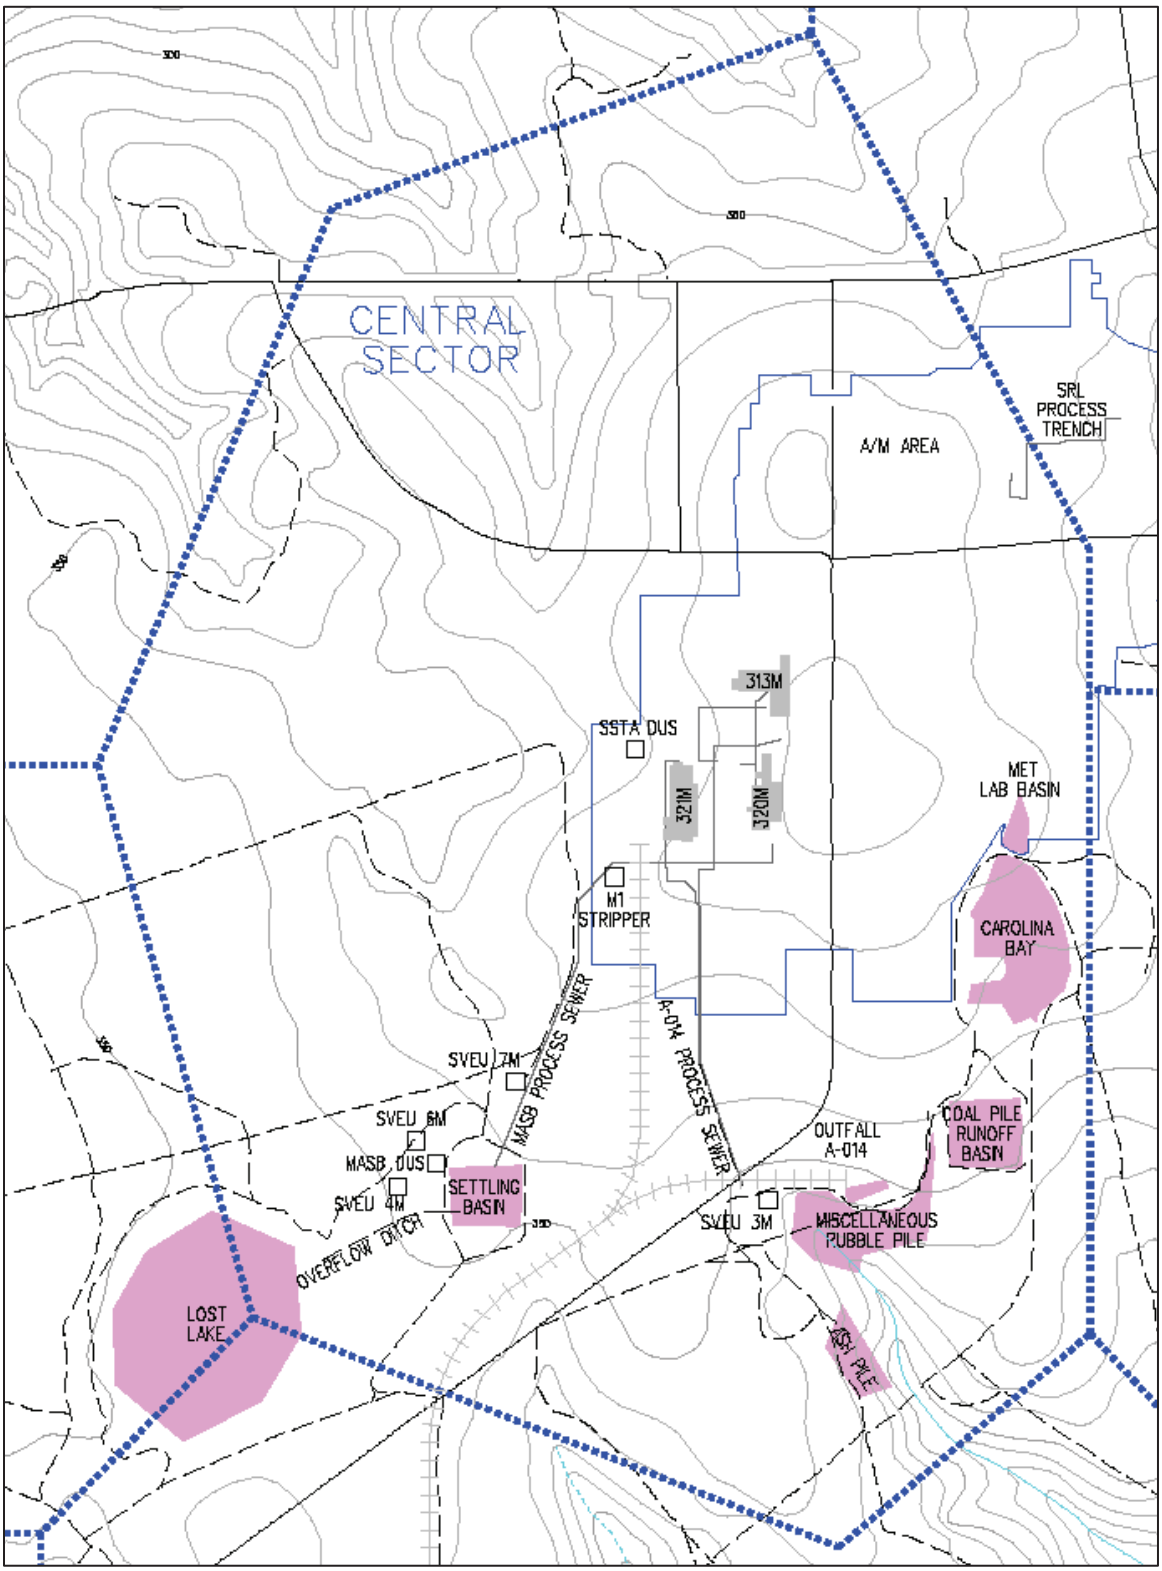


Figure J-2. Location of the Met Lab HWMF OU within the A/M Area Groundwater Central Sector at SRS

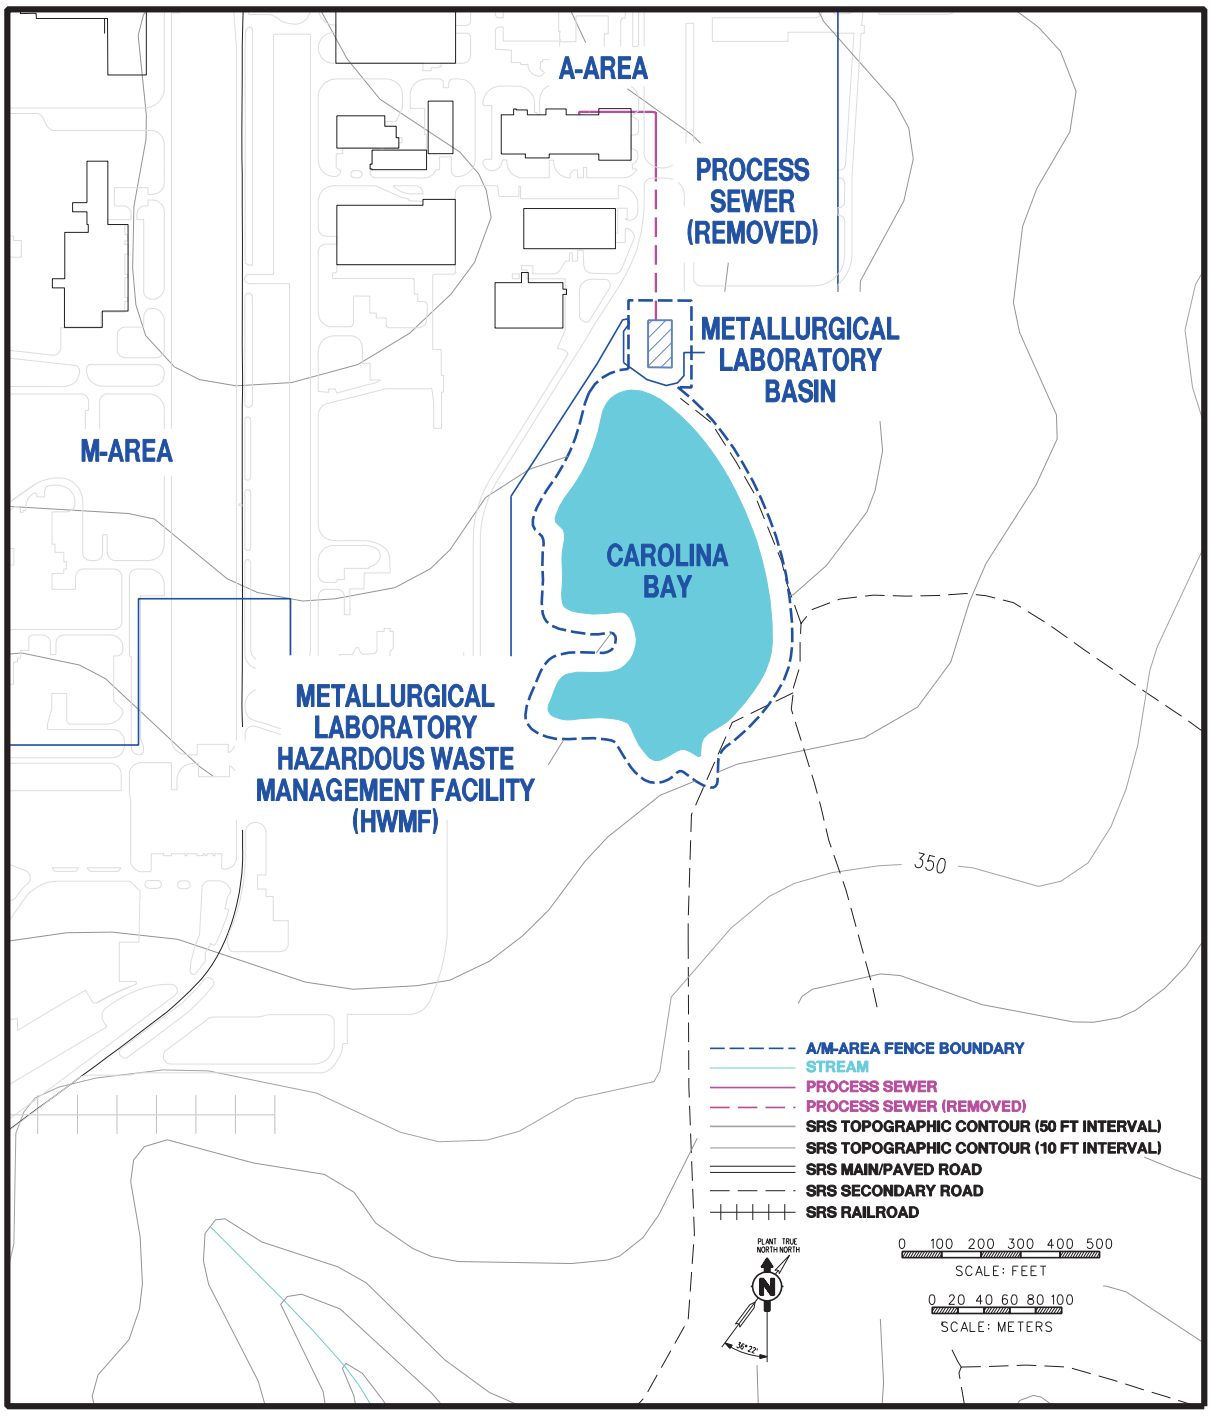


Figure J-3. Site Layout of Met Lab HWMF OU at SRS



Figure J-4. Historical Photograph of the Met Lab HWMF OU (1991)



Figure J-5. Photograph of the Met Lab HWMF OU Covered Basin (2025)



Figure J-6. Aerial Photograph of the Met Lab HWMF OU Covered Basin (2025)

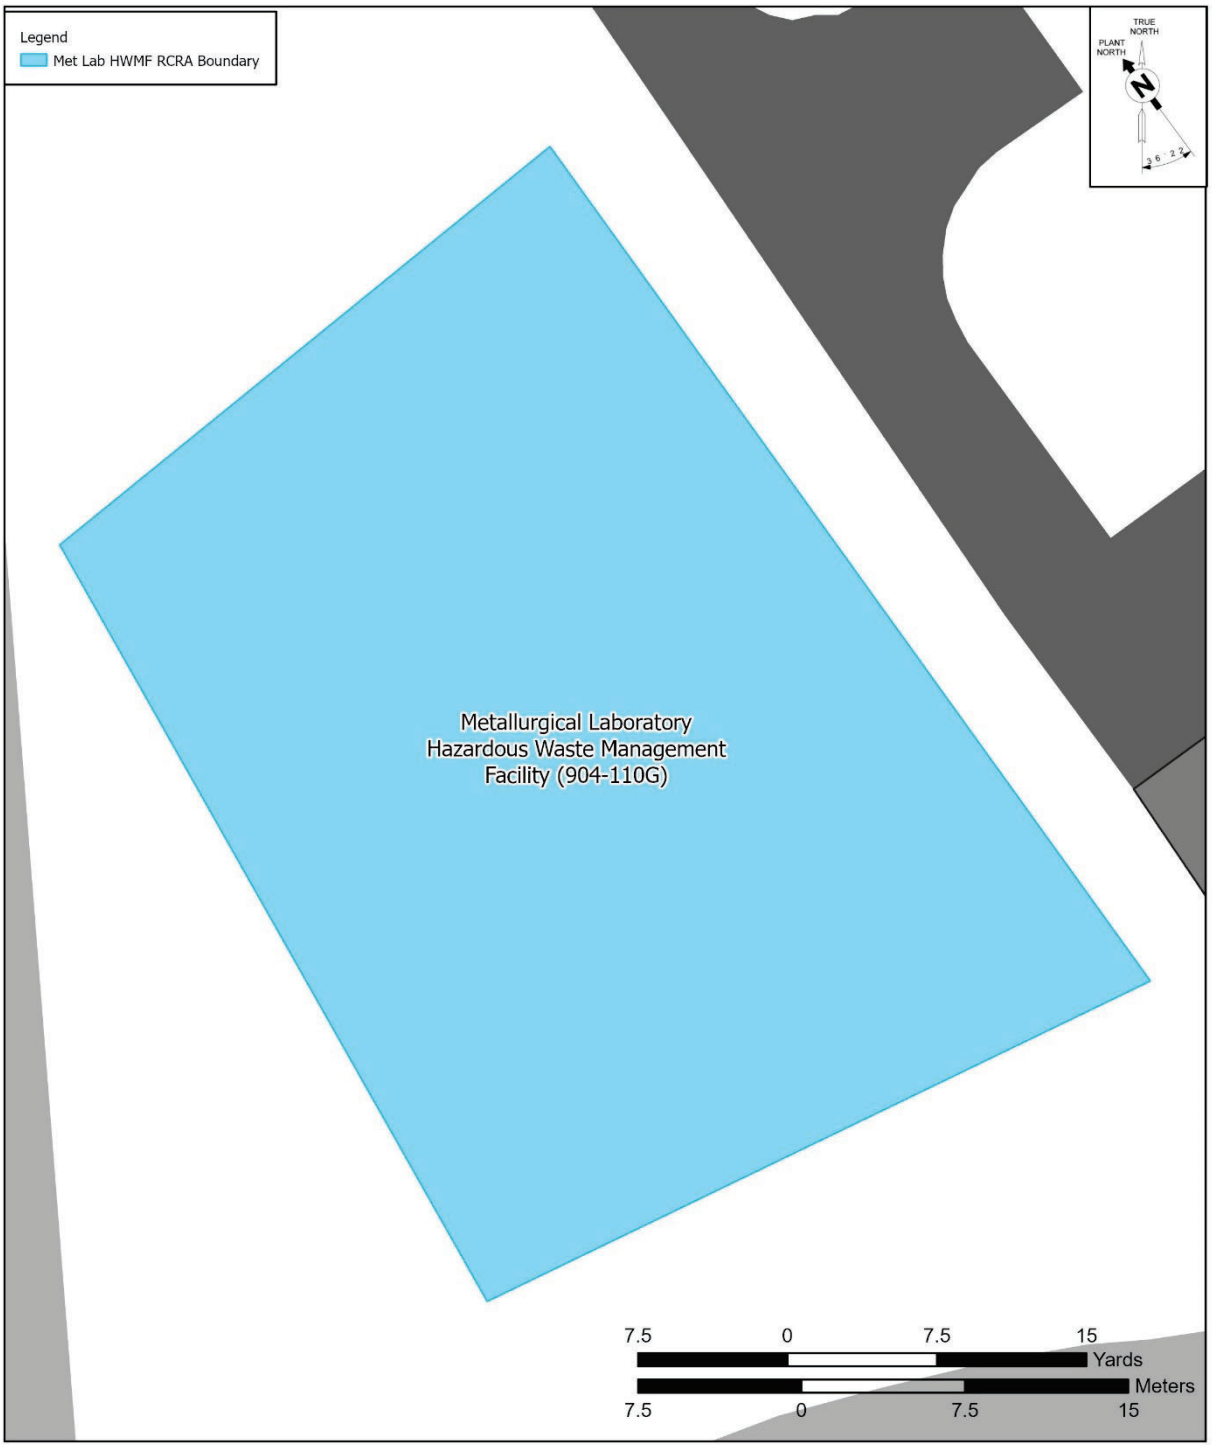


Figure J-7. Met Lab HWMF OU RCRA Boundary

This page is intentionally left blank.

Table J-1. Chronology of OU Events

Event	Date
Corrective Action Start	1991
RCRA Closure Certified	June 1991
IROD Issuance	September 16, 1992
Previous Five-Year Reviews Issuance	August 27, 1997 / February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table J-2. Actual versus Estimate Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	Five-Year Total
Total Actual O&M Costs ($)	51,514	23,609	24,596	26,160	43,204	169,083
Total ROD Estimated Direct O&M Costs ($)	20,000	20,000	20,000	20,000	20,000	100,000

RCRA documentation does not require estimated project costs to be prepared. However, an estimated cost was provided in the Met Lab HWMF IROD (WSRC 1992).

Table J-3. PFOS/PFAS Screening Results for the Met Lab OU

Operable Unit Name:	**Met Lab**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	**Yes**	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	**Yes**	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this operable unit.**	

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU

I. SITE INFORMATION			
Site Name:	**Metallurgical Laboratory Hazardous Waste Management Facility (904-110G)**	**Date of Inspection:**	**08/27/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #2**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Sunny 78°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☒ Other Consolidation, Excavation, Disposal

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. O&M Staff: Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949

Problems/Suggestions: ☐ Report Attached

2. O&M Staff: Eric Barron (Name) | EC&ACP Post-Closure Waste Site O&M Staff Member (Title) | 09/09/2025 (Date)

Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395

Problems/Suggestions: ☐ Report Attached

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. **Local Regulatory Authorities and Response Agencies** (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

_____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

_____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

_____

4. **Other Interviews** *(Optional):* ☐ Report Attached _____

_____

_____

_____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. **O&M Documents:**

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Met Lab HWMF Field Inspection Checklist, ER-IDS-019-020* (FY2021 to FY2025 [quarterly])

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is discussed in Section IV of this OU-specific review:

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons:

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☒ Gates secured ☐ N/A

Remarks: OU-specific perimeter fencing is required by the remedial action. Perimeter fencing was in good condition.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Charles Bryan (Name) | DOE Program Manager (Title) | 10/28/2025 (Date) | 803-952-7505 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks: Survey monuments were located and in good condition.

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

VI. GENERAL SITE CONDITIONS

A. Roads ☒ Applicable ☐ N/A

1. Roads damaged: ☒ Location shown on site map ☒ Roads adequate ☐ N/A

Remarks:

B. Other Site Conditions

Remarks: Inspections conducted quarterly from FY2021 through FY2025 identified overgrown vegetation, active ant mounds, signs needing to be replaced, minor fencing repairs needed. These issues were resolved soon after discovery.

VII. LANDFILL COVER/CONTAINMENT ☒ Applicable ☐ N/A

A. Landfill Surface

1. Settlement (Low spots)**:** ☐ Location shown on site map ☒ Settlement not evident

Areal extent _____ Depth _____

Remarks:

2. Cracks: ☐ Location shown on site map ☒ Cracking not evident

Lengths _____ Widths _____ Depths _____

Remarks:

3. Erosion: ☐ Location shown on site map ☒ Erosion not evident

Areal extent _____ Depth _____

Remarks:

4. Holes: ☐ Location shown on site map ☒ Holes not evident

Areal extent _____ Depth _____

Remarks:

5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☒ No signs of stress

Areal extent _____ Depth _____

Remarks: Vegetation is mowed routinely.

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A
Remarks:

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident
Areal extent Depth
Remarks:

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident
☐ Wet areas ☐ Location shown on site map Areal extent
☐ Ponding ☐ Location shown on site map Areal extent
☐ Seeps ☐ Location shown on site map Areal extent
☐ Soft subgrade ☐ Location shown on site map Areal extent
Remarks:

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability
Areal extent
Remarks:

B. Benches ☐ Applicable ☒ N/A
(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A
(Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

D. Cover Penetrations ☐ Applicable ☒ N/A

E. Gas Collection and Treatment ☐ Applicable ☒ N/A

F. Cover Drainage Layer ☒ Applicable ☐ N/A

1. Outlet Pipes Inspected: ☐ Functioning ☒ N/A
Remarks:

2. Outlet Rock Inspected: ☒ Functioning ☐ N/A
Remarks:

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*		
G. Detention/Sedimentation Ponds	☐ Applicable	☒ N/A
H. Retaining Walls	☐ Applicable	☒ N/A
I. Perimeter Ditches/Offsite Discharge	☒ Applicable	☐ N/A

1. Siltation: ☐ Location shown on site map ☒ Siltation not evident
Areal extent_____ Depth_____
Remarks:_____

2. Vegetative Growth: ☐ Location shown on site map ☐ N/A
☒ Vegetation does not impede flow
Areal extent_____ Type_____
Remarks:_____

3. Erosion: ☐ Location shown on site map ☒ Erosion not evident
Areal extent_____ Depth_____
Remarks:_____

4. Discharge Structure: ☐ Location shown on site map ☒ N/A
Remarks:_____

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A

X. OTHER REMEDIES

If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.

A. Consolidation, Excavation, Disposal ☒ Applicable ☐ N/A

Consolidation, Excavation, and Disposal were performed at Met Lab HWMF. The remedy is performing as designed.

Attachment J-1. Five-Year Review Site Inspection Checklist – Metallurgical Laboratory Hazardous Waste Management Facility (904-110G) OU *(continued/end)*

XI. OVERALL OBSERVATIONS
A. Implementation of the Remedy
Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.). The remedy of stabilizing the basin contents, consolidating contaminated materials in the basin, and installing and maintaining a low permeability cap is designed to prevent physical exposure to contaminants and to mitigate further migration of contaminants to the groundwater. The cover system is intact, long-term grasses have been fully established. The soil cover system remedy appears to be functioning as designed. Drainage channels are functioning adequately.
B. Adequacy of O&M
Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy. The O&M procedures consisting of quarterly site inspections and site maintenance (repair of erosion damage, cover system, fencing and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the OU) have been implemented. The O&M procedures are adequately maintaining the Met Lab HWMF OU and the condition of the warning signs is good. When maintenance activities are identified during inspections (e.g., treating ant mounds, vegetation removal replacing signs repairing fencing), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the Met Lab HWMF OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.
C. Early Indicators of Potential Remedy Failure
Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future. N/A
D. Opportunities for Optimization
Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy. N/A

End of Checklist

This page is intentionally left blank.

APPENDIX K. MIXED WASTE MANAGEMENT FACILITY (643-28E) OPERABLE UNIT

I. INTRODUCTION

This report is the seventh five-year review for the Mixed Waste Management Facility (643-28E) (MWMF) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants have been left in place at the MWMF OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the MWMF OU is protective of human health and the environment. This report documents the results of the review.

The remedy for this unit is conducted under the Savannah River Site (SRS) Resource Conservation and Recovery Act (RCRA) program. The Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) remediation requirements are met by the RCRA program; therefore, no further remedial action is necessary under CERCLA.

II. OU CHRONOLOGY

Table K-1 lists the chronology of site events for the MWMF OU.

III. BACKGROUND

MWMF OU is listed as a RCRA Unit in Appendix C of the Federal Facility Agreement (FFA) for SRS (FFA 1993). The media associated with the MWMF OU is soil.

The groundwater is being addressed by the MWMF Groundwater OU. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS.

Physical Characteristics

The MWMF OU is located in the central portion of SRS between F- and H-Areas, approximately 8 km (5 mi) from the nearest site boundary (Figures K-1 and K-2). The MWMF is a source-specific OU within the Burial Ground Complex and within the Upper Three Runs Watershed. The MWMF consists of 118 slit trenches, one engineered low-

level trench (ELLT), and a naval core barrel mound. This facility comprises approximately 23.5 hectares (58 acres).

The slit trenches are generally 6 m (20 ft) deep and 6 m (20 ft) wide with varying lengths up to 360 m (1200 ft). The trenches were spaced approximately 3 m (10 ft) apart. The trenches were backfilled with natural soil during landfilling operations to minimize the potential for fire and airborne releases. This practice was modified in 1985 with the initiation of ELLT operation, which consisted of stacking waste containerized in B-25 boxes (metal disposal containers, 1.2 m x 1.2 m x 1.8 m [4 ft x 4 ft x 6 ft] in dimension) in the trench completely before backfilling the trench. The dimensions of the ELLT are 40.2 m (134 ft) by 150 m (500 ft) by 6.6 (22 ft) deep. Approximately 9,600 B-25 boxes were placed in ELLT-1. An earthen mound was used for the disposal of naval reactor equipment.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999a) designates the MWMF OU as being within an industrial area. The future land use for the MWMF OU is reasonably anticipated to remain industrial with U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

The MWMF operated from 1969 until March 11, 1986. During that time, this facility received low-level radioactive waste materials produced at SRS. Some of these materials are classified under RCRA as mixed waste containing both hazardous and radioactive components. Waste from SRS was disposed of in the form of job control waste and sent to the MWMF (e.g., rags, gloves and coveralls, soil, construction debris, failed equipment, spent air filters, spent lithium-aluminum targets, irradiated scrap metal, naval reactor hardware, lead shielding, waste oil, scintillation fluids, cadmium, and silver-coated beryl saddles).

Initial Response

RCRA preventive actions at the MWMF were conducted pursuant to the requirements of the RCRA per Settlement Agreement 87-27-SW.

Closure of the MWMF began in 1988, per the South Carolina Department of Environmental Services (SCDES) approved closure plan (WSRC 1991) and was completed in December 1990. The MWMF was closed by compaction of the waste in place via dynamic compaction followed by placement of a protective low-permeability multi-layer cover system over the waste trenches to reduce rainwater contact with wastes.

The MWMF was certified closed in 1991 and was accepted by SCDES in April 1991 as being in compliance with RCRA requirements.

Basis for Taking Action

In 1984, SRS made an administrative decision to determine the extent of mixed waste deposited in the Low-Level Radioactive Waste Disposal Facility (LLRWDF). Through researching records and analysis of mixed wastes against RCRA regulations, SRS determined that the area within LLRWDF referred to as the MWMF contained mixed wastes.

A RCRA Closure Plan was submitted to SCDES in 1985 with approval in 1987. The RCRA closure of the MWMF began in 1988 and was completed in December 1990. The RCRA preventive activities at the MWMF became subject to CERCLA when the entire SRS facility was placed on the National Priorities List in December 1989.

Per the approved 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025), post-closure care is regulated under SCHWMR R.61-79-264. In addition, an ongoing corrective action and monitoring program at the MWMF is administered through the 2025 RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025). The monitoring program consists of monitoring for impacts to groundwater, seepline surface water, and surface water of Fourmile Branch and Upper Three Runs.

Statistical analyses on data collected since 1991 were performed to determine COCs. The COCs identified at the MWMF OU are barium, chloroform, cadmium, 1,1-dichloroethane,

vinyl chloride, trans-1,2-dichloroethylene, phenol, aluminum, iron, manganese, carbon-14, lead, tritium, nickel, tetrachloroethylene, TCE, zinc, uranium-234/235, and uranium-238 (WSRC 1994). No remedial goals (RGs) were identified in the Record of Decision (ROD) for these constituents.

IV. REMEDIAL ACTIONS

Remedy Selection

Preventative alternatives were developed for the MWMF within the RCRA closure process in 1988. As documented in the MWMF OU ROD, the RCRA closure was selected as the final action under CERCLA. Therefore, no further action under CERCLA was necessary for the MWMF OU (WSRC 1994).

The closure design for the MWMF was consistent with requirements of: RCRA, 40 Code of Federal Regulation 265, South Carolina Hazardous Waste Management Regulations R.61-79.265, and USDOE Order 5820.2 Radioactive Waste Management.

The MWMF was closed according to the approved Closure Plan (WSRC 1991).

The remedial action objectives (RAOs) were to prevent the physical exposure to contaminants and to mitigate further migration of contaminants to the groundwater by minimizing a liquid medium pathway (rainwater percolation) for transport. The MWMF RCRA preventative action of placement of all contaminated materials under a low-permeability cap and institutional controls (i.e., Land Use Controls [LUCs]) satisfied both RAOs.

Post-closure requirements will be met by:

- Maintaining the integrity and effectiveness of the final cover, including making repairs to the RCRA cap as necessary to correct the effects of settling, subsidence, erosion, or other events;
- Taking measures to prevent run-on and runoff from eroding or otherwise damaging the final cover; and
- Repairing security control devices.

Remedy Implementation

Implementation of the selected final action remedy (i.e., the RCRA preventative action) included the following activities:

- Pre-compacting the waste by dynamic compaction to minimize future differential waste settlement;
- Backfilling after compaction to a level 1.5 m (5 ft) below the final cover elevations; and
- Placed a 23.5-hectare (58-acre) low permeability cover system over the waste trenches consisting of a layer of back fill, a 0.6-m (2-ft) layer of low-permeability compacted kaolin clay with a permeability of 1.0E-07cm/s or less, topped with 0.6 m (2 ft) of topsoil to support a vegetative cover, cap surface drainage and stormwater conveyance system. Later in 1994, portions of the RCRA LLRWDF 5.3-hectare (13-acre) geosynthetic cover system was tied into the MWMF cover system. The LLRWDF closure consisted of twelve discrete areas (i.e., ELLT-2, ELLT-3, ELLT-4, and Trench Areas 1 to 9 [Figure K-2]). The MWMF small cap was covered by the ELLT-2 and Trench Area 7 cover system. ELLT-3 and Trench Areas 1, 3 to 6, and 8 were integrated into the MWMF cover system (WSRC 1999b).

Figures K-3 and K-4 provides current photographs of the MWMF OU.

Systems Operations/Operation and Maintenance

There are no operational requirements.

The following maintenance activities are ongoing:

- Inspection and repair, as necessary, of the groundwater monitoring wells associated with the post-closure groundwater monitoring program for the MWMF.
- Quarterly site inspections for a minimum of 30 years to verify the integrity of the cover system, OU-specific perimeter fencing, signs, etc. Any repairs will be made as necessary to maintain the integrity and effectiveness of the initial cover including

making repairs to the surface cap as necessary to correct the effects of settling, subsidence, erosion, or other events.

- LUCs to restrict access to authorized personnel with appropriate training on applicable requirements and preclude unauthorized access or intrusive activities through the SRS Site Use/Site Clearance program and SRS site security. The survey plat and records associated with deed restriction use of the MWMF have been filed with Aiken County.

Operation and maintenance (O&M) costs associated with the selected remedy for MWMF OU include costs of the soil cover inspection and maintenance, LUCs and five-year remedy reviews. The actual O&M cost during fiscal year (FY) 2021 to FY2025 is $1,409,197. RCRA documentation does not require estimated project costs to be prepared. Therefore, actual cost data comparison to estimated cost data is not included in this remedy review.

V. PROGRESS SINCE LAST REVIEW

This is the seventh five-year remedy review for the MWMF OU. The previous protectiveness statement from the last five-year review concluded that because the remedial actions at MWMF OU are protective, the site is protective of human health and the environment. Exposure pathways that could result in unacceptable risks are controlled through a maintained cover system and LUCs in place while USDOE controls the OU.

There were no recommendations or follow-up actions from the last five-year review.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed implementation of the remedial action;
- Inspected the OU, interviewed maintenance personnel, and documented the results on the Inspection Checklist provided in Attachment K-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and

- Ensured that all actions required under the RCRA Hazardous and Mixed Waste Permit Renewal (SCDES 2025) were implemented (i.e., quarterly inspections and maintenance to the soil covers and groundwater monitoring).

Data Review

Groundwater

Fact sheets provided on the U.S. Environmental Protection Agency (USEPA) webpage regarding emerging contaminants were reviewed for applicability to this site. Due to the presence of chlorinated solvents at MWMF, 1,4-dioxane was identified as a potential contaminant for the groundwater and has been sampled dating back to 1992. As shown in Figure K-5, 1,4-dioxane has been detected in the Southwest Plume (SWP), comingled with the tritium plume, both are sourced from the ORWBG. As previously stated, groundwater is regulated by the RCRA Hazardous Waste Permit Renewal (SCDES 2025) and is addressed in the MWMF Groundwater OU.

The low permeability cap over the Old Radiological Waste Burial Ground (ORWBG) has reduced the tritium concentration in the SWP by approximately 40%. Source term control from the cap and advective depletion of the aquifer should cause the concentration of the 1,4-dioxane in the aquifers and pond to be significantly reduced with time (SRNS 2025). The current phytoremediation/spray irrigation system operating in the SWP to address the tritium appears to be curtailing expansion of the 1,4-dioxane plume. 1,4-dioxane is prone to volatilization and photo-oxidation in air (7 to 10-hour half-life, maximum lifetime of 23 hours) in a spray irrigation setting (SRNS 2025). The remedial approach for the 1,4-dioxane is described in the 2023 RCRA Permit Renewal Application for the MWMF (SRNS 2024).

Summary of Inspections and Interviews

Scheduled quarterly site inspections were conducted from FY2021 through FY2025 (Various). The field inspection checklists are approved as part of the closure/post-closure/permit application process and are governed by the RCRA Permit Renewal for

SRS. They are available in the Administrative Recored File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/).

Tasks included on the field inspection checklists include:

- Verifying roads to waste units are accessible;
- Verifying waste unit signs (24) are in acceptable condition, have correct information and are legible from a distance of 7.6 m (25 ft) and refer to Manual C.3, Vol. 1, ER-SOP-019, for source document;
- Verifying fence wire, posts, gates, other areas of fence are intact and in good condition, both inside and outside the perimeter fence;
- Checking for excessive vegetation growing over fences which may obstruct warning signs or visibility of the closure cover;
- Inspecting closure cover and check for erosion, uncovered buried waste, abnormal soil cracks, and presence of burrowing animals;
- Checking integrity of concrete-lined drainage channels inside and outside fenced areas for the presence of erosion or debris restricting water flow. Build-up of debris/ sedimentation in drainage ditches is not to exceed 5 cm (2 in). Ditches are designed to collect run-off and divert run-on. Standing water in the ditches or on the cover is not exceed defined limits;
- Visually checking the cover and side slopes for signs of ponding, slumping, excessive erosion, and any observable depressions indicating subsidence;
- Visually checking vegetative cover for grasses density with no bare spots more than 0.9 m by 0.9 m (3 ft by 3 ft) in diameter. There should be no woody vegetation or shrubs growing on the closure covers. The height of vegetative cover should not impair visual inspection of closure. This will be determined by the EC&ACP Post Closure Inspector;
- Visually checking subsidence monitors for damage visibility;

- Visually performing a condition check of survey benchmarks for damage and visibility;
- Verifying unattended gates are locked to prevent unauthorized entry;
- Verifying annual elevation surveys of the subsidence monitors have been performed by end of November for the current year. Verifying copies of survey results are in the EC&ACP Document Control Center;
- (Inspector) Verifying in January, April, July, and October, previous "Quarterly Monitoring Well inspector Report" has been sent to EC&ACP Document Control Center. This report can be obtained from EC&ACP Post-Closure Well Maintenance Group;
- Checking gas vents for signs of damage for obstructions; and
- Other.

The field inspections identified the following issues: active ant mounds, a sign needing to be replaced, minor rutting from mowing equipment, cracked, chipped, and/or failing concrete, and clearing of debris and repairs to drainage channels. These findings were documented on the field inspection checklists and resolved soon after discovery.

The MWMF OU was inspected by Savannah River Nuclear Solutions, LLC (SRNS) Environmental Compliance and Area Completion Projects (EC&ACP) on August 27, 2025 and included taking current photographs of the MWMF OU and reviewing the field inspection checklist. No issues were identified for the MWMF during this inspection that would affect the protectiveness of the remedy. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified for the MWMF OU during these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024 with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the MWMF OU that would affect the protectiveness of the remedy.

The MWMF OU was inspected by SRNS EC&ACP and USDOE personnel on October 29, 2025. No issues were identified for the MWMF during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, USEPA and SCDES personnel was held on March 19, 2026. SRNS and USDOE personnel were also present at the meeting. During the meeting, the participants viewed drone footage of MWMF OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for MWMF OU as implemented were identified during the inspection.

The MWMF OU was inspected by SCDES on September 4, 2025, as part of the RCRA annual comprehensive groundwater monitoring evaluation. The MWMF OU was observed to be in good condition and no issues were identified.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, in-situ stabilization/solidification, RCRA soil cover with LUCs, is effective in preventing exposure to contaminant risk above 1E-06 risk levels and mitigating further migration of contaminants to groundwater and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Quarterly site inspections and site maintenance have been effective in maintaining integrity of the soil cover. Based on site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The LUC requirements are discussed and approved as part of the closure/post-closure/ permit application process and are governed by the RCRA Hazardous and Mixed Waste Permit Renewal for the SRS (SCDES 2025). The closure/post-closure requirements are discussed in the 2023 RCRA Permit Renewal Application for the MWMF Postclosure (SRNS 2024). Therefore, a Land Use Control Implementation Plan is not required for this OU.

The LUCs (i.e., RCRA closure/post-closure care requirements) that are in place include physical access controls to prevent unauthorized contact (i.e., OU-specific fencing with locked gates and warning signs posted on the fences), removal or excavation of subsurface soils, and restrictions to prevent disturbance of the MWMF OU. Warning signs are in good condition, and no activities were observed that would have violated LUCs. All LUC objectives are being met.

Are the Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still Valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of final remedy selection are still valid. There have been no changes in the standards or physical conditions of the MWMF OU that would affect the protectiveness of the remedy.

As the remedial work has been completed, the applicable standards, set forth in the ROD (WSRC 1994) and RCRA closure plan (WSRC 1991), have been met. All standards and to-be-considered values associated with groundwater will be addressed as part of the MWMF Groundwater OU. Groundwater corrective actions are performed under the RCRA Hazardous and Mixed Waste Permit Renewal for SRS.

The USEPA standards and toxicity values have been updated since submittal of the last five-year remedy review as shown in Appendix B. The changes to the values for COCs at the MWMF OU included some decreases in the RSLs due to updated input values used to calculate the RSLs. The residential soil screening level for lead decreased from 400 mg/kg to 200 mg/kg. If other sources of lead are present, the screening level is 100 mg/kg. However, these changes do not affect the protectiveness of the remedy and RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene

(DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. 1,4-dioxane was identified in 1992 and was added to the Groundwater Protection Standards for the SWP emanating from the MWMF (SRNS 2024). The 2023 RCRA Renewal Application (SRNS 2024) describes the corrective action for 1,4-dioxane.

Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this waste unit (Table K-3). However, the engineered cover system in place serves as an effective and protective remedy, mitigating potential exposures and releases associated with PFAS.

None of the other listed emerging contaminants were identified as applicable to this OU.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that could call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues that prevent the remedy for the MWMF OU from being protective.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for the MWMF OU under CERCLA.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the MWMF OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risk are being controlled by stabilization and placement of all contaminated material under a low-permeability cap and LUCs to prevent exposure to or ingestion of contaminated soil media and mitigating further

migration of contaminants to groundwater. All threats to the MWMF OU are being addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the MWMF OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

SCDES, 2025. *South Carolina Hazardous and Mixed Waste Permit, Permit Number SC1 898 008 989, 2025 RCRA Permit Renewal for the Savannah River Site, issued on October 27, 2025, Module IV - Postclosure Care and Module IV – Groundwater Requirements, Section D, Mixed Waste Management Facility*, South Carolina Department of Environmental Services, Division of Waste Management, Bureau of Land and Waste Management, Columbia, SC

SRNS, 2024. *2023 RCRA Permit Renewal Application: Mixed Waste Management Facility (MWMF) Post Closure*, SRNS-IM-2022-00158, Volume VII, Revision 1, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

SRNS, 2025. *Annual Corrective Action Report for the F-Area Hazardous Waste Management Facility, the H-Area Hazardous Waste Management Facility, and the Mixed Waste Management Facility (U),* SRNS-RP-2025-00773, Volume I, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1991. *Mixed Waste Management Facility (MWMF) Closure Plan*, Revision 4, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1994. *Final Record of Decision Remedial Alternative Selection for Mixed Waste Management Facility (U),* WSRC-RP-93-1511, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999a. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

WSRC, 1999b. *Mixed Waste Management Facility Closure Plan (LLRWDF), Volume II (U)*, Q-CLP-E-00001, Revision 4, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

Various - Inspection Data Sheets – *Field Inspection Checklist, Mixed Waste Management Facility Post Closure Inspection (U)*, ER-IDS-019-018, Inspection Period FY2021 to FY2025 (quarterly)

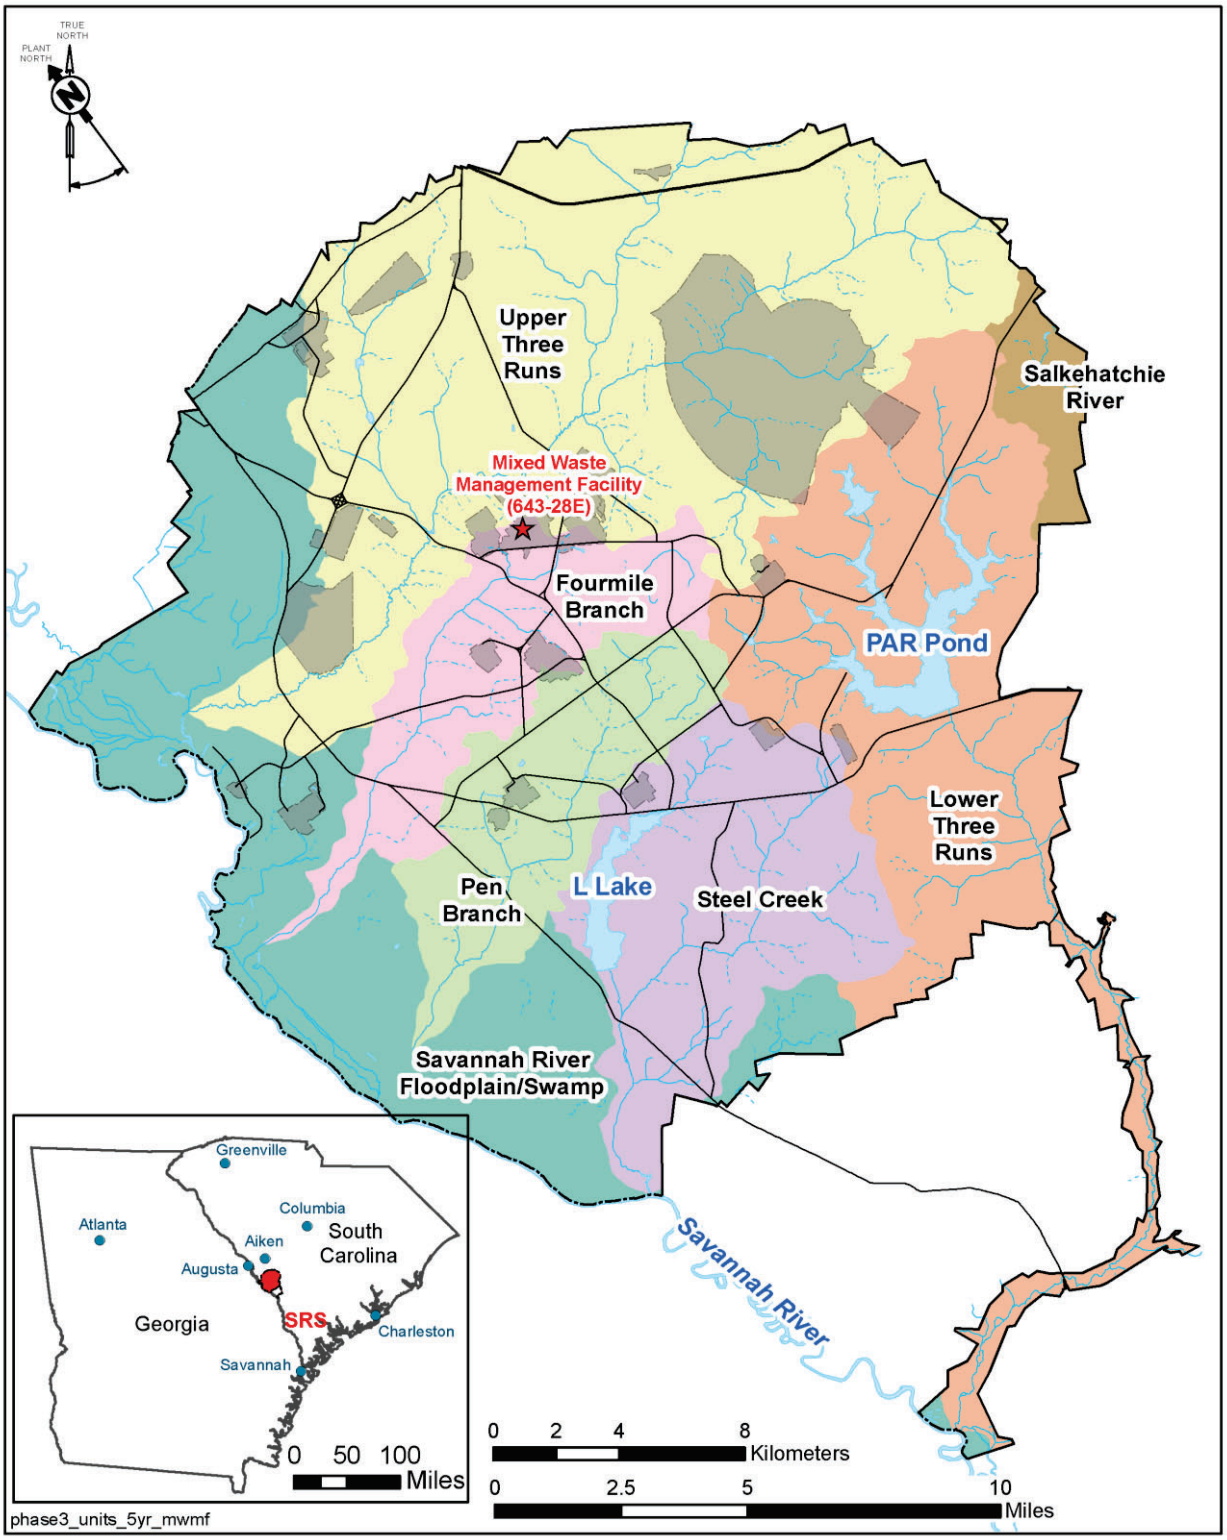


Figure K-1. MWMF OU at SRS

This page is intentionally left blank.

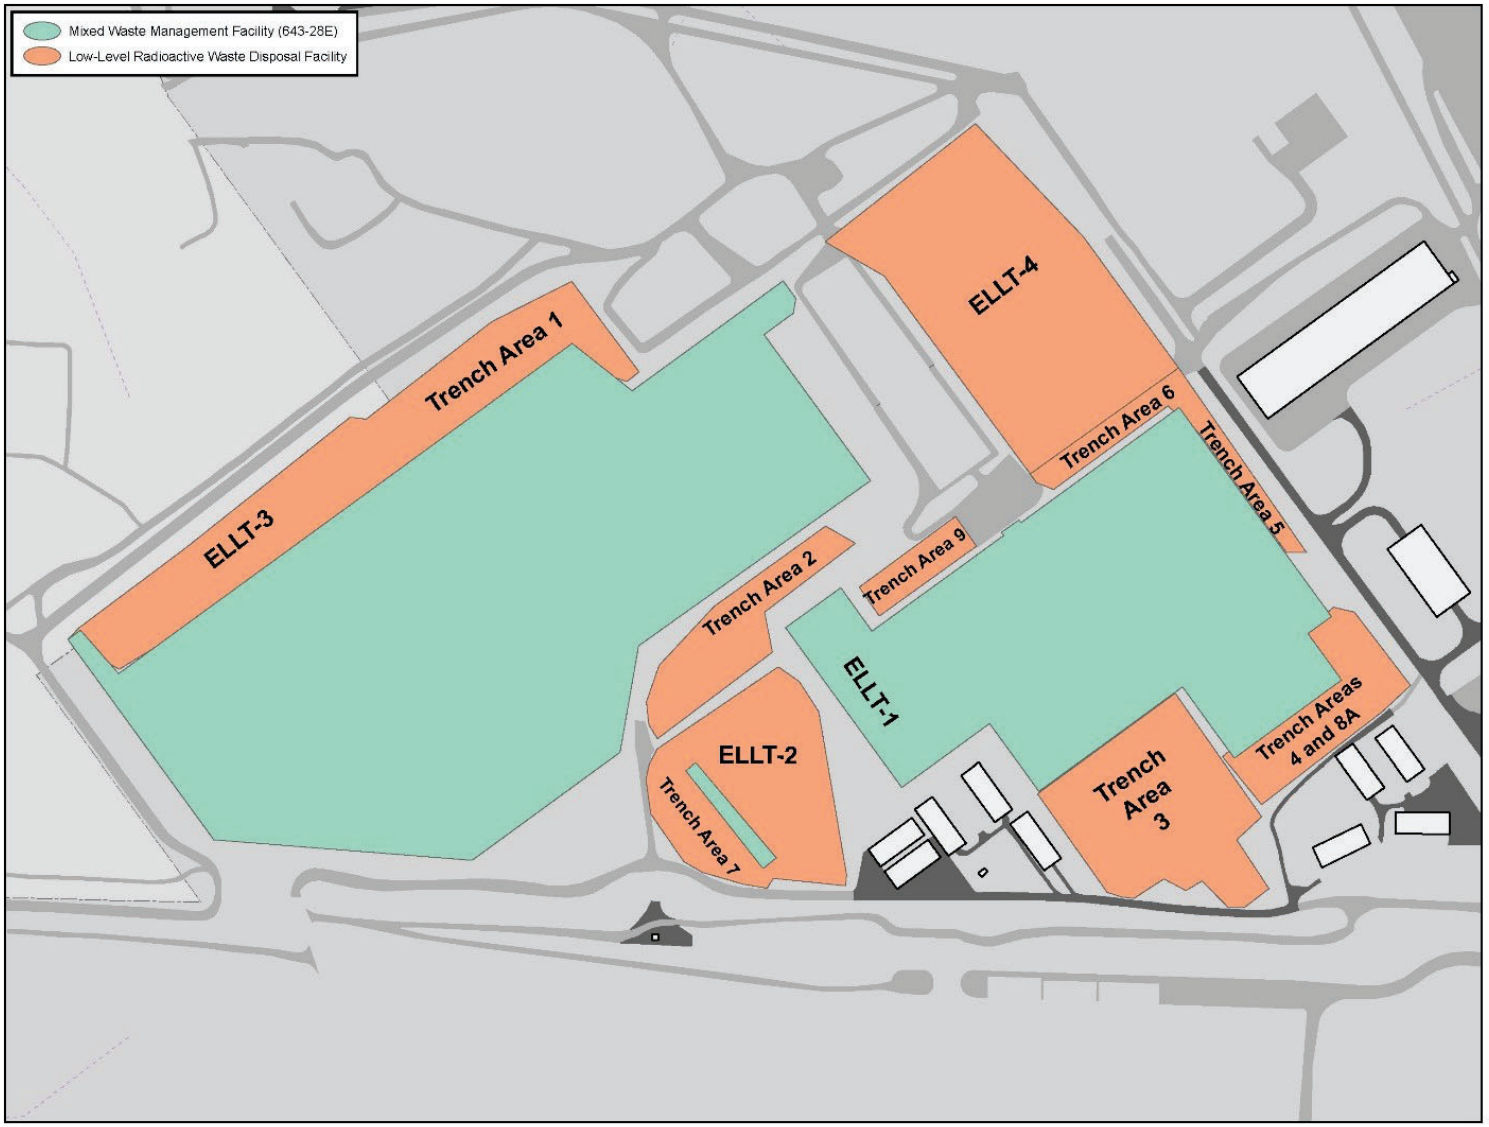


Figure K-2. LLRWDF Units in Relation to MWMF Units



Figure K-3. Current Surface Photographs of the MWMF OU (2025)



Figure K-4. Current Aerial Photographs of the MWMF OU (2025)

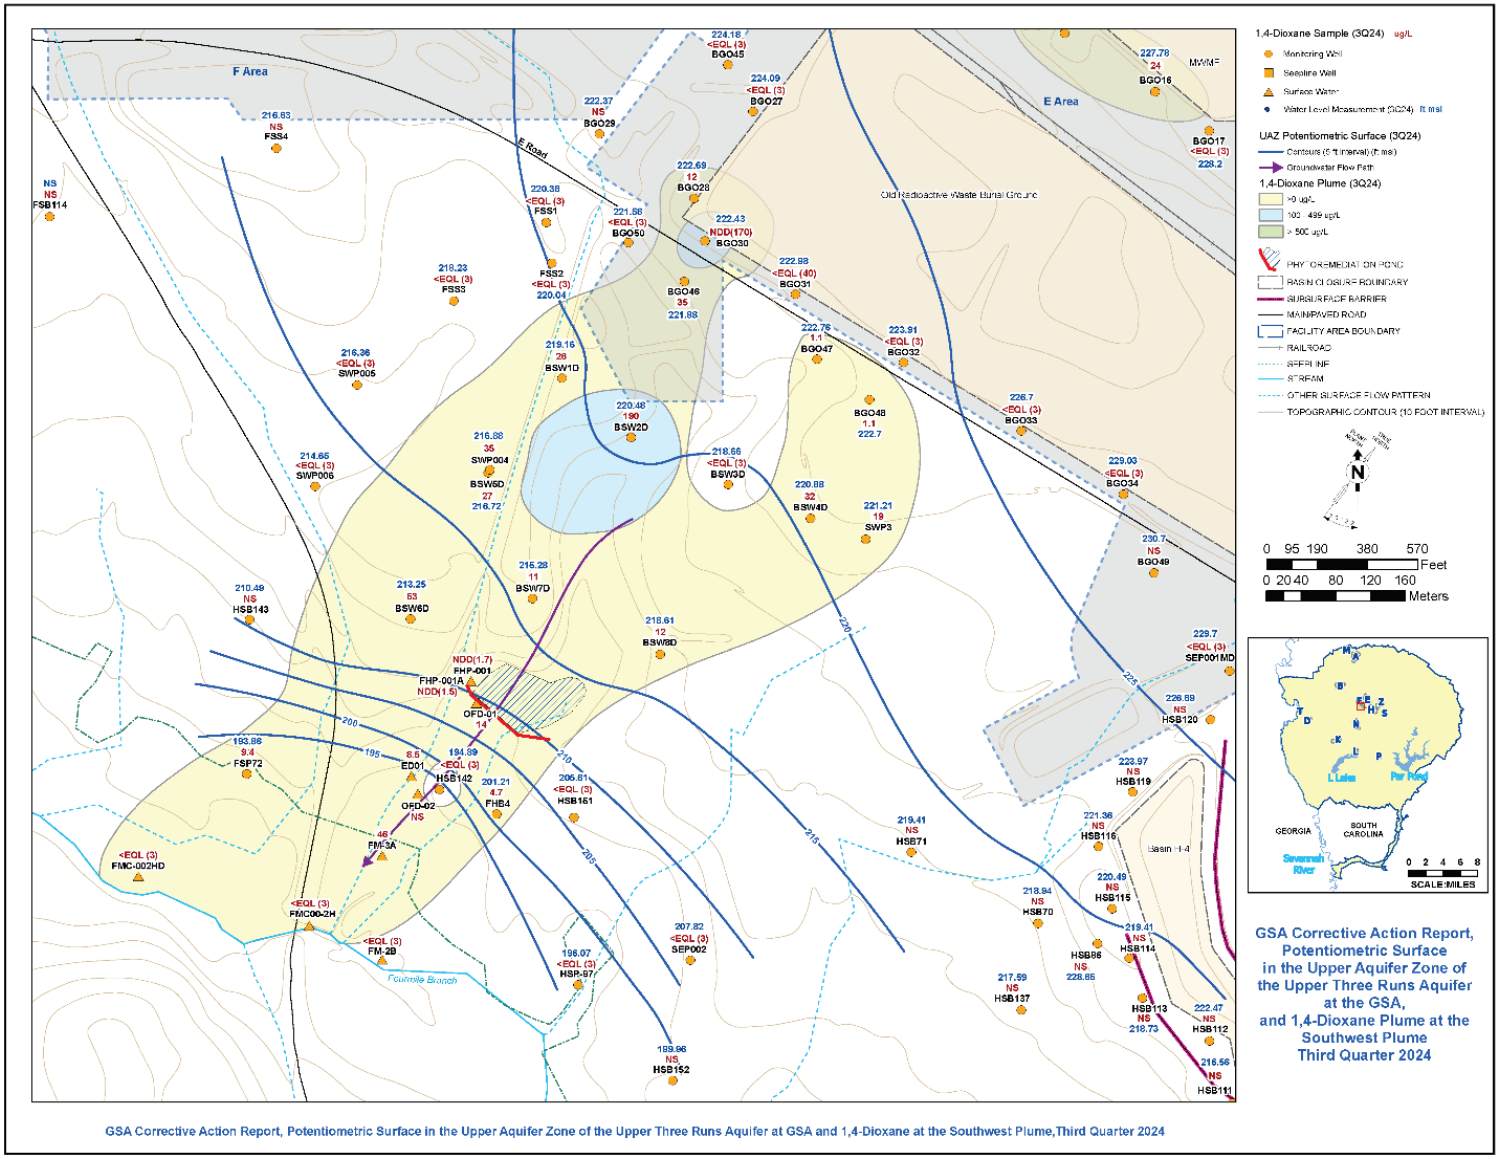


Figure K-5. MWMF Southwest Plume 1,4-Dioxane Concentrations in the Upper Aquifer Zone (SRNS 2025

Table K-1. Chronology of Site Events

Event	Date
RCRA Closure Plan Approved	December 1987
Corrective Action start	1988
RCRA Closure Certified	1991
Final ROD issuance	September 23, 1994
Previous Five-Year Reviews Issuance	August 27, 1997 / February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table K-2. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	Five-Year Total
Total Actual O&M Costs ($)	207,405	269,541	280,816	298,667	353,197	1,409,626
Total ROD Estimated Direct O&M Costs ($)	N/A	N/A	N/A	N/A	N/A	N/A

RCRA documentation does not require estimated project costs to be prepared.
N/A = not applicable

Table K-3. PFOS/PFAS Screening Results for the MWMF OU

Operable Unit Name:	**MWMF**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	**Yes**	
Uranium Enrichment/Plutonium Production/Nuclear Operations	**Yes**	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	No	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this operable unit.**	

Attachment K-1. Five-Year Review Site Inspection Checklist – Mixed Waste MANAGEMENT FACILITY (643-28E) (MWMF) OU

I. SITE INFORMATION			
Site Name:	**Mixed Waste Management Facility (MWMF) OU**	**Date of Inspection:**	08/27/2025
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	SEMS #: 33
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	Sunny 80°F

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☐ Other _____

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. O&M Staff: Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949
   Problems/Suggestions: ☐ Report Attached _____

2. O&M Staff: Eric Barron (Name) | EC&ACP Post-Closure Waste Site O&M Staff Member (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395
   Problems/Suggestions: ☐ Report Attached _____

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. Local Regulatory Authorities and Response Agencies (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____
Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____
Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____
Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. Other Interviews *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED (CLICK ALL THAT APPLY)

1. O&M Documents:

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Mixed Waste Management Facility (MWMF) Post Closure Inspection, ER-IDS-019-018* (FY2021 to FY2025 [quarterly]).

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

III. Onsite Documents & Records Verified *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

7. Groundwater Monitoring Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is discussed in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached
From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached
From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached
From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached
From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons: _____

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☒ Gates secured ☐ N/A

Remarks: OU-specific perimeter fencing is required by the remedial action. Perimeter fences are in good condition.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

V. Access and Institutional Controls *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once every 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Matt Baker (Name) | Acting FFA Remedial Project Manager (Title) | 10/29/2025 (Date) | 803-952-6211 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks:

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

VI. General Site Conditions	
A. Roads ☒ Applicable ☐ N/A	
1. Roads damaged: ☐ Location shown on site map ☒ Roads adequate ☐ N/A Remarks:	
B. Other Site Conditions	
Remarks: Quarterly site inspections conducted from FY2021 through FY2025 identified active ant mounds, a sign needing to be replaced, minor rutting from mowing equipment, clearing of debris and repairs to drainage channels, and cracked, chipped, and/or failing concrete. All issues were addressed shortly after discovery.	
VII. LANDFILL COVER/CONTAINEMENT ☒ APPLICABLE ☐ N/A	
A. Landfill Surface	
1. Settlement (Low spots): ☐ Location shown on site map ☒ Settlement not evident Areal extent Depth Remarks:	
2. Cracks: ☐ Location shown on site map ☒ Cracking not evident Lengths Widths Depths Remarks:	
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent Depth Remarks:	
4. Holes: ☐ Location shown on site map ☒ Holes not evident Areal extent Depth Remarks:	
5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☐ No signs of stress Areal extent Depth Remarks:	

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

VII. Landfill Cover/Containement *(Continued)*

6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A
Remarks:_____

7. Bulges: ☐ Location shown on site map ☒ Bulges not evident
Areal extent_____ Depth_____
Remarks:_____

8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident
☐ Wet areas ☐ Location shown on site map Areal extent_____
☐ Ponding ☐ Location shown on site map Areal extent_____
☐ Seeps ☐ Location shown on site map Areal extent_____
☐ Soft subgrade ☐ Location shown on site map Areal extent_____
Remarks:_____

9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability
Areal extent_____
Remarks:_____

B. Benches ☐ Applicable ☒ N/A
(Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)

C. Letdown Channels ☐ Applicable ☒ N/A
(Channel lined with erosion control mats, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

VII. Landfill Cover/Containement *(Continued)*				
D. Cover Penetrations	☒ Applicable	☐ N/A		
1. Gas Vents:	☐ Active	☐ Passive		
☐ Properly secured/locked	☐ Functioning	☐ Routinely sampled	☐ Good Condition	
☐ Evidence of leakage at penetration		☐ Needs maintenance	☒ N/A	
Remarks:				
2. Gas Monitoring Probes:				
☐ Properly secured/locked	☐ Functioning	☐ Routinely sampled	☐ Good Condition	
☐ Evidence of leakage at penetration		☐ Needs maintenance	☒ N/A	
Remarks:				
3. Monitoring Wells:				
☐ Properly secured/locked	☐ Functioning	☐ Routinely sampled	☐ Good Condition	
☐ Evidence of leakage at penetration		☐ Needs maintenance	☒ N/A	
Remarks:				
4. Leachate Extraction Wells:				
☐ Properly secured/locked	☐ Functioning	☐ Routinely sampled	☐ Good Condition	
☐ Evidence of leakage at penetration		☐ Needs maintenance	☒ N/A	
Remarks:				
5. Settlement Monuments:	☒ Located	☒ Routinely Surveyed	☐ N/A	
Remarks:				
E. Gas Collection and Treatment	☐ Applicable	☒ N/A		
F. Cover Drainage Layer	☐ Applicable	☒ N/A		
G. Detention/Sedimentation Ponds	☐ Applicable	☒ N/A		
H. Retaining Walls	☐ Applicable	☒ N/A		

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued)*

VII. Landfill Cover/Containement *(Continued)*
I. Perimeter Ditches/Offsite Discharge ☒ Applicable ☐ N/A
1. Siltation: ☐ Location shown on site map ☒ Siltation not evident Areal extent_____ Depth_____ Remarks:_____
2. Vegetative Growth: ☐ Location shown on site map ☐ N/A ☒ Vegetation does not impede flow Areal extent_____ Type_____ Remarks:_____
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent_____ Depth_____ Remarks:_____
4. Discharge Structure: ☐ Location shown on site map ☒ N/A Remarks:_____
VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A
IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A
X. OTHER REMEDIES
If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.
A. Soil Vapor Extraction System ☐ Applicable ☒ N/A

Attachment K-1 Five-Year Review Site Inspection Checklist – Mixed Waste Management Facility (643-28E) (MWMF) OU *(continued/end)*

XI. OVERALL OBSERVATIONS

A. Implementation of the Remedy

Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.).

The remedy selected was low-permeability soil cover system and LUCs to prevent physical exposure to contaminants and mitigating further migration of contaminants to the groundwater. The cover system is intact, long-term grasses have been fully established. Soil cover system remedy is functioning as designed. There are no issues requiring corrective action.

B. Adequacy of O&M

Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy.

The O&M procedures consisting of quarterly site inspections and site maintenance (repair of erosion damage, cover system, fencing and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the OU) have been implemented. The O&M procedures are adequately maintaining the MWMF OU and the condition of the warning signs is good. When maintenance activities are identified during inspections (e.g., treating ant mounds, replacing a sign, fixing minor rutting from mowing equipment, and repairing and clearing drainage channels), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the MWMF OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.

C. Early Indicators of Potential Remedy Failure

Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future.

N/A

D. Opportunities for Optimization

Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy.

N/A

End of Checklist

APPENDIX L. SRL SEEPAGE BASINS (904-53G1, 904-54G2, 904-54G, AND 904-55G) OPERABLE UNIT

I. INTRODUCTION

This report is the sixth five-year review for the Savannah River Laboratory (SRcdL) Seepage Basins (904-53G1, 904-53G2, 904-54G, and 904-55G) (SRLSB) Operable Unit (OU). The review was conducted from July 2025 through December 2025. Contaminants have been left in place at the SRLSB OU at levels that do not allow for unlimited use and unrestricted exposure. The purpose of this review is to determine whether the remedy in place at the SRLSB OU is protective of human health and the environment. This report documents the results of the review.

II. OU CHRONOLOGY

Table L-1 lists the chronology of site events for the SRLSB OU.

III. BACKGROUND

SRLSB OU is listed as a Resource Conservation and Recovery Act (RCRA)/ Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) unit in Appendix C of the Federal Facility Agreement (FFA) for Savannah River Site (SRS) (FFA 1993). The media associated with the SRLSB OU is soil. The SRLSB OU groundwater is being addressed under the A/M Area Groundwater OU and will be discussed in the five-year remedy review reports for SRS OUs with operating equipment.

Physical Characteristics

The SRLSB OU is located within the northwestern section of SRS, approximately 1,200 m (4,000 ft) from the nearest SRS boundary and 1,350 m (4,500 ft) from the nearest residence (Figure L-1). The SRLSB OU consists of four seepage basins, designated as Seepage Basins 1 through 4, and a process sewer pipeline (Figure L-2). The four basins lie within the northern portions of the A/M Area, northeast of Savannah River Ecology Laboratory and southeast of the Savannah River National Laboratory (SRNL). The settings to the north, east, and south of the basins are wooded. Tims Branch is located north of the basins,

and an unnamed intermittent stream is immediately east of them. The area to the west is cleared and vegetated with low grasses. The four basins (Figure L-2) had an approximate depth of 3.6 m (12 ft) and covered a total area of approximately 0.87 hectares (2.15 acres). The total capacity of the basins was 2,605 m^3 (688,200 gal). A berm of undisturbed soil separated each of the four basins. The four basins were connected by a series of sequential overflow channels designed to receive wastewater by overflow from Basin 1 (904-52G) to Basin 2 (904-53G) to Basin 3 (904-54G) and then to Basin 4 (904-55G).

Wastewater was conveyed from Building 776-A (SRNL) to the west end of Basin 1 through a vitrified clay process sewer pipe. The line was constructed in conjunction with Basins 1 and 2 for start of operation in 1954. There is no surface water within the boundaries of the SRLSB.

Land and Resource Use

According to the *Savannah River Site Future Use Project Report* (USDOE 1996), residential uses of SRS land should be prohibited. The *Land Use Control Assurance Plan for the Savannah River Site* (WSRC 1999a) designates SRLSB OU as being within the site industrial support area. The future land use for SRLSB OU is reasonably anticipated to remain industrial with the U.S. Department of Energy (USDOE) maintaining control of the land.

History of Contamination

Basins 1 and 2 were placed into operation in 1954, and Basins 3 and 4 were added in 1958 and 1960, respectively (WSRC 1999b). The basins were used from 1954 to 1982 to dispose of low-level radioactive liquid waste generated in the SRNL laboratories (Buildings 735-A and 773-A). The laboratory-derived, low-level liquid waste was stored in Building 776-A waste tanks until the activities were confirmed to be below 100 dpm/mL alpha and/or 50 dpm/mL beta-gamma. Waste meeting this transfer criterion was then sent via the process sewer line to Basin 1. Figures L-3, L-4, L-5, and L-6 present photographs of the SRLSB OU before remediation and in the current condition.

During the 28 years of operation, the basins received 1.2 million m^3 (340 million gal) of wastewater, or about 42,960 m^3/year (12.1 million gal/year). There is no record of overflow out of the basins and no account of any local ground surface seeps. The wastewater seeped into the ground within the basins as designed.

Initial Response

Over the years, large trees had grown in and around the basins. A CERCLA removal action for removal of the vegetation at the SRLSBs was performed in 1997. The vegetation was stored and covered with geotextile material in Basins 2 and 4 until disposal at the SRS E-Area Low-Level Radioactive Waste Disposal Facility in October 1999. Disposal of this contaminated vegetation was not a part of the SRLSB OU remedial action but was performed as a separate action under USDOE removal action authority.

Basis for Taking Action

Analytical data collected for the Remedial Facility Investigation (RFI) / Remedial Investigation (RI) / Baseline Risk Assessment (BRA) and Focused Corrective Measures Study / Feasibility Study (CMS/FS) (WSRC 1998) indicate that significant impacts to the soil media associated with the SRLSB had occurred from both radiological and inorganic contaminants. Major radionuclide contaminants detected in the soil at SRLSB OU include actinium-228, cesium-137, cobalt-60, curium-243/244, radium-228, thorium-228, and uranium-238. The primary inorganic contaminants are mercury, silver, vanadium, and chromium. Process knowledge suggests that no significant quantities of chlorinated organics were discarded into the SRLSB OU.

As determined in the RFI/RI/BRA/CMS/FS, SRLSB operations and resulting soil contamination have not significantly impacted groundwater. The fate and transport analysis does not predict future impacts to the groundwater from the contaminants within the SRLSB OU. Therefore, groundwater is not a media of concern. Additionally, there are no contaminant migration constituents of concern (COCs) as indicated by contaminant migration modeling.

The final list of human health COCs for the future industrial worker scenario includes eighteen radionuclides and two metals. Only one ecological COC, chromium, was determined. Remedial goals (RGs) were established for the industrial worker scenario based on a risk of 1.0E-06, or a hazard quotient of 1 (Table L-2).

IV. REMEDIAL ACTIONS

Remedy Selection

As stated in the Record of Decision (ROD) (WSRC 1999b), the remedial action objectives (RAOs) for the SRLSB OU are as follows:

- Eliminate exposure of the future industrial worker to radiochemical constituents, mercury, and chromium in the soils of SRLSB OU;
- Remove all principal threat source material (PTSM) (soil above 1.0E-03 industrial worker health risk level) from Basins 1, 2, and 3; and
- Reduce risk to soil invertebrates from the ingestion of chromium in the surface soils of Basin 1.

As stated in the ROD (WSRC 1999b), the selected remedy for the SRLSB OU was to excavate soil above 1.0E-03 industrial risk (PTSM), dispose at an off-SRS site, such as Envirocare of Utah, Inc., place an earthen cover over all four basins, and use institutional controls (i.e., land use controls [LUCs]) to maintain future industrial land use only. The following LUC objective is necessary to ensure protectiveness of the remedy:

- Control access to the SRLSB unit in accordance with the current site use/site clearance programs, including signs posted in the area to indicate that soil beneath the unit has been contaminated with radionuclides.

Remedy Implementation

Implementation of the selected remedy at SRLSB OU included the following activities:

- Removal of 4,740 m^3 (6,200 yd^3) of PTSM soil by (1) excavation of approximately 1.2 m (4 ft) from the bottom of Basins 1, 1.5 m (5 ft) from the bottom of Basin 2, and 0.6 m (2 ft) from the bottom of Basin 3, and 0.3 m (1 ft) from all of the berms in the three

basins; (2) excavation of the process sewer pipeline and the soils 0.3 m (1 ft) below and 0.45 m (1.5 ft) on each side of the pipeline from Basin 1 to the first manhole; and (3) packaging all job control waste and transporting to Envirocare of Utah, Inc., a low-level waste disposal facility. Basin 4 did not require excavation of contaminated soil but was backfilled with clean soil.

- Performing confirmatory soil samples to verify all PTSM soil was removed.
- Backfilling the process sewer trench and all four basins (0.85 hectare [2.1 acres]) with clean soil to a depth between 2.7 m (9 ft) and 5.7 m (19 ft) and sloped to provide proper stormwater drainage. The top 15 cm (6 in) of the vegetative layer contained topsoil, fertilizer, lime, seed and mulch.
- Established LUCs for 1 hectare (2.56 acres) (Figure L-7) including physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the SRLSB OU for industrial use only, and warning signs and site use restrictions via the SRS Site Use/Site Clearance Program, for the SRLSB OU.
- Conducting maintenance and maintaining LUCs of the covered basins to prevent unauthorized access.

Systems Operations/Operation and Maintenance

There are no system operational requirements. The following maintenance activities are ongoing:

- Annual site inspections and site maintenance (i.e., soil cover maintenance, repair of erosion damage, and warning signs);
- Site controls and land use restrictions via the SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the SRLSB OU.

Table L-3 compares the actual operation and maintenance (O&M) costs for the five-year remedy review period to the estimated direct O&M costs from the ROD (WSRC 1999b).

The estimated O&M cost for fiscal year (FY) 2021 to FY2025 was $25,000 for site inspections, maintenance, and LUCs. The actual O&M cost for FY2021 to FY2025 is $115,938. The actual O&M costs are higher than expected because O&M costs were not included in the ROD estimate.

V. PROGRESS SINCE LAST REVIEW

The previous protectiveness statement concluded that because the remedial actions at SRLSB OU are protective, the site is protective of human health and the environment. The implementation of LUCs, including controlled access to SRLSB OU is protective of human health and the environment. Exposure pathways that could result in unacceptable risks have been controlled through soil excavation and disposal at an off-SRS CERCLA-approved facility, backfilling the area to grade with clean soil, re-vegetation of the area and LUCs.

There were no recommendations or follow-up actions from the last five-year review.

VI. FIVE-YEAR REVIEW PROCESS

The following tasks were performed as part of the review:

- Reviewed the documents listed in Section XII. Documents Reviewed;
- Confirmed the implementation of the remedial action;
- Inspected the OU and documented the results on the Inspection Checklist provided in Attachment L-1 with the purpose of assessing the protectiveness of the remedy and the functionality of the access controls; and
- Reviewed changes in standards and to-be-considered guidance.

Summary of Inspections and Interviews

Scheduled annual site inspections were conducted from FY2021 through FY2025 (Various).

Tasks included on the field inspection checklists include:

- Verifying roads are accessible;
- Verifying waste unit signs (20) are in acceptable condition, have the correct information and are legible from a distance of 7.6 m (25 ft);
- Verifying fence is locked and in good condition;
- Verifying there is no excavating, digging, or construction activity on the soil cover;
- Checking integrity of drainage ditches for presence of excessive erosion, sediment buildup and any debris restricting water flow;
- Verifying no woody vegetation is growing on the soil cover, and remove or identify as needed;
- Visually checking vegetative cover for grass density with no bare spots more than 0.9 m by 0.9 m (3 ft by 3ft) in area. (The height of the vegetation should not impair the visual inspection of the soil cover. This will be determined by the Inspector.);
- Checking soil cover for signs of erosion or depressions (subsidence);
- Checking for signs of burrowing animals; and
- Other.

The field inspections identified the following issues: active ant mounds, evidence of burrowing animals, and trees on fence and blown over dur to a hurricane. These findings were documented on the field inspection checklists and resolved soon after discovery.

The SRLSB OU was inspected by Savannah River Nuclear Solutions, LLC (SRNS) Environmental Compliance and Area Completion Project (EC&ACP) on August 19, 2025 and included taking current photographs of the SRLSB OU and reviewing the field inspection checklist. No issues were identified during this inspection. Interviews were conducted with Eric Barron, O&M staff member, and Brian Hanshew, O&M Site Manager, on September 9, 2025 at the O&M organization offices. No issues were identified as an outcome of these interviews. However, SRS was greatly impacted by Hurricane Helene and closed in response during the period of September 27, 2024 through October 6, 2024

with the exception of emergency and essential personnel. The site resumed normal operations on October 7, 2024. EC&ACP O&M personnel evaluated the impacts of Hurricane Helene. No storm damages were identified at the SRLSB OU that would affect the protectiveness of the remedy.

The SRLSB OU was inspected by SRNS EC&ACP and USDOE personnel October 28, 2025. No issues were identified for the SRLSB OU during this inspection that would affect the protectiveness of the remedy.

A regulatory site inspection with USDOE, U.S. Environmental Protection Agency (USEPA) and South Carolina Department of Environmental Services (SCDES) personnel was held on March 19, 2026. SRNS personnel were also present at the meeting. During the meeting, the participants viewed drone footage of SRLSB OU and were provided with an opportunity to walk down the OU. The USEPA and SCDES elected not to perform a walk down because the drone video provided them with better views of the OU. No significant problems regarding the protection of the remedy for this OU as implemented were identified during the inspection.

VII. TECHNICAL ASSESSMENT

Is the Remedy Functioning as Intended by the Decision Document?

The remedy, excavation, off-site disposal, and LUCs is effective in preventing exposure to contaminants above 1E-06 risk levels and is functioning as intended.

LUCs have been effective in maintaining restricted (industrial) land use. Annual site inspection and site maintenance have been effective in maintaining the integrity of the soil cover. Based on site inspections, there is no indication of potential remedy failure that could place protectiveness at risk.

The Land Use Control Implementation Plan (LUCIP) for SRLSB OU is included as Appendix A of the Corrective Measure Implementation Report / Post-Construction Report / Final Remediation Report and governs LUC implementation, maintenance, monitoring, reporting, and enforcement of LUCs (WSRC 2001). The LUCs that are in place include physical access controls to prevent unauthorized contact, removal or excavation of

subsurface soils, and restrictions to prevent disturbance of the SRLSB OU. Warning signs are in good condition, and no activities were observed that would have violated the LUCs. All LUC objectives are being met.

The LUCIP is available on the SRS external webpage in the Administrative Record File (https://public.srs.gov/missions-and-programs/environmental-stewardship/arf-irf-index/) and the Land Use Control Assurance Plan webpage (https://public.srs.gov/ missions-and-programs/environmental-stewardship/lucap/).

Are Exposure Assumptions, Toxicity Data, Cleanup Levels, and Remedial Action Objectives still valid?

The exposure assumptions, toxicity data, and cleanup levels used at the time of final remedy selection are still valid. There have been no changes in the standards or physical condition of the SRLSB OU that would affect the protectiveness of the remedy.

The USEPA standards and toxicity values have been updated since submittal of the last five-year remedy review as shown in Appendix B. The changes to the values for COCs at the SRLSB OU were not significant, and the RAOs continue to be met by the remedial action. No new standards or to-be-considered guidance have been identified that call into question the protectiveness of the remedy.

Fact sheets provided on the USEPA webpage (https://19january2021snapshot.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern_.html) regarding emerging contaminants were reviewed for applicability to this site. The USEPA webpage provides a link to fact sheets for the following emerging contaminants: 1,2,3-trichloropropane (TCP), 1,4-dioxane, 2,4,6-trinitrotoluene (TNT), 2,4-dintrotoluene (DNT), hexahydro-1,3,5-tri-nitro-1,3,5-triazine (RDX), nanomaterials, N-nitroso-dimethylamine (NDMA), perchlorate, perfluorooctane sulfonic acid (PFOS) and other per- and polyfluoroalkyl substances (PFAS), polybrominated biphenyls, polybrominated diphenyl ethers (PBDEs), and tungsten. None of these emerging contaminants, except for PFOS and other PFAS, were identified as applicable to this OU based on the OU history of contamination.

Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this waste unit (Table L-4). However, the engineered cover system in place serves as an effective and protective remedy, mitigating potential exposures and releases associated with PFAS.

Has any Other Information Come to Light that Could Call into Question the Protectiveness of the Remedy?

No other information has come to light that would call into question the protectiveness of the remedy.

VIII. ISSUES

There are no issues related to current site conditions or activities that prevent the remedy from being protective of this OU.

IX. RECOMMENDATIONS AND FOLLOW-UP ACTIONS

There are no recommendations or follow-up actions for this OU.

X. PROTECTIVENESS STATEMENT(S)

The remedy at the SRLSB OU is protective of human health and the environment.

Exposure pathways that could result in unacceptable risks are being controlled by LUCs to prevent exposure to or ingestion of contaminated soil media. All threats to the SRLSB OU have been addressed through physical access controls to prevent unauthorized entry to SRS (fences, guards, security patrols, etc.), administrative controls that maintain the SRLSB OU for industrial use only, and warning signs and land use restrictions via the SRS Site Use/Site Clearance Program.

XI. NEXT REVIEW

The eighth five-year review for SRS OUs with Engineered Cover Systems is scheduled for December 2031.

XII. DOCUMENTS REVIEWED

FFA, 1993. *Federal Facility Agreement for the Savannah River Site,* Administrative Docket No. 89-05-FF (Effective Date: August 16, 1993)

USDOE, 1996. *Savannah River Site Future Use Project Report*, U.S. Department of Energy, Savannah River Operations Office, Savannah River Site, Aiken, SC

WSRC, 1998. *RCRA Facility Investigation/Remedial Investigation/Baseline Risk Assessment and Focused Corrective Measures Study/Feasibility Study for the SRL Seepage Basins Operable Unit (904-53G, -54G, and –55G) (U)*, WSRC-RP-97-846, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 1999a. *Land Use Control Assurance Plan for the Savannah River Site*, WSRC-RP-98-4125, Revision 1.1, latest revision, Savannah River Nuclear Solutions, LLC, Savannah River Site, Aiken, SC

WSRC, 1999b. *Record of Decision, Remedial Alternative Selection for the SRL Seepage Basins Operable Unit (904-53G1, -53G2, -54G and –55G) (U)*, WSRC-RP-97-848, Revision 1.1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

WSRC, 2001. *Corrective Measure Implementation Report/Post-Construction Report/ Final Remediation Report (CMIR/PCR/FRR) for Closure of SRL Seepage Basins Operable Unit (904-53G, -53G, -54G, and -55G) (U)*, WSRC-RP-2001-4123, Revision 1, Westinghouse Savannah River Company, Savannah River Site, Aiken, SC

Various – Inspection Data Sheets - *Field Inspection Checklist for SRL Seepage Basins*, ER-IDS-019-011, Inspection Period 2021 through 2025 (annually)

This page is intentionally left blank.

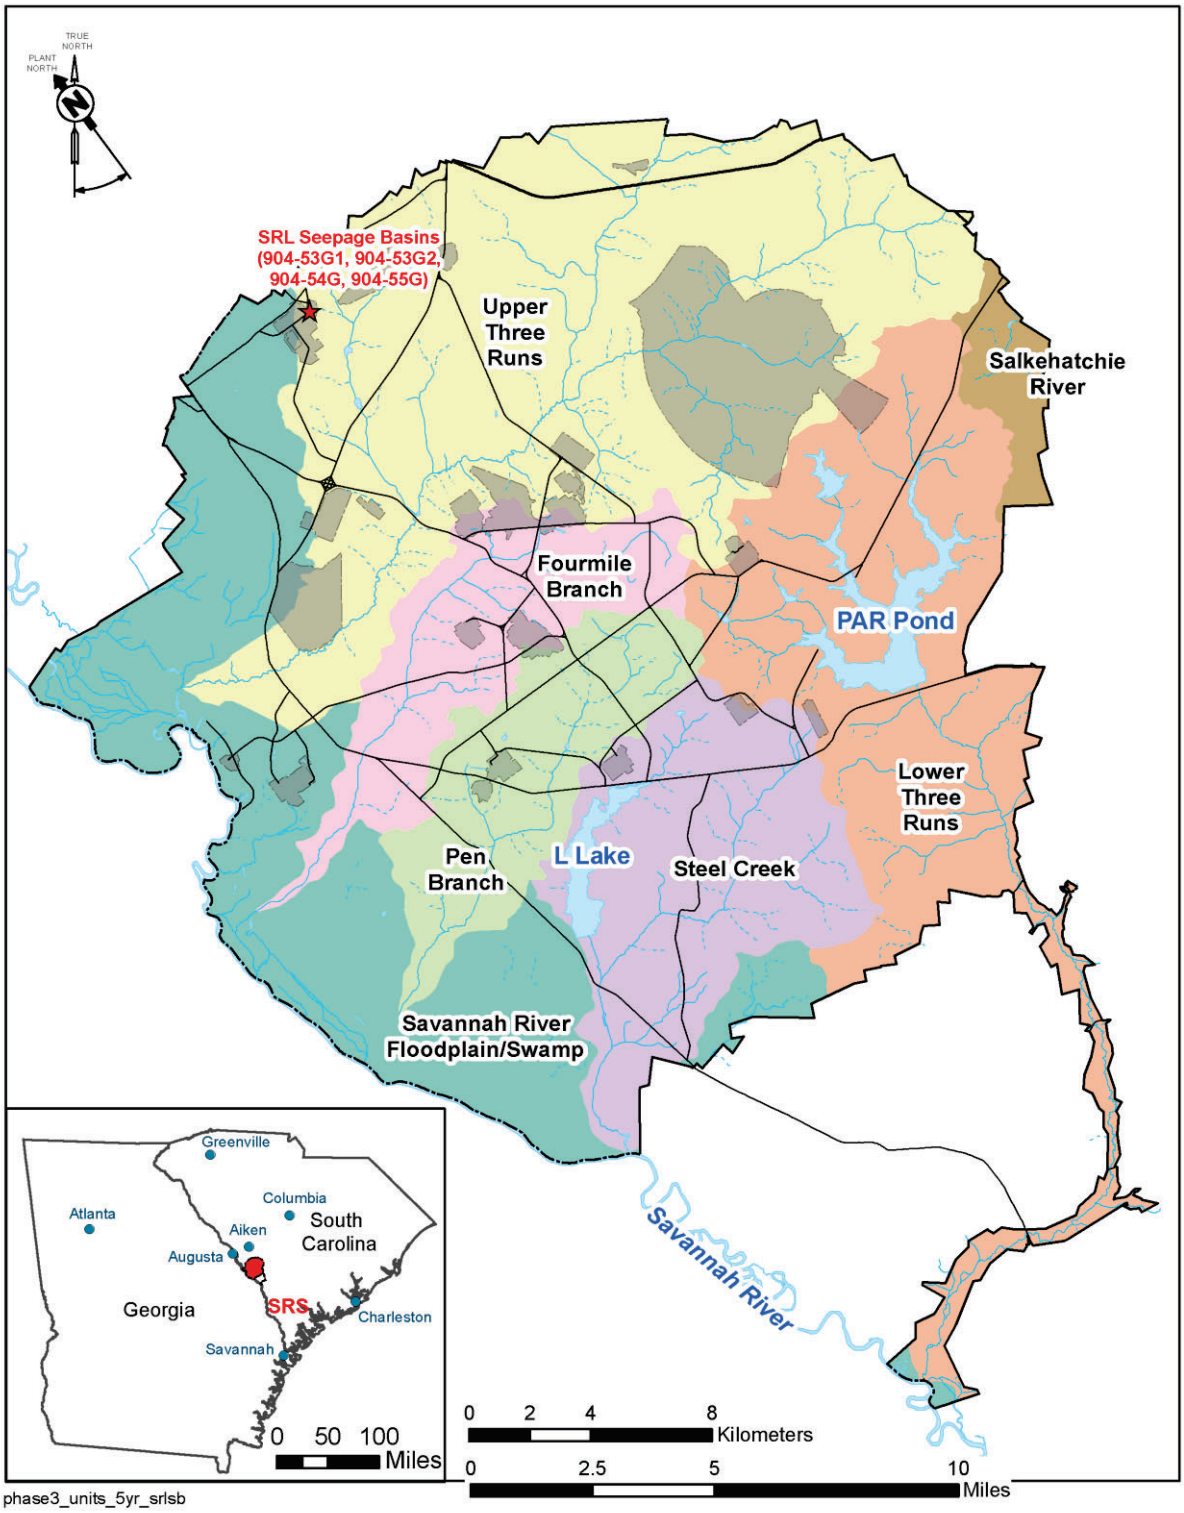


Figure L-1. Location of the SRL Seepage Basins OU at SRS



Figure L-2. Layout of the SRLSB OU (904-53G, 904-53G, 904-54G, and 904-55G) after Construction Completion (2001)



Figure L-3. Photo of SRLSB OU Before Remediation Activities



Figure L-4. Current Photograph of the SRLSB OU (2025)



Figure L-5. Current Photo of the SRLSB OU (2025)



Figure L-6. Current Aerial Photograph of the SRLSB OU (2025)

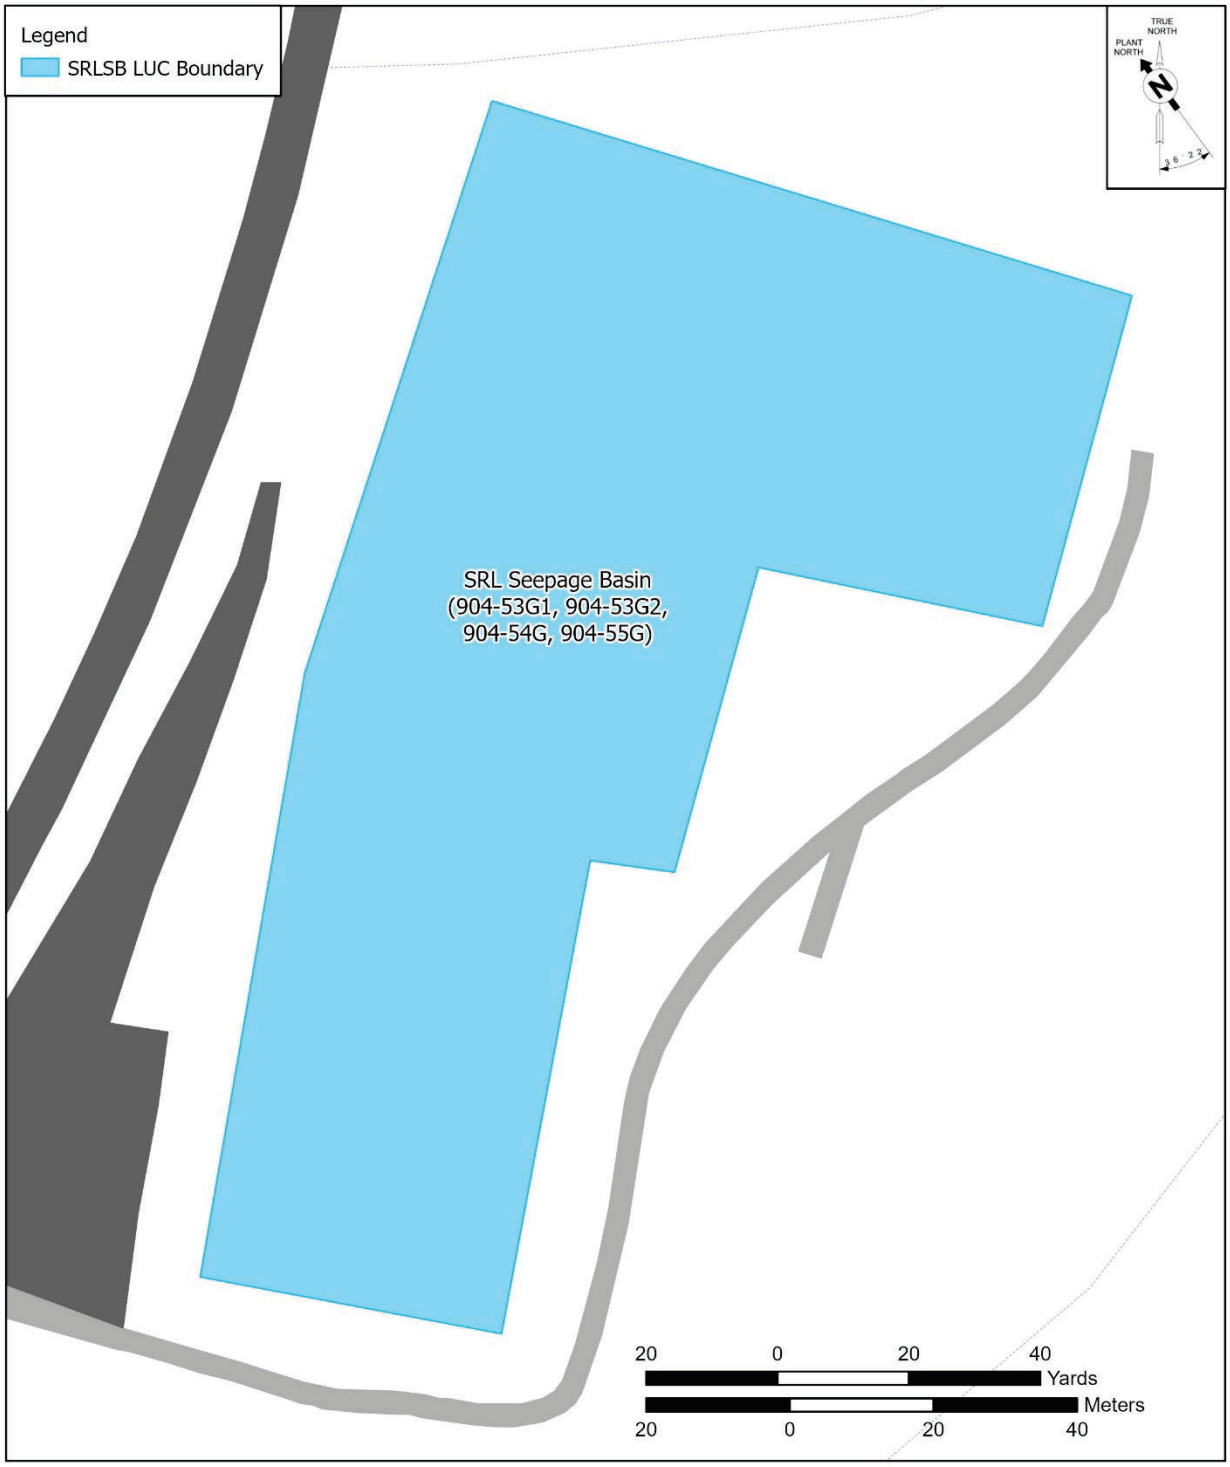


Figure L-7. SRLSB OU LUC Boundary

This page is intentionally left blank.

Table L-1. Chronology of OU Events

Event	Date
RFI/RI Field Start / Complete	September 25, 1996 / May 27, 1997
Removal Action Start / Complete (Trees Only)	July 28, 1997 / December 9, 1997
CERCLA Removal Action Start / Complete	August 22, 1997 / October 15, 1997
ROD Issuance	April 26, 2000
Remedial Action Start / Complete	December 8, 1999 / August 20, 2003
Previous Five-Year Reviews Issuance	February 12, 2004 / January 29, 2009 / February 4, 2014 / February 21, 2018 / December 21, 2021

Table L-2. COCs for SRLSB OU

Unit	Media	COC	Type of COC	RG	Units	Basis
SRL Seepage Basin	Soil	Actinium-228	HH	7.0E-02	pCi/g	Future Industrial Worker
		Americium-241		8.1E+00	pCi/g	
		Cesium-137		1.1E-01	pCi/g	
		Cobalt-60		2.0E-02	pCi/g	
		Curium-243/244		1.6E+00	pCi/g	
		Lead-212		7.0E-01	pCi/g	
		Neptunium-239		9.0E-01	pCi/g	
		Plutonium-238		1.1E+01	pCi/g	
		Plutonium-239/240		1.0E+01	pCi/g	
		Potassium-40		4.0E-01	pCi/g	
		Radium-228		6.7E-02	pCi/g	
		Strontium-90		5.7E+01	pCi/g	
		Thorium-228		3.5E-02	pCi/g	
		Thorium-230		8.5E+01	pCi/g	
		Thorium-232		9.8E+01	pCi/g	
		Uranium-233/234		7.1E+01	pCi/g	
		Uranium-235		8.3E-01	pCi/g	
		Uranium-238		3.1E+00	pCi/g	
		Hexavalent Chromium		1.5E+03	mg/kg	
		Mercury		4.7E+01	mg/kg	
		Chromium	ECO	2.0E+02	mg/kg	Soil invertebrates

HH = Human Health
ECO = Ecological

Table L-3. Actual versus Estimated O&M Costs

	FY2021	FY2022	FY2023	FY2024	FY2025	5-Year Total
Total Actual O&M Costs ($)	25,037	18,622	20,228	21,827	30,224	115,938
Total ROD Estimated Direct O&M Costs* ($)	25,000	0	0	0	0	25,000

*Costs for preparation of the Sixth Five-Year Remedy Review were accounted for in FY2021. Annual O&M costs were not included in the original estimate.

Table L-4. PFOS/PFAS Screening Results for the SRL SB OU

Operable Unit Name:	**SRL SB**	
Use/Category	Known Use at Facility (Yes/No)	Notes/Comments
Fire Training Facility/Fire Department Location	No	
Wastewater Treatment Plant/ Centralized Waste Treatment Landfill	No	
Uranium Enrichment/Plutonium Production/Nuclear Operations	No	
Metal Plating Processing	No	
Explosives/Munitions/Weapons	No	
Electronics Manufacturing	No	
Equipment Fuel/Maintenance (large fuel storage areas; industrial waste lines or maintenance)	No	
Well Drilling	No	Data from site groundwater wells indicate that there have been no installation or operational impacts from PFAS.
Pesticides	No	
Laboratory	**Yes**	
Consumer Product Manufacturing	No	
Operable Unit Conclusion:	**Based on the operational history and documented usage patterns, including a review of historical PFAS applications and categories, PFAS may be expected to be present at this operable unit.**	

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU

I. SITE INFORMATION			
Site Name:	**SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU**	**Date of Inspection:**	**08/19/2025**
Location and Region	**SRS, USEPA Region 4**	**EPA ID:**	**SEMS #47**
Agency, Office, or Company leading the Five-Year Review	**USDOE**	**Weather/ Temperature**	**Partly Cloudy 85°F**

Remedy Includes: *(Click all that apply)*

- ☒ Landfill Cover/Containment
- ☒ Access Controls
- ☒ Institutional Controls
- ☐ Groundwater Pump and Treatment
- ☐ Surface Water Pump and Treatment
- ☐ Monitored Natural Attenuation
- ☐ Groundwater Containment
- ☐ Vertical Barriers
- ☒ Other Excavation, off-site disposal

Attachments: ☐ Inspection team roster attached

II. INTERVIEWS *(Click all that apply)*

1. **O&M Staff:** Brian Hanshew (Name) | EC&ACP Post-Closure Waste Site O&M Site Manager (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-4949
   Problems/Suggestions: ☐ Report Attached

2. **O&M Staff:** Eric Barron (Name) | EC&ACP Post-Closure Waste Site O&M Staff Member (Title) | 09/09/2025 (Date)
   Interviewed: ☐ At Site ☒ At Office ☐ By Phone Phone No.: 803-952-3395
   Problems/Suggestions: ☐ Report Attached

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

II. INTERVIEWS *(Click all that apply)(Continued)*

3. **Local Regulatory Authorities and Response Agencies** (i.e., State and tribal offices, emergency response office, police department, office of public health or environmental health, zoning office, recorder of deeds or other city and county offices, etc.). Fill in all that apply.

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

Agency: _____

Contact: _____ (Name) _____ (Title) _____ (Date) _____ (Phone No.)

Problems/Suggestions: ☐ Report Attached _____

4. **Other Interviews** *(Optional):* ☐ Report Attached _____

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Click all that apply)*

1. **O&M Documents:**

☐ O&M Manual	☐ Readily Available	☐ Up to Date	☒ N/A
☒ As-Built Drawings	☒ Readily Available	☒ Up to Date	☐ N/A
☒ Maintenance Logs	☒ Readily Available	☒ Up to Date	☐ N/A

Remarks: See *Waste Unit Inspection and Maintenance, ER-SOP-019, Field Inspection Checklist for SRL Seepage Basins*, ER-IDS-019-011.

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

III. ONSITE DOCUMENTS & RECORDS VERIFIED *(Continued)*

2. Health and Safety Plans (HASPs):

☐ Site-Specific Health and Safety Plans	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Contingency Plan/Emergency Response Plan	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks: Routine O&M activities do not require a SSHASP under 29 CFR 1910.120, HAZWOPER.

3. O&M and OSHA Training Records: ☒ Readily Available ☒ Up to Date ☐ N/A

Remarks: Training Records are complete and up to date per EC&ACP training matrix.

4. Permits and Service Agreements:

☐ Air Discharge Permit	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Effluent Discharge	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Waste Disposal; POTW	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Other Permits	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

5. Gas Generation Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

6. Settlement Monument Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

7. Groundwater Monitoring Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

8. Leachate Extraction Records: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

9. Discharge Compliance Records:

☐ Air	☐ Readily Available	☐ Up to Date	☒ N/A
☐ Water (Effluent)	☐ Readily Available	☐ Up to Date	☒ N/A

Remarks:

10. Daily Access/Security Logs: ☐ Readily Available ☐ Up to Date ☒ N/A

Remarks:

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

IV. O&M COSTS

1. O&M Organization:

☐ State In-House ☐ Contractor for State
☐ PRP In-House ☐ Contractor for PRP
☒ Other: SRS

2. O&M Cost Records:

☐ Readily Available ☐ Up to Date ☐ Funding mechanism/agreement in place
☒ Other: Project cost data is summarized in Section IV of this OU-specific review.

Total annual cost by year for review period, if available

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

From:_____ (Date) To:_____ (Date) _____ (Total Cost) ☐ Breakdown attached

3. Unanticipated or Unusually High O&M Costs During Review Period

Describe costs and reasons: _____

V. ACCESS AND INSTITUTIONAL CONTROLS ☒ Applicable ☐ N/A

A. Fencing

1. Fencing Damage: ☐ Location shown on site map ☐ Gates secured ☒ N/A

Remarks: OU-specific perimeter fencing is not required by the remedial action.

B. Signs

1. Signs and Other Security Measures: ☐ Location shown on site map ☐ N/A

Remarks: Signs are in good condition.

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

V. ACCESS AND INSTITUTIONAL CONTROLS *(Continued)*

C. Institutional Controls

1. Implementation and Enforcement

Site conditions imply ICs are not properly implemented: ☐ Yes ☒ No ☐ N/A

Site conditions imply ICs are not being fully enforced: ☐ Yes ☒ No ☐ N/A

Type of monitoring (e.g., self-reporting, drive-by, etc.) Walkdown

Frequency: Once in 5 years

Responsible Party/Agent: USDOE Savannah River Field Office

Contact: Charles Bryan (Name) | DOE Program Manager (Title) | 10/28/2025 (Date) | 803-952-7505 (Phone No.)

Reporting is up-to-date: ☒ Yes ☐ No ☐ N/A

Reports are verified by the lead agency: ☒ Yes ☐ No ☐ N/A

Specific requirements in deed or decision documents have been met: ☒ Yes ☐ No ☐ N/A

Violations have been reported: ☐ Yes ☐ No ☒ N/A

Problems/Suggestions: ☐ Report Attached

2. Adequacy: ☒ ICs are adequate ☐ ICs are inadequate ☐ N/A

Remarks: Survey monuments located and in good condition.

D. General

1. Vandalism/Trespassing: ☐ Location shown on site map ☒ No vandalism is evident

Remarks:

2. Land use changes onsite: ☒ N/A

Remarks:

3. Land use changes offsite: ☒ N/A

Remarks:

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

VI. GENERAL SITE CONDITIONS
A. Roads ☒ Applicable ☐ N/A
1. Roads damaged: ☒ Location shown on site map ☒ Roads adequate ☐ N/A Remarks: Roads at this site are in good condition.
B. Other Site Conditions
Remarks: Annual site inspections performed during the period of FY2021 to FY2025 identified active ant mounds, evidence of burrowing animals, and trees on fence blown over due to a hurricane. These issues were addressed soon after discovery.
VII. LANDFILL COVER/CONTAINMENT ☒ Applicable ☐ N/A
A. Landfill Surface
1. Settlement (Low spots)**:** ☐ Location shown on site map ☒ Settlement not evident Areal extent____ Depth____ Remarks:
2. Cracks: ☐ Location shown on site map ☒ Cracking not evident Lengths____ Widths____ Depths____ Remarks:
3. Erosion: ☐ Location shown on site map ☒ Erosion not evident Areal extent____ Depth____ Remarks:
4. Holes: ☐ Location shown on site map ☒ Holes not evident Areal extent____ Depth____ Remarks:
5. Vegetative Cover: ☒ Grass ☒ Cover properly established ☒ No signs of stress Areal extent____ Depth____ Remarks: Vegetation is mowed routinely.

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*
6. Alternative Cover (armored rock, concrete, etc.): ☒ N/A Remarks:_____
7. Bulges: ☐ Location shown on site map ☒ Bulges not evident Areal extent_____ Depth_____ Remarks:_____
8. Wet Areas / Water Damage: ☒ Wet areas/water damage not evident ☐ Wet areas ☐ Location shown on site map Areal extent_____ ☐ Ponding ☐ Location shown on site map Areal extent_____ ☐ Seeps ☐ Location shown on site map Areal extent_____ ☐ Soft subgrade ☐ Location shown on site map Areal extent_____ Remarks:_____
9. Slope Instability: ☐ Slides ☐ Location shown on site map ☒ No evidence of slope instability Areal extent_____ Remarks:_____
B. Benches ☐ Applicable ☒ N/A (Horizontally constructed mounds of earth placed across a steep landfill side slope to interrupt the slope in order to slow down the velocity of surface runoff and intercept and convey the runoff to a lined channel)
C. Letdown Channels ☐ Applicable ☒ N/A (Channel lined with erosion control mates, riprap, grout bags, or gabions that descend down the steep side slope of the cover and will allow the runoff water collected by the benches to move off of the landfill cover without creating erosion gullies)
D. Cover Penetrations ☐ Applicable ☒ N/A
E. Gas Collection and Treatment ☐ Applicable ☒ N/A
F. Cover Drainage Layer ☐ Applicable ☒ N/A
G. Detention/Sedimentation Ponds ☐ Applicable ☒ N/A
H. Retaining Walls ☐ Applicable ☒ N/A

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued)*

VII. LANDFILL COVER/CONTAINMENT *(Continued)*

I. Perimeter Ditches/Offsite Discharge ☒ Applicable ☐ N/A

1. Siltation: ☐ Location shown on site map ☒ Siltation not evident
Areal extent_____ Depth_____
Remarks:_____

2. Vegetative Growth: ☐ Location shown on site map ☐ N/A
☒ Vegetation does not impede flow
Areal extent_____ Type_____
Remarks:_____

3. Erosion: ☐ Location shown on site map ☒ Erosion not evident
Areal extent_____ Depth_____
Remarks:_____

4. Discharge Structure: ☐ Location shown on site map ☒ N/A
Remarks:_____

VIII. VERTICAL BARRIER WALLS ☐ Applicable ☒ N/A

IX. GROUNDWATER/SURFACE WATER REMEDIES ☐ Applicable ☒ N/A

Attachment L-1. Five-Year Review Site Inspection Checklist – SRL Seepage Bains (904-53G1, 904-53G2, 904-54G, and 904-55G) OU *(continued/end)*

X. OTHER REMEDIES

If there are remedies applied at the site, which are not covered above, attach an inspection sheet describing the physical nature and condition of any facility associated with the remedy. An example would be soil vapor extraction.

B. Excavation and Off-Site Disposal ☒ Applicable ☐ N/A

Excavation and off-site disposal were performed at SRLSB OU. The remedy is performing as designed.

XI. OVERALL OBSERVATIONS

A. Implementation of the Remedy

Describe issues and observations relating to whether the remedy is effective and functioning as designed. Begin with a brief statement of what the remedy is to accomplish (i.e., to contain contaminant plume, minimize infiltration and gas emissions, etc.).

The remedial action for the SRLSB OU was removal of contaminated soil and the installation of soil covers. The remedy is fully established and functioning as designed.

B. Adequacy of O&M

Describe issues and observations related to the implementation and scope of O&M procedures. In particular, discuss their relationship to the current and long-term protectiveness of the remedy.

The O&M procedures consisting of annual site inspections and site maintenance (repair of erosion damage, cover system, and warning signs) and site controls (SRS Site Use and Site Clearance Programs, which restrict invasive and permanent installation activities at the OU) have been implemented. The O&M procedures are adequately maintaining the SRLSB OU and the condition of the warning signs is good. When maintenance activities are identified during inspections, (e.g., treating ant mounds, tree removal, and filling holes burrowed by small animals), repairs are scheduled and performed. Within a month after Hurricane Helene occurred all monitoring wells were re-inspected for damages and repaired as needed. No storm damages were identified at the SRLSB OU. There are no issues that impact the protectiveness of the remedy that require corrective actions.

C. Early Indicators of Potential Remedy Failure

Describe issues and observations such as unexpected changes in the cost or scope of O&M or a high frequency of unscheduled repairs that suggest that the protectiveness of the remedy may be compromised in the future.

N/A

D. Opportunities for Optimization

Describe possible opportunities for optimization in monitoring tasks or the operation of the remedy.

N/A

End of Checklist

This page is intentionally left blank.