

## Facility Decommissioning Evaluation Building 484-7D, D-Area Storage Building

This is a Simple Model Decommissioning per Facility Disposition Manual 1C

Prepared by: W.L.B. Griffin Date: 11/18/19  
William B. Griffin  
EC&ACP Engineering  
Environmental Compliance and Area Completion Projects

Reviewed by: John K. Blankenship Date: 11/18/19  
John K. Blankenship  
EC&ACP Engineering  
Environmental Compliance and Area Completion Projects

Approved: Manuel I. Terronez Date: 11/20/2019  
Manuel I. Terronez  
EC&ACP Engineering Manager  
Environmental Compliance and Area Completion Projects

Approved: Thelesia O. Oliver Date: 11-20-2019  
Thelesia O. Oliver  
EC&ACP Operational Compliance Manager  
Environmental Compliance and Area Completion Projects

Approved: James M. Griffith Date: 11/21/19  
James M. Griffith  
Manager, EC&ACP Projects  
Environmental Compliance and Area Completion Projects

Approved: Thomas F. Gaughan Date: 11/21/19  
Thomas F. Gaughan  
EC&ACP Chief Engineer  
Environmental Compliance and Area Completion Projects



## DISCLAIMER

**This document was prepared in conjunction with work accomplished under Contract No. DE-AC09-08SR22470 with the U.S. Department of Energy.**

**This work was prepared under an agreement with and funded by the U.S. Government. Neither the U.S. Government or its employees, nor any of its contractors, subcontractors or their employees, makes any express or implied: 1. warranty or assumes any legal liability for the accuracy, completeness, or for the use or results of such use of any information, product, or process disclosed; or 2. representation that such use or results or such use would not infringe privately owned rights; or 3. endorsement or recommendation of any specifically identified commercial product, process, or service. Any views and opinions of authors expressed in this work do not necessarily state or reflect those of the United States Government, or its contractors, or subcontractors.**

**Printed in the United States of America**

*Prepared for*  
**U.S. Department of Energy**  
*and*  
**Savannah River Nuclear Solutions LLC**  
**Aiken, South Carolina**

## Introduction

This document contains an evaluation of available existing information about a facility that is slated for decommissioning. This evaluation screens the project to determine whether it is appropriate to conduct the decommissioning under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA), or to use a simpler graded approach.

This Facility Decommissioning Evaluation (FDE) consists of three sections. Part 1 contains a description of the project scope, including a brief summary of the purpose and history of the facility and photographs of the structures that are part of the project. Part 2 encompasses a series of questions, the answers to which determine the decommissioning model (CERCLA Model, Integrated Sampling Model, or Simple Model) that will be used. The three graded approach models are described in Facility Disposition Manual 1C, Procedure 501. Part 2 also includes a justification for the answers to each question. Part 3 is a list of references that were used for the evaluation.

## Conclusion

A review of the existing characterization data, process/building history, sample data and walk downs of the facility, supports the determination that this building meets the criteria of a Clean Building, Simple Model as described in Facility Disposition Manual 1C, Procedure 501. This decision is supported by the documentation found throughout the body of this document. No chemical or hazardous radioactive contaminants are associated with this structure.

## Part 1. Project Scope

### Scope

This Evaluation has been prepared in accordance with requirements found in Facility Disposition Manual 1C; Procedure 502, "Preparing Decommissioning Decision Documents". The scope of this evaluation includes 484-7D, D-Area Storage Building, which is further described in the next section.

The proposed decommissioning end-state for this facility is demolition to the building slab or to grade as applicable.

The described decommissioning activities are not the final area closure actions. The decommissioning of a building is intended to reduce landlord costs, increase safety by removing excess facilities and reduce the potential for releases of hazardous substances to the environment.

## Facility Description

Building 484-7D (see Figure 1 for photograph, Figure 2 for layout of the structure, and Figure 3 for layout of the area in the vicinity of the structure) is an approximately (~) 24-year old metal frame structure with metal skin. The interior walls are aluminum. The structure is attached to a concrete slab. The structure itself is ~20 feet (ft)' by 42 ft, with a non-partitioned interior. The structure does not appear to have any asbestos or lead in the materials. The building was used primarily for receiving of D-Area Materials. Electrical power, which was disconnected during deactivation, was the only utility supplied to the structure (refer to "Deactivation Project Final Report Building 484-D Powerhouse and Ancillary Buildings", V-PCOR-D-00042, Reference 6). There are no sumps and/or drains associated with the facility. Concrete associated with the facility is in good condition.

To the east and south sides of the building (Figures 2 and 3) are covered laydown areas. Each area has a concrete slab and a metal roof extended over it that abuts the building structure and is supported by posts distal to the structure.

Abutting the covered lay-down are a gravel/dirt and a smaller uncovered concrete lay-down area (Figures 2 and 3). These areas were used for temporary storage of powerhouse parts and equipment suitable for outside storage. The covered laydown area on the south side of the building is currently being used for temporary storage of tools, equipment, cabinets, etc. that belong to the Community Reuse Organization (CRO). All items in temporary storage will be removed prior to decommissioning. The bollard on the southwest corner of the structure will also be removed during decommissioning.



**Figure 1. Building 484-7D, D-Area Storage Building**

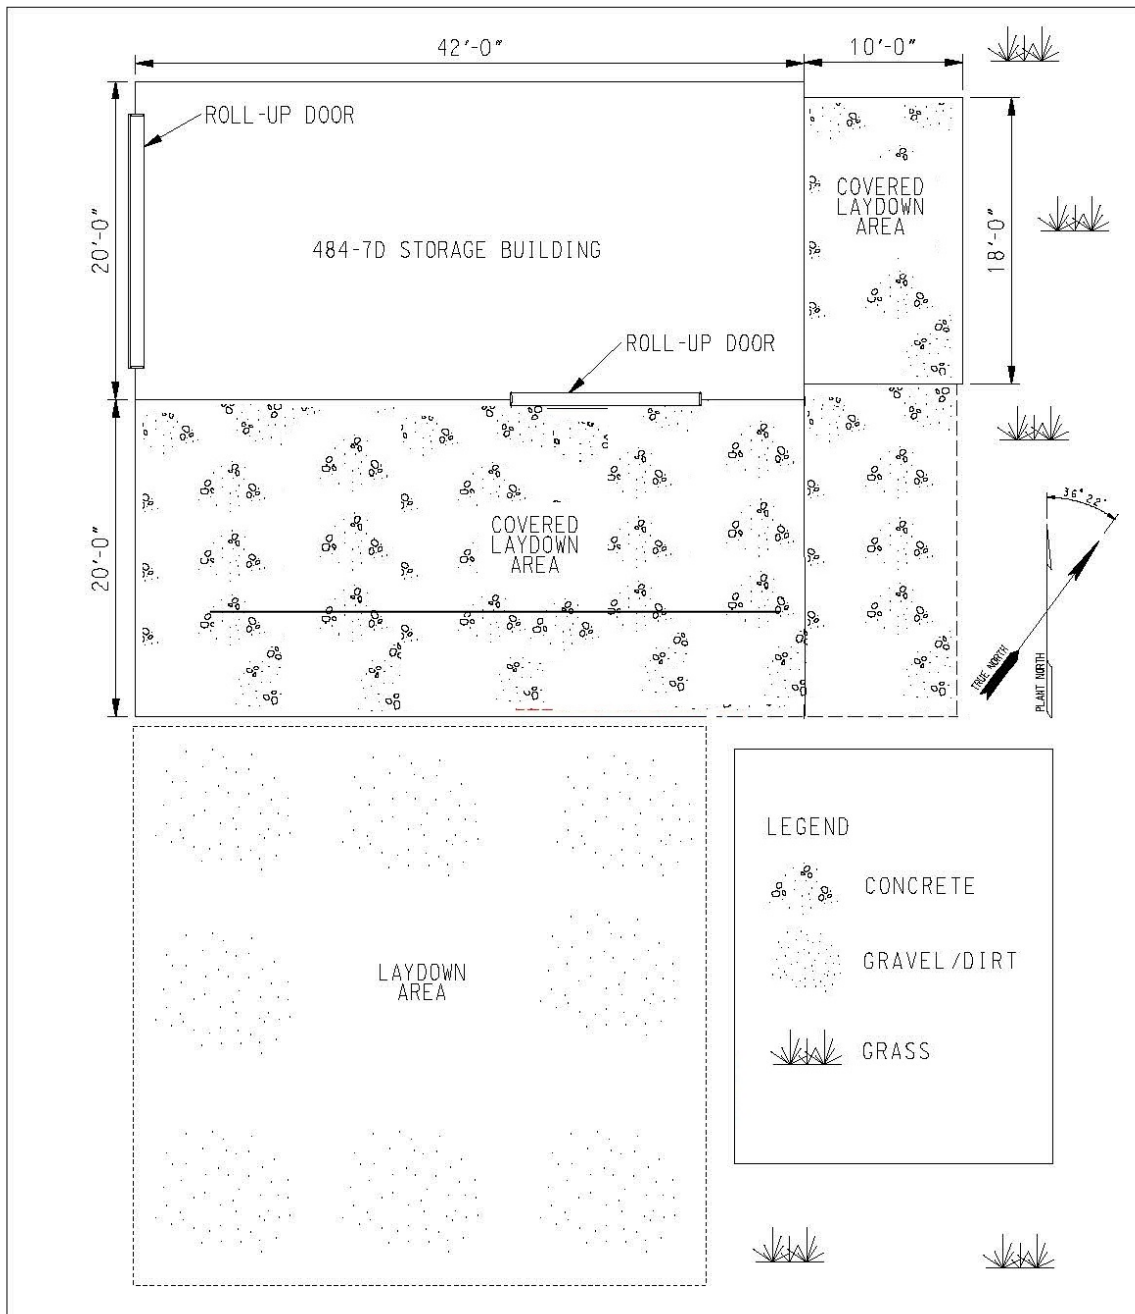
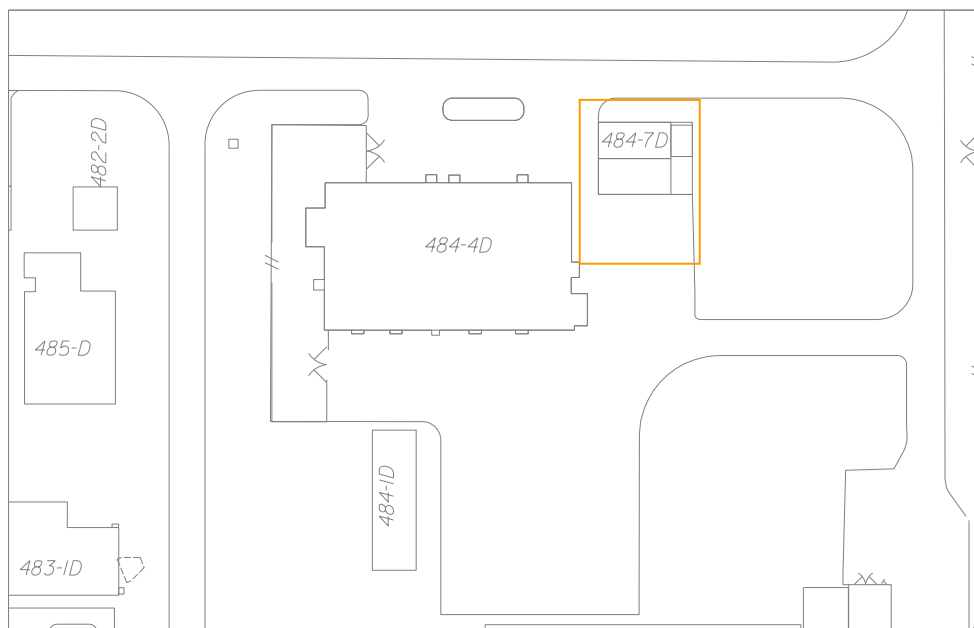


Figure 2. Building 484-7D, Storage Building (Layout)



**Figure 3. Building 484-7D, Storage Building Area Layout**

### Process History

Review of records, walk downs and interviews indicate that no chemical or radioactive processes were performed in this building (i.e., no chemical, mechanical, or electrical energy or interaction was performed to change the state of an input material or to produce a new output product).

Historically, Building 484-7D was used for storage of equipment for the 484-D Powerhouse. During deactivation of the 484-D D-Area Powerhouse and Ancillary Buildings in 2012, minor amounts of oil that had leaked from fork trucks or other machinery onto the slab were cleaned up; however, there appears to be minor staining in various places (Figure 4). The stains on the concrete will be pressure washed and cleaned with BioSolve® or equivalent surfactant during decommissioning of the structure.

The covered lay-down pad on the east side of the structure currently has an overpack container that also belongs to CRO (Figure 4). The overpack container will be removed and properly dispositioned prior to building decommissioning. The uncovered concrete pad south of this pad appears to have discoloration due to vehicle traffic. Any stains on the concrete will be spray washed and cleaned with BioSolve® or equivalent surfactant during decommissioning of the structure.

Abutting the larger covered pad is an uncovered gravel/dirt lay-down area that was used for temporary storage. There is no evidence of spills in uncovered laydown area.

There are no sumps or drains associated with the structure. The integrity of the concrete slabs is good. There are no apparent cracks in the slab that could convey spills to the soil underneath.



**Figure 4. Building 484-7D, Storage Building Covered Lay-down Areas**

**Chemical Process**

Chemical Name	Process Location	Evidence of Spills?
N/A	N/A	N/A

N/A – not applicable

**Radioactive Process**

Isotope	Contaminated Areas/Others
N/A	N/A

N/A – not applicable

## Summary of Existing Characterization

Characterization has been accomplished using a combination of process knowledge/historical release information, verification walk downs and a review of S-EHA-D-00001, “Hazards Survey for D-Area” (Reference 5).

An important part of the characterization portion of this evaluation is a historical review of spills/releases to the environment. This review includes a review of the Savannah River Site (SRS) Occurrence Reporting and Processing System/Site Item Reportability and Issue Management (ORPS/SIRIM) database conducted from the effective date of the Federal Facility Agreement (FFA), August 16, 1993 to present and a review of the FFA. The FFA serves as a review of releases/spills to the environment prior to August 16, 1993.

Review of the FFA, the SRS ORPS/SIRIM database and SRS spill files reveal no records of spills having occurred at the 484-7D structure.

An asbestos survey of the building was conducted on October 18, 2019 and no areas tested positive for asbestos containing materials (ACM). The results of that survey are included in Q-APG-D-00004, “Baseline Asbestos Inspection Report of Building 484-7D”, Reference 7. In accordance with 40 CFR part 61.145, a ten-day notification of demolition will be filed with SCDHEC prior to demolition, even though no asbestos is present

Wastes generated during decommissioning will be characterized and managed in accordance with SRS procedures and State and Federal regulations.

## Historical Significance

A review has been conducted in accordance with a Programmatic Agreement. This review resulted in the publication of the SRS’s Cold War Built Environment Cultural Resources Management Plan (Reference 4), in which the facilities with historical significance are listed. This facility is not listed in that reference and therefore is not historically significant.

## Part 2. Evaluation

Clean Facilities				
	Question	Yes	No	Justification
1.	Has the facility ever contained or processed radioactive or hazardous material other than stored packaged material or materials of construction? <i>If yes, go to question 4.</i>		X	Facility is a standard storage structure. There is no evidence of radioactive or hazardous material processing or processing equipment within the structure. None of the available information or personnel interviews indicate the structure was ever used for anything except storage.
2.	If there was stored packaged material, has there ever been a spill? <i>If No or N/A, this is a Simple Model. Stop.</i>	X		The spills in the facility appear to be lubricating and/or hydraulic oil from fork truck leaks.
3.	Was spill confined inside structure and cleaned to free release standard per Radiological Control Manual 5Q (for radiological) or continued occupancy per Industrial Hygiene Manual 4Q (for hazardous)? <i>If Yes, this is a Simple Model. Stop.</i>	X		Spills in the area of the structure appear to originate from fork truck oil leaks and have been cleaned up. Stained areas will be cleaned with BioSolve® or equivalent surfactant during decommissioning. There is no evidence of radiological contamination.  <b>Building 484-7D will be a Simple Model decommissioning.</b>
Contaminated Facilities				
	Question	Yes	No	Justification
4.	Is the facility listed as a RCRA/CERCLA Unit in Appendix C of the SRS FFA? <i>If Yes, this is a CERCLA Model. Stop.</i>			N/A
5.	Is the facility listed as a Site Evaluation Area in Appendix G of the SRS FFA? <i>If Yes, this is a CERCLA Model. Stop.</i>			N/A
6.	Is there evidence that there has been a release of hazardous or radioactive materials outside the structure? <i>If Yes, this is a CERCLA Model. Stop.</i>			N/A
7.	Is there a substantial threat of a release of hazardous or radioactive materials outside the structure? <i>If Yes, this is a CERCLA Model. Stop.</i>			N/A
8.	Has the facility been assigned a hazard category as defined in Facility Safety Document Manual 11Q? <i>If No, stop and refer facility for evaluation to assign a hazard category, then proceed</i>			N/A

Contaminated Facilities ( <i>cont'd</i> )				
	Question	Yes	No	Justification
9.	Is the hazard category Nuclear (HC- 2 or 3), radiological, or high hazard chemical? <i>If Yes, this is a CERCLA Model. Stop</i>			N/A
10.	Has the Department of Energy-Savannah River directed that the decommissioning be performed using the CERCLA Model? <i>If yes, this is a CERCLA Model. Stop</i>			N/A
12.	Is the facility a formerly nuclear, radiological, or high-hazard chemical facility? <i>If Yes, this is an Integrated Sampling Model. Stop.</i>			N/A
13.	Has Environmental Compliance and Area Completion Project's Regulatory Support Group determined that a final survey is not required for this facility? <i>If Yes, this is a Simple Model. If No, this is an Integrated Sampling Model. Stop</i>			N/A

N/A – not applicable

## Part 3. Review of Existing Records

The following facility records were reviewed as a part of this evaluation:

Ref #	Document No.	Revision/Date	Title
1	SRNS-RF-2008-00086-000-M&O	Revision 19-01-MO, Feb. 14, 2019	Standard Requirements Identification System FA00 Facility List.
2	WSRC-OS-94-42	Rev 0, Aug. 16, 1993 All updates through Sept. 21, 2018, including Rev. 0 Appendices C, G and K for Fiscal Year 2019	FFA for the SRS, Administrative Document No. 89-05-FF
3	N/A	N/A / Since 1993	D-Area SIRIM and ORPS reports 08/1993 to 02/2009.
4	N/A	Final January 26, 2005	SRS's Cold War Built Environment Cultural Resources Management Plan
5	S-EHS-D-00001, Rev 0	April, 2006	D-Area Hazards Survey
6	V-PCOR-D-00042	Rev. 0 / July 1, 2014	Deactivation Project Final Report Building 484-D Powerhouse and Ancillary Buildings
7	Q-APG-D-00004	Rev. 0, October 14, 2019	Baseline Asbestos Inspection Report of Building 484-7D